

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2014**

Published January 8, 2015

CHILD SEATS:

None during December 2014.

EQUIPMENT:

Velvac, Inc. (Velvac) is recalling certain warning triangle kits under brand name Velvac TO-502 Part No 90235 and brand name Torch Industrial TO-205 Part No. 090235, manufactured December 28, 2012, to April 10, 2014. These warning triangle kits do not comply with configuration, stability, color, and durability testing. Thus, these warning triangle kits fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) No. 125 "Warning devices." If the warning triangle fails to provide adequate stability and reflectivity when used outdoors, it can increase the risk of a vehicle crash. Velvac will notify owners, and dealers will replace the warning triangles, free of charge. The recall is expected to begin during January 2015. Owners may contact Velvac customer service at 1-262-787-7102.

14E-081

H&H Sports Protection (H&H) is recalling certain VCAN V528 helmets size XL manufactured April 1, 2008, to October 9, 2014. The helmet retention systems failed during high temperature testing. Also, the required labeling may not be found on the helmets. Thus, these helmets do not meet the requirements of Federal Vehicle Safety Standard (FMVSS) No. 218 "Motorcycle helmets." Failed helmet restraints can increase the risk of serious personal injury to the occupant. H&H will notify affected owners, retailers and dealers, and H&H will reimburse the full purchase price for the helmets. The recall is expected to begin in February 2015. Owners may contact H&H customer service at 1-858-680-8226 or at OP@HHsportsprotection.com.

14E-082

Cummins Inc. (Cummins) is recalling certain Cummins Emission Solution Ecofit Tier2 DOC Raincaps part numbers 4354195, A048L539, 4352927, A047A112, and 89486A manufactured December 17, 2012, to September 15, 2014. The affected raincaps are used on aftermarket exhaust systems. The raincap lid can become detached during transport or stationary engine operation causing water to enter the exhaust system. If the raincap lid detaches during transport it can fall into the roadway, increasing the risk of a vehicle. If the raincap lid detaches during stationary engine operation, it can fall increasing the risk of personal injury. Cummins will notify owners, and dealers will replace the raincap assembly, free of charge. The recall is expected to begin February 3, 2015. Owners may contact Cummins customer service at 1-812-377-5000. Cummins' number for this recall is C1583.

14E-083

ZF Group North America Operations (ZF Group) is recalling certain 9-Speed Automatic Transmissions. The automatic transmission parking pawl may have been contaminated during manufacturing and the park rod may become dislodged or broken. This may prevent the transmission from shifting into the Park position. The shift indicator may show that the vehicle is in Park but the park lock may not be engaged, allowing the vehicle to roll away unintentionally, increasing the risk of a crash. ZF Group has notified the vehicle manufacturers that purchased these transmissions. The vehicle manufacturers that installed these transmissions in their vehicle products will notify the affected vehicle owners and perform a free remedy on those vehicles. Owners may

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2014**

Published January 8, 2015

contact their vehicle manufacturer for more information. Owners may contact ZF Group customer service at 1-734-416-6200.

14E-084

Roadhouse Distribution Inc. (Roadhouse) is recalling certain Voss 888CF motorcycle helmets sizes XS-XXL manufactured June 1, 2013, to October 31, 2014. The affected helmets failed in penetration testing due to inadequate material in the helmet shell. Thus, these helmets fail to comply with Federal Motor Vehicle Safety Standard (FMVSS) No. 218, "Motorcycle helmets." The wearer of the helmet may not be adequately protected, increasing the risk of personal injury during a vehicle crash. Roadhouse will notify owners and resellers, and provide a replacement helmet free of charge. The safety recall is expected to begin February 2, 2015. Owners may contact Roadhouse Distribution Inc at 1-877-431-2453.

14E-085

Shark is recalling certain medium and extra large RAW motorcycle helmets manufactured August 22, 2013, to June 29, 2014. During testing, some of the affected helmets failed to conform to the impact attenuation requirements of Federal Motor Vehicle Safety Standard No. 218, "Motorcycle Helmets." By wearing a helmet that fails to meet impact requirements, the user may not be adequately protected in the event of a crash, increasing the risk of personal injury. Shark will notify owners and will direct owners to contact service provider Realtime Results who will replace the helmet, free of charge. The recall is expected to begin on January 20, 2015. Owners may contact Realtime Results at 1-888-770-7157.

14E-086

TIRES:

None during December 2014.

VEHICLES:

Heil Company (Heil) is recalling certain model year 2000-2014 Petroleum Pull Trailers manufactured August 29, 2000, to September 12, 2014. On the affected trailers, the cables of the secondary coupling system may fail to keep the trailer connected to the tow vehicle if the pintle hitch connection should fail. A failure of the cables of the secondary coupling system after the pintle hitch has become disconnected, could result in the trailer detaching from the tow vehicle, increasing the risk of a crash. Heil will notify owners and dealers and will install larger diameter secondary coupling cables, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Heil customer service at 1-800-400-6913.

14V-761

Mercedes-Benz USA, LLC (Mercedes) is recalling certain model year 2014-2015 E250 BlueTec, E250 BlueTec 4Matic, GLK250 4Matic BlueTec, and 2015 ML250 4Matic BlueTec vehicles manufactured February 28, 2014, to November 10, 2014. In the affected vehicles, oil may leak from around the chain tensioner gasket

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2014**

Published January 8, 2015

area. Leaking oil may drip onto a hot engine surface, increasing the risk of a fire. Additionally, the leaking oil may be a road hazard for other vehicles, increasing the risk of a crash. Mercedes will notify owners, and dealers will replace the chain tensioner gasket, free of charge. The recall began on December 19, 2014. Owners may contact Mercedes customer service at 1-800-367-6372. Mercedes' number for this recall is 2014120002.

14V-762

Subaru of America, Inc. (Subaru) is recalling certain model year 2003-2005 Legacy, Outback, Baja, 2004-2005 Impreza (including WRX/STI), and 2005 Saab 9-2X vehicles sold, or ever registered, in geographic locations associated with high absolute humidity. Specifically, vehicles sold, or ever registered, in Puerto Rico, Hawaii, the U.S. Virgin Islands, Guam, Saipan, American Samoa, Florida and adjacent counties in southern Georgia, as well as the coastal areas of Alabama, Louisiana, Mississippi and Texas. Upon deployment of the passenger side frontal air bag, excessive internal pressure may cause the inflator to rupture. In the event of a crash necessitating deployment of the passenger side frontal air bag, the inflator could rupture with metal fragments striking and potentially seriously injuring the vehicle occupants. Subaru will notify their owners and Saab owners will be notified by General Motors. Dealers will replace the passenger air bag inflator, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Subaru at 1-800-782-2783. Owners of Saab vehicles should call toll-free 1-800-955-9007. Subaru's number for this recall is WQP-51. Note: This recall supersedes recall 14V-471.

14V-763

Mercedes-Benz USA, LLC - DBA Sprinter (Mercedes) is recalling certain model year 2014-2015 Sprinter 2500, and Sprinter 3500 vehicles manufactured February 28, 2014, to November 21, 2014. In the affected vehicles, oil may leak from around the chain tensioner gasket area. Leaking oil may drip onto a hot engine surface, increasing the risk of a fire. Additionally, the leaking oil may be a road hazard for other vehicles, increasing the risk of a crash. Mercedes will notify owners, and dealers will replace the chain tensioner gasket, free of charge. The recall began on December 10, 2014. Owners may contact Mercedes customer service at 1-877-762-8267. Mercedes' number for this recall is 2014120003.

14V-764

Triumph Motorcycles America, LTD (Triumph) is recalling certain model year 2011-2014 Explorer motorcycles manufactured November 1, 2011, to June 1, 2014. The side stand pivot bolt may fracture. If the side stand pivot bolt fractures, the motorcycle may fall when parked on the side stand, increasing the risk of injury to someone nearby. Triumph will notify owners, and dealers will replace the side stand pivot bolt and lock nut, free of charge. The recall is expected to begin in December 2014. Owners may contact Triumph customer service at 1-678-854-2010. Triumph's number for this recall is SB518.

14V-765

Double K Inc. (Double K) is recalling certain Hometown Trolley Villager transit buses manufactured August 15, 2008, to May 24, 2014. The affected vehicles are equipped with certain model S2005, S2010, S5005, S5010, S5505, and S5510 wheelchair lifts manufactured by Ricon Corporation. The platform side plate of the affected wheelchair lifts may crack. If the platform side plates crack, the lift platform can separate from the lift and come to rest against the vehicle's lift door. When the doors are opened, the platform may fall out, increasing the risk of

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2014**

Published January 8, 2015

injury to the lift operator. Double K will notify owners to take buses to a Ricon dealer or service center who will install supplemental platform support bumpers. Any platform that has already started cracking will be replaced, free of charge. Owners may contact Double K customer service at 1-715-478-5090. Owners may contact Ricon customer service at 1-800-322-2884.

14V-766

Halcore Group, Inc. (Halcore) is recalling certain model year 2006-2013 American Emergency Vehicles (AEV) Ambulance Wheelchair Vans manufactured March 1, 2006, to March 31, 2013, equipped with certain model S2005, S2010, S5005, S5010, S5505, and S5510 wheelchair lifts manufactured by Ricon Corporation. The platform side plate of the affected wheelchair lifts may crack. If the platform side plates crack, the lift platform can separate from the lift and come to rest against the vehicle's lift door. When the doors are opened, the platform may fall out, increasing the risk of injury to the lift operator. Halcore will notify owners to take their vans to a Ricon dealer or service center who will install supplemental platform support bumpers. Any platform that has already started cracking will be replaced, free of charge. The recall began on December 10, 2014. Owners may contact American Emergency Vehicles at 1-800-374-9749 or Ricon customer service at 1-800-322-2884.

14V-767

Temsa Global Sanayi Ve Ticaret A.S.(Temsa) is recalling certain model year 2014-2015 TS45 motorcoaches manufactured April 1, 2014, to November 30, 2014. Due to a headlamp control module malfunction, the headlamps and daytime running lamps may fail while driving. If the headlamps and daytime running lamps fail while driving, there would be a loss of visibility, increasing the risk of a crash. Temsa will notify owners, and CH Bus Sales dealers will remove the affected headlamp control module and update the buses software, free of charge. The recall began on December 9, 2014. Owners may contact CH Bus Sales, representatives of Temsa, at 1-407-271-8935.

14V-768

Nova Bus is recalling certain model year 2012 LFS transit buses manufactured June 27, 2012, to October 15, 2012, and equipped with slim flip-up seats. In the affected vehicles, the anchor rivnut may not properly secure one end of the seat to the bus wall. If the seat detaches from the wall, there is an increased risk of injury. Nova Bus will notify owners, and dealers will inspect and replace the anchor rivnut, as necessary, free of charge. The recall is expected to begin in January 2015. Owners may contact Nova Bus customer service at 1-800-350-6682. Nova Bus' number for this recall is CR3280.

14V-769

Chrysler Group LLC (Chrysler) is recalling certain model year 2003-2005 Dodge Ram 1500, 2500, and 3500, 2004-2005 Dodge Durango, 2005 Dodge Dakota, 2005 Dodge Magnum and 2005 Chrysler 300, 300C and 300 SRT8 vehicles originally sold, or ever registered, in geographic locations associated with high absolute humidity. Specifically, vehicles sold, or ever registered, in Alabama, Florida, Georgia, Hawaii, Louisiana, Mississippi, Texas, Puerto Rico, U.S. Virgin Islands, Saipan, Guam, and American Samoa are addressed by this recall. Upon deployment of the passenger side frontal air bag, excessive internal pressure may cause the inflator to rupture. In the event of a crash necessitating deployment of the passenger side frontal air bag, the inflator could rupture with metal fragments striking and potentially seriously injuring the vehicle occupants. Chrysler will

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2014**

Published January 8, 2015

notify owners, and dealers will replace the front passenger air bag inflator, free of charge. For vehicles that were sold, or are currently registered, in Florida, Puerto Rico, Hawaii, and the U.S. Virgin Islands, owners were notified and the recall began on December 5, 2014. For all other vehicles, Chrysler will notify owners and the recall will begin on, or around, early February 2015. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is P40 Expanded. Note: This recall supersedes the passenger air bag portion of recall 14V-354.

14V-770

Prevost Cars, Inc.(Prevost) is recalling certain model year 2009-2011 XL2, XL2 Shells, X3 Shell Converted Coaches, and X3 motorcoaches manufactured January 1, 2009, to December 31, 2011, and equipped with an automatic fire suppression system (AFSS) pressure tank in the engine compartment. The tank's pressure relief valve may not withstand the temperatures in the engine compartment, resulting in the venting of the extinguishing agent. If the event of a fire, if the pressure tank has previously vented, the system would not be functional to help extinguish the fire, increasing the risk of injury. Prevost will notify owners, and dealers will relocate the tank, free of charge. The recall is expected to begin February 2, 2015. Owners may contact Prevost customer service at 1-877-773-8678. Prevost's number for this recall is SR15-01.

14V-771

KTM North America, Inc. (KTM) is recalling certain model year 2015 Husqvarna FE 350 S and FE 351 S motorcycles manufactured from July 22, 2014, to July 23, 2014. In the forks of the affected motorcycles, the threaded connection between the piston rod and fork cap may not have been sufficiently tightened and therefore the piston rod could become stuck within the fork leg. If the piston rod detaches within the fork leg, the front suspension could malfunction and destabilize the motorcycle, increasing the risk of a crash. KTM will notify owners, and Husqvarna dealers will inspect the torque of the fork piston rod to the fork cap, correcting it as necessary, free of charge. The recall is expected to begin in January 2015. Owners may contact KTM customer service at 1-888-985-6090. KTM's number for this recall is TB 1503.

14V-772

Mazda North American Operations (Mazda) is recalling certain model year 2003-2006 Mazda6, and model year 2004-2005 RX-8, MPV, and B-series vehicles originally sold, or ever registered, in geographic locations associated with high absolute humidity. Specifically, vehicles sold, or ever registered, in Alabama, Florida, Georgia, Hawaii, Louisiana, Mississippi, Texas, Puerto Rico, Saipan and Guam. Upon deployment of the passenger side frontal air bag, excessive internal pressure may cause the inflator to rupture. In the event of a crash necessitating deployment of the passenger side frontal air bag, the inflator could rupture with metal fragments striking and potentially seriously injuring the vehicle occupants. Mazda will notify owners, and dealers will replace the front passenger air bag inflators, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Mazda customer service at 1-800-222-5500. Mazda's number for this recall is 8114L. Note: This recall supersedes safety recall 14V-344 as to the front passenger air bag inflators.

14V-773

Ford Motor Company (Ford) is recalling certain model year 2015 Ford Mustang vehicles manufactured

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2014**

Published January 8, 2015

September 25, 2014, to October 9, 2014. The fuel pressure sensor may not have been seated properly to the fuel jumper line, which may cause a fuel leak. A partially seated fuel pressure sensor could cause a fuel odor or a fuel leak, increasing the risk of a vehicle fire in the presence of an ignition source. Ford will notify owners, and dealers will replace the fuel jumper line, free of charge. The recall began on December 17, 2014. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 14S27.

14V-774

Jayco, Inc. (Jayco) is recalling certain model year 2015 Eagle HT FW 28.5RSTS "PR" trailers manufactured June 2, 2014, to October 28, 2014. Incorrect tire size information may be found on the tire label. Thus, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) No. 110, "Tire Selection and Rims for Passenger Cars." Replacing a tire based on an incorrect tire size could overload the trailer causing poor handling and increasing the risk of a crash. Jayco will mail new labels to registered owners with placement instructions. Owners can also request dealers to install the new label with the correct tire size ST225/75R15D, free of charge. The recall began on December 8, 2014. Owners may contact Jayco customer service at 1-800-283-8267. Jayco's number for this recall is 9901229.

14V-775

Doubletree RV (Doubletree) is recalling certain model year 2006-2013 Select Suite, Tradition, Mobile Suite, and Elite Suite recreational trailers manufactured January 1, 2006, to April 25, 2013 and equipped with Fastec-brand door locks. It may be possible to remove the key from the lock in a way that potentially jams the deadbolt. If the deadbolt jams, the interior side of the door lock may also jam. A person inside the travel trailer at the time will then be locked in and be unable to exit the vehicle without using the emergency exit, increasing the risk of injury. Doubletree will notify owners, and dealers will replace the cylinders, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Fastec directly at www.fastecindustrial.com or by calling toll free 1-800-837-2505, or Doubletree customer service at 1-260-562-1075.

14V-776

Ford Motor Company (Ford) is recalling certain model year 2014 Ford Transit Connect cargo vans manufactured August 9, 2013, to September 20, 2014. The affected vehicles are equipped with sliding door panels that may have an improper bond strength between the plastic panel and paint primer. This could cause the door panel to separate from the vehicle while driving. If the plastic sliding door panel separates while driving, it can increase the risk of a vehicle crash. Ford will notify owners, and dealers will reinstall the panel with proper materials, free of charge. The recall is expected to begin January 12, 2015. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 14S26.

14V-777

Pierce Manufacturing (Pierce) is recalling certain model year 2008-2011 Quantum fire apparatus manufactured February 21, 2008, to April 25, 2011. The mechanical springs used to return the accelerator pedal to idle after the driver lifts their foot off the pedal may break. If the springs break, the pedal may not return to idle once the driver lifts their foot off the pedal. This unintended acceleration increases the risk of a crash. Pierce will notify owners, and dealers will replace the throttle pedal assemblies, free of charge. The recall is expected to begin in

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2014**

Published January 8, 2015

January 2015. Owners may contact Pierce customer service at 1-888-974-3723. Pierce's number for this recall is 74B25.

14V-778

American Honda Motor Co. (Honda) is recalling certain model year 2015 Acura TLX V6 2WD vehicles manufactured July 14, 2014, to November 12, 2014, and certain 2015 TLX V6 SH-AWD vehicles manufactured August 26, 2014, to November 10, 2014. The automatic transmission parking pawl may become contaminated or the park rod may become dislodged or broken. This may prevent the transmission from shifting into the Park position. If the shift indicator displays "Park" but the park lock does not engage, the vehicle may roll away increasing the risk of a crash. Honda will notify owners, and dealers will inspect and replace the transmission if necessary, free of charge. The recall is expected to begin January 6, 2015. Owners may contact Honda customer service at 1-310-783-2000. Honda's number for this recall is JM8.

14V-779

Kingmor Supply, Inc. (Kingmor) is recalling certain model year 2006-2014 IC CE school buses manufactured from January 1, 2006, to October 31, 2014, and equipped with certain model S2005, S2010, S5005, S5010, S5505, and S5510 wheelchair lifts manufactured by Ricon Corporation. The platform side plate of the affected wheelchair lifts may crack. If the platform side plates crack, the lift platform can separate from the lift and come to rest against the vehicle's lift door. When the doors are opened, the platform may fall out, increasing the risk of injury to the lift operator. Kingmor will notify owners and Ricon will supply supplemental platform support bumpers. Any platform that has already started cracking will be replaced, free of charge. The recall began on December 18, 2014. Owners may contact Kingmor customer service at 1-800-782-4474, or Ricon at 1-800-322-2884.

14V-780

Halcore Group, Inc. (Halcore) is recalling certain model year 2012-2015 AEV Type 1 F-series manufactured January 1, 2013, to July 31, 2014. The affected vehicles are equipped with LiquidSpring-brand aftermarket suspension kits. The mounting bracket that attaches the suspension fluid tank to the frame may fail, allowing the fluid tank to separate from the vehicle. If the suspension fluid tank mount fractures and the tank separates from the chassis, the tank may become a road hazard, increasing the risk of a crash. Halcore will notify owners, LiquidSpring will install a re-designed bracket, free of charge. The recall began on December 17, 2014. Owners may contact Halcore customer service at 1-614-539-8181 or LiquidSpring at 1-765-474-7816.

14V-781

Starcraft RV (Starcraft) is recalling certain model year 2015 Travel Trailer 2JY 17SB manufactured August 27, 2014, to November 10, 2014. The tire labels contain incorrect tire pressure information. The label indicates 65 PSI when the correct tire pressure is 50 PSI. Thus, these vehicles fail to comply with Federal Motor Vehicle Safety Standard (FMVSS) No. 110 "Tire Selection and Rims for Passenger Cars." Incorrect tire pressure information may cause operators to over inflate the tire, increasing the risk of a tire blow out and a vehicle crash. Starcraft will mail new labels to owners with replacement instructions. Owners can also request dealers to install the new tire label, free of charge. The recall began on December 10, 2014. Owners may contact Starcraft customer service at 1-800-945-4787.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2014**

Published January 8, 2015

14V-782

ARBOC Specialty Vehicles, LLC (ARBOC) is recalling certain model year 2015 Spirit of Mobility transit buses manufactured June 23, 2014, to November 21, 2014. The affected vehicles were manufactured with driver side transition windows that were not safety stamped. Thus, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) No. 205 "Glazing Materials." A broken window can create glass shards, increasing the risk of personal injury. ARBOC will notify owners, and dealers will replace the window, free of charge. The recall began on December 19, 2014. Owners may contact ARBOC customer service at 1-574-825-1720. ARBOC's number for this recall is TSB1415.

14V-783

Hyundai Motor America (Hyundai) is recalling certain 1.6 liter model year 2015 Sonata vehicles manufactured August 29, 2014, to October 28, 2014. The affected vehicles may have been assembled with an incorrect left axle shaft which may result in the shaft separating from the transaxle differential. If the left axle shaft separates from the transaxle, the vehicle may stop moving, increasing the risk of a crash. Additionally, a separated axle shaft may allow the vehicle to roll away as the driver and other occupants exit the vehicle or anytime thereafter. A vehicle rollaway increases the risk of injury to exiting occupants and bystanders. Hyundai will notify owners, dealers will inspect and replace the axle shaft, as necessary, free of charge. Owners may contact Hyundai customer service at 1-800-633-5151. Hyundai's number for this recall is 126.

14V-784

Tishomingo Acquisition, LLC (Tishomingo) is recalling certain model year 2012-2015 Ox Trailers Quarter Frame dump trailers manufactured August 27, 2012, to December 1, 2014. The draft arm of the affected trailers may crack or break. If the draft arm breaks, a loss of vehicle control may result, increasing the risk of a crash. Tishomingo has notified owners, and will replace the draft arm, free of charge. The recall began on December 19, 2014. Owners may contact Tishomingo customer service at 1-800-255-4345.

14V-785

Ameritrans Bus, Inc. (Ameritrans) is recalling certain model year 2013-2014 F330 transit buses built on F550 chassis manufactured May 23, 2013, to March 19, 2014 and 2013 R330 transit buses built on Ram 5500 chassis manufactured September 1, 2014, to October 31, 2014. The affected vehicles are equipped with LiquidSpring-brand aftermarket suspension kits. The mounting bracket that attaches the suspension fluid tank to the frame may fail, allowing the fluid tank to separate from the vehicle. If the suspension fluid tank mount fractures and the tank separates from the chassis, the tank may become a road hazard, increasing the risk of a crash. Ameritrans will notify owners, and LiquidSpring will install a re-designed bracket, free of charge. The recall began on December 22, 2014. Owners may contact Ameritrans customer service at 1-574-262-8935 or LiquidSpring at 1-765-474-7816.

14V-786

Ford Motor Company, (Ford) is conducting a regional recall for certain model year 2004-2005 Ford Ranger and 2005-2006 Ford GT vehicles originally sold, or ever registered, in geographic locations associated with high absolute humidity. Specifically, vehicles sold, or ever registered, in Florida, Hawaii, Puerto Rico, the

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2014**

Published January 8, 2015

U.S. Virgin Islands, Saipan, Guam, and American Samoa, as well as certain areas of Alabama, Mississippi, Louisiana, Texas, and Georgia, are included. Upon deployment of the passenger side frontal air bag, excessive internal pressure may cause the inflator to rupture. In the event of a crash necessitating deployment of the passenger side frontal air bag, the inflator could rupture with metal fragments striking and potentially seriously injuring the vehicle occupants. Ford will notify owners, and dealers will replace the inflators in all affected vehicles, free of charge. The recall is expected to begin in the latter part of January 2015. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 14S28. NOTE: This recall supersedes, in part, safety recall 14V-343 as to the front passenger air bag inflators only. The driver's air bag inflators will continue to be addressed by that recall.

14V-787

American Honda Motor Co. (Honda) is recalling certain model year 2015 Crosstour 4 Cylinder vehicles manufactured October 1, 2014, to November 4, 2014, Crosstour V6 2WD vehicles manufactured September 30, 2014, to November 13, 2014, and Crosstour V6 4WD vehicles manufactured September 30, 2014, to November 18, 2014. The inflator tube for the side curtain air bag may have been incorrectly manufactured. If the side curtain air bag does not properly inflate, it can affect the performance of the air bag in the event of a vehicle crash, increasing the risk of occupant injury. Honda will notify owners, and dealers will replace the left and/or right side curtain air bags, free of charge. The recall is expected to begin January 9, 2015. Owners may contact Honda customer service at 1-310-783-2000. Honda's number for this recall is JN0, JN1, and JN3.

14V-788

BMW of North America, LLC (BMW) is recalling certain model year 2014-2015 MINI Cooper Hardtop 2 Door, and Cooper S Hardtop 2 Door vehicles manufactured January 6, 2014, to October 17, 2014. During service appointments, dealers may have inadvertently reprogrammed the transmission control unit with software that may allow drivers to exit the vehicle when the transmission is not in Park. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) No. 114, "Theft Protection and Rollaway Prevention." If the driver exits the vehicle without the transmission being in Park, the vehicle could roll away as the driver and other occupants exit the vehicle or anytime thereafter. A vehicle rollaway increases the risk of injury to exiting occupants and bystanders. MINI will notify owners, and dealers will reprogram the transmission control module with the correct software, free of charge. The recall is expected to begin on February 1, 2015. Owners can contact MINI customer service at 1-866-825-1525.

14V-789

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain model year 2015 Jetta vehicles manufactured July 11, 2014, to November 13, 2014. Due to incorrect software within the headlight control module, the low beam headlights may turn off when high beam lights are turned on. As a result, the light output from the headlights may be insufficient. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) No. 108. "Lamps, Reflective Devices, and Associated Equipment." Insufficient headlight output may increase the risk of a crash. Volkswagen will notify owners, and dealers will update the headlight control module software, free of charge. The recall is expected to begin in January 2015. Owners may contact Volkswagen customer service at 1-800-893-5298. Volkswagen's number for this recall is 57F6.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2014**

Published January 8, 2015

14V-790

Hino Motor Sales U.S.A., Inc. (Hino) is recalling certain model year 2005-2015 Hino ND8J, NE8J, and NF8J trucks manufactured August 26, 2003, to May 14, 2014. In the affected vehicles, components of the parking brake handle assembly may wear, resulting in either the parking brake unexpectedly releasing when engaged or preventing the parking brake from fully engaging. Either parking brake condition may result in the vehicle rolling unexpectedly, increasing the risk of a crash. Hino will notify owners, and dealers will install a new parking brake lever that contains a two-way damper and a roller at the cable joining pin, free of charge. The recall is expected to begin on February 8, 2015. Owners may contact Hino customer service at 1-248-699-9330. Hino's number for this recall is A9970. Note: This recall supersedes 13V-614.

14V-791

American Honda Motor Co. (Honda) is recalling certain model year 2014 Acura RLX vehicles manufactured November 22, 2012, to January 30, 2014, 2015 Acura RLX vehicles manufactured June 4, 2014, to November 18, 2014, and 2014 Acura RLX Hybrid vehicles manufactured November 5, 2013, to July 25, 2014. An aluminum film applied to the inner reflector of the headlight may experience adhesion issues causing the film to delaminate. Thus, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) No. 108, "Lamps, reflective devices, and associated equipment." Delamination of the aluminum film may diminish output of the headlight, increasing the risk of a vehicle crash. Honda will notify owners, and dealers will replace both of the headlights, free of charge. The recall is expected to begin January 30, 2015. Owners may contact Honda customer service at 1-310-783-2000. Honda's number for this recall is JN2.

14V-792

Terex Advance (Terex) is recalling certain model year 2013-2015 Front Discharge Concrete Mixer Trucks manufactured August 20, 2012, to December 5, 2014. Due to improperly secured castellated retaining nuts on the front axle leaf spring rear pin and the steering system, the rear end of the front axle leaf spring may partially disconnect from the front suspension hanger. If the front axle spring becomes partially disconnected from the front suspension hanger, steering difficulty may result, increasing the risk of a crash. Terex will notify owners, and dealers will inspect and correct the retaining nut installation, as necessary, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Terex customer service at 1-800-433-6691.

14V-793

Harley-Davidson Motor Company (Harley-Davidson) is recalling certain model year 2012 FXST103, FLSTC, FLSTC103, FLSTF, FLSTF103, FXDL, FXDWG, FXDWG103, FXDC, FXDB, FLSTN, FLSTN103, FLSTC103Shrine, FLSTFB, FLSTFB103, FXS, FXS103, FLS, FLS103, FLD, FLD103, FXDF, and FXDF103 Dyna and Softail motorcycles manufactured August 22, 2011, through February 24, 2012. In the affected motorcycles, the threads for the brake line banjo bolt in the front brake master cylinder may corrode. If the threads corrode, a sudden loss of brake fluid could result, causing a loss of the front brakes, and increasing the risk of a crash. Harley-Davidson will notify owners, and dealers will flush and inspect the front brake master cylinder and, if necessary, replace the master cylinder, free of charge. The recall is expected to begin on January 14, 2015. Owners may contact Harley-Davidson customer service at 1-800-258-2464. Harley-Davidson's number for this recall is 0163 and 0164.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2014**

Published January 8, 2015

14V-794

Chrysler Group LLC (Chrysler) is recalling certain model year 2006-2007 Dodge Ram 1500, 2500, 3500, Dakota, and Mitsubishi Raider vehicles manufactured July 1, 2005, to July 31, 2006 with manual transmissions. The return springs in the clutch ignition interlock switch may break. Broken springs can result in a no-start condition, or cause unintended movement when the ignition is cranked, increasing the risk of a vehicle crash. Chrysler will notify owners, and dealers will replace the clutch ignition interlock switch, free of charge. The recall is expected to begin February 13, 2015. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is P80.

14V-795

Chrysler Group LLC (Chrysler) is recalling certain model year 2005 Dodge Ram 1500 trucks manufactured January 28, 2004, to August 3, 2005. In the affected vehicles, the rear axle pinion nut may loosen due to an undersized spline on the pinion gear. If the pinion nut loosens, the rear axle may seize, and/or the driveshaft may detach resulting in a loss of vehicle control, increasing the risk of a crash. Chrysler will notify owners, and dealers will install a retention feature to the pinion nut, free of charge. The recall is expected to begin February 13, 2015. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is P77.

14V-796

Blue Bird Body Company (Blue Bird) is recalling certain model year 2015 Vision non-school buses manufactured July 8, 2015, and All American non-school buses manufactured September 12, 2014. These buses, equipped with hydraulic brakes, may have an incorrectly manufactured parking brake pedal assembly which could separate and bend causing the parking brake not to engage properly. If the parking brake does not engage properly, the vehicle may unexpectedly move, increasing the risk of a vehicle crash. Blue Bird will notify owners, and dealers will inspect the date code on the parking brake pedal assembly and will replace the assembly if it is within that date range, free of charge. The recall is expected to begin on January 30, 2015. Owners may contact Blue Bird customer service at 1-478-822-2242.

14V-797

Blue Bird Body Company (Blue Bird) is recalling certain model year 2015-2016 Vision and All American school buses manufactured July 8, 2014, to September 22, 2014. These buses, equipped with hydraulic brakes, may have an incorrectly manufactured parking brake pedal assembly which could separate and bend causing the parking brake not to engage properly. If the parking brake does not engage properly, the vehicle may unexpectedly move, increasing the risk of a vehicle crash. Blue Bird will notify owners, and dealers will inspect the date code on the parking brake pedal assembly and will replace the assembly if it is within that date range, free of charge. The recall is expected to begin on January 30, 2015. Owners may contact Blue Bird customer service at 1-478-822-2242. Blue Bird's number for this recall is R14XR.

14V-798

Farber Specialty Vehicles (Farber) is recalling certain model year 2005-2008 Winnebago WFG38S vehicles manufactured January 1, 2008, to December 24, 2009 equipped with certain model S2005, S2010, S5005, S5010, S5505, and S5510 wheelchair lifts manufactured by Ricon Corporation. The platform side plate of the

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2014**

Published January 8, 2015

affected wheelchair lifts may crack. If the platform side plates crack, the lift platform can separate from the lift and come to rest against the vehicle's lift door. When the doors are opened, the platform may fall out, increasing the risk of injury to the lift operator. Farber will notify owners to take vehicles to a Ricon dealer or service center who will install supplemental platform support bumpers. Any platform that has already started cracking will be replaced, free of charge. The recall is expected to begin January 6, 2015. Owners may contact Farber customer service at 1-800-331-3188, or Ricon customer service at 1-800-322-2884. Farber's number for this recall is 14E-041.

14V-799

Chrysler Group LLC (Chrysler) is recalling certain model year 2015 Dodge Dart Aero vehicles manufactured August 24, 2014, to October 28, 2014. The affected vehicles were built with a premium instrument cluster and Lowline Tire Pressure Monitoring System (TPMS). The TPMS warning light may not illuminate when low tire pressure is detected. Thus, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) No. 138, "Tire pressure monitoring systems." A malfunctioning TPMS light will not notify an owner of an improperly inflated tire. An improperly inflated tire may experience a complete loss of tire pressure, increasing the risk of a vehicle crash. Chrysler will notify owners, and dealers will reconfigure the vehicles from a lowline TPMS to a highline TPMS, free of charge. The recall is expected to begin February 13, 2015. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is P76.

14V-800

Ferrara Fire Apparatus, Inc. (Ferrara) is recalling certain model year 2014 Ferrara Fire Custom trucks manufactured from August 1, 2014, to September 30, 2014. The Cummins ISB or ISL engines in these vehicles may have been equipped with Fleetguard UFF-XT fuel filters, part number FF63009, whose filter shell may separate from the fuel filter nut plate causing the engine to stall without warning. If the engine stalls unexpectedly there is an increased risk of a crash. All of the affected vehicles have been repaired, therefore, a recall notification notice will not be issued for this campaign. Owners may contact Ferrera at 1-800-443-9006 or Cummins customer service at 1-800-223-4583. Cummins' number for this recall is C1545.

14V-801

Ford Motor Company (Ford) is recalling certain model year 2005-2008 Ford Mustang vehicles manufactured August 1, 2004, to June 30, 2007, and 2005-2006 Ford GT vehicles manufactured February 11, 2005, to January 30, 2006. Upon deployment of the driver side frontal air bag, excessive internal pressure may cause the inflator to rupture. In the event of a crash necessitating deployment of the driver side frontal air bag, the inflator could rupture with metal fragments striking and potentially seriously injuring the vehicle occupants. Ford will notify owners, and dealers will replace the driver side frontal air bag inflator, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 14B09.

NOTE: This recall supersedes, in part, safety recall 14V-343 as to the front driver air bag inflators in 2005-2008 Ford Mustang and 2005-2006 Ford GT vehicles only. The driver's air bag inflators in 2004-2005 Ford Rangers originally sold, or ever registered in, certain hot and humid locations will continue to be addressed by that recall.

14V-802

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2014**

Published January 8, 2015

Nissan North America, Inc. (Nissan) is recalling certain model year 2015 Nissan Armada vehicles manufactured September 15, 2014, to October 14, 2014. In the affected vehicles the parking pawl may not engage completely, due to the parking rod not completing the stroke from interference with the transmission housing. If the parking pawl doesn't completely engage it can cause the vehicle to move from the "Park" position, increasing the risk of a vehicle crash. Nissan will notify owners, and dealers will inspect the casting date stamp of the transmission housing, and replace with a new one if it is within the affected range, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Nissan customer service at 1-800-647-7261.

14V-803

General Motors LLC (GM) is recalling certain model year 2015 Cadillac SRX vehicles manufactured November 11, 2014, to December 3, 2014. The front driver's seat may have been built with an incorrect seat track bracket. Drivers' seats with this condition may not be properly attached to the seat track. The front outboard seat bracket may become disengaged during a vehicle crash, increasing the risk of personal injury. GM will notify owners, and dealers will inspect and replace affected seat track hook brackets, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact GM customer service at 1-800-458-8006 (Cadillac). GM's number for this recall is 14863.

14V-804

ARBOC Specialty Vehicles, LLC (ARBOC) is recalling certain model year 2015 Spirit of Mobility, and Spirit of Freedom transit buses manufactured July 1, 2014, to December 12, 2014. In the affected vehicles, the exterior electrical connections for the side marker lights may not be weatherized. Exposed electrical connections may short, increasing the risk of a fire. ARBOC will notify owners, and dealers will install heat shrink to weatherize the connections, free of charge. The recall began on January 6, 2015. Owners may contact ARBOC customer service at 1-866-953-5555. ARBOC's number for this recall is RC056301.

14V-805

Navistar, Inc. (Navistar) is recalling certain model year 2015 International 9900, DuraStar, LoneStar, PayStar, ProStar, WorkStar, and TranStar trucks. The affected vehicles may experience brake drag due to an improperly seated diaphragm in the brake chamber. Brake drag may result in a wheel end fire. Navistar will notify owners, and dealers will inspect and replace the brake chambers, as necessary, free of charge. The recall is expected to begin on February 17, 2015. Owners may contact Navistar customer service at 1-800-448-7825. Navistar's number for this recall is 14523.

14V-806

Navistar, Inc. (Navistar) is recalling certain model year 2013-2015 International WorkStar vehicles manufactured March 16, 2012, to October 1, 2014. In the affected vehicles, the headlight low beam and ground circuits may have been reversed at the headlight connector resulting in reduced light output. As such, these vehicles fail to comply with Federal Motor Vehicle Safety Standard (FMVSS) No. 108, "Lamps, Reflective Devices, and Associated Equipment." Reduced light output may impair the driver's vision, increasing the risk of a crash. Navistar will notify owners, and dealers will correct the wiring in headlight harness connector, free of charge. The recall began on December 29, 2014. Owners may contact Navistar customer service at 1-

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2014**

Published January 8, 2015

800-448-7825. Navistar's number for this recall is 14525.

14V-807

Navistar, Inc. (Navistar) is recalling certain model year 2015-2016 IC CE school buses manufactured August 8, 2014, to October 23, 2014, and 2015 IC RE school buses manufactured on July 31, 2014. The affected vehicles may experience brake drag due to an improperly seated diaphragm in the brake chamber. Brake drag may result in a wheel end fire. Navistar will notify owners, and dealers will inspect and replace the brake chambers, as necessary, free of charge. The recall is expected to begin on February 17, 2015. Owners may contact Navistar customer service at 1-800-448-7825. Navistar's number for this recall is 14526.

14V-808

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain model year 2014-2015 Jetta vehicles manufactured March 28, 2014, to November 24, 2014, certain 2014-2015 Passat vehicles manufactured April 7, 2014, to November 18, 2014, certain 2015 Golf and GTI vehicles manufactured July 1, 2014, to November 20, 2014, and certain 2014-2015 Beetle and Beetle Convertible vehicles manufactured March 31, 2014, to November 27, 2014. A sealing cap at the fuel rail may fail, allowing fuel to leak into the engine compartment. A fuel leak, in the presence of an ignition source, can result in a vehicle fire. Volkswagen will notify owners, and dealers will replace the fuel rails with new parts, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Volkswagen customer service at 1-800-822-8987. Volkswagen's number for this recall is 24Bi.

14V-809

PACCAR Incorporated (PACCAR) is recalling certain model year 2015 Peterbilt 367, 389, 567, 579, and 587 trucks manufactured from May 30, 2014, to October 24, 2014, and 2015 Kenworth T270, T370, T440, T470, T660, T680, T800, T880, and W900 trucks manufactured from May 23, 2014, to October 29, 2014, equipped with certain air brake actuators. The affected vehicles may experience brake drag due to an improperly seated diaphragm in the brake chamber. Brake drag may result in a wheel end fire. Kenworth and Peterbilt will notify owners, and dealers will inspect and replace the brake chamber, as necessary, free of charge. The recall is expected to begin during February 2015. Owners may contact PACCAR customer service at 1-425-828-5000 (Kenworth), or 1-940-591-4000 (Peterbilt). PACCAR's number for this recall is 14KWP (Kenworth), and 1214L (Peterbilt).

14V-810

Suzuki Motor of America, Inc. (Suzuki) is recalling certain model year 2010-2013 SX4 vehicles manufactured July 16, 2009, to November 1, 2012, and 2010-2013 Kizashi vehicles manufactured October 13, 2009, to October 31, 2012. The shift selector can be moved out of the "Park" position without depressing the brake pedal. If the shift selector is moved out of the "Park" position while the brake pedal is not depressed, the vehicle may unexpectedly roll, increasing the risk of a vehicle crash. Suzuki will notify owners, and dealers will replace the shift selector assembly, free of charge. The recall is expected to begin January 19, 2015. Owners may contact Suzuki customer service at 1-714-996-7040. Suzuki's number for this recall is VL.

14V-811

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2014**

Published January 8, 2015

Spartan Motors, Inc. (Spartan) is recalling certain model year 2013-2015 Gladiator, K2, K3, MetroStar, and MM motorhome and emergency response chassis cabs manufactured November 28, 2012, to October 15, 2013. The castle nuts for the steering linkage may loosen, allowing the steering linkage to separate. If the steering linkage separates, a loss of steering control would occur, increasing the risk of a crash. Spartan will notify owners, and dealers will inspect and tighten the castle nuts, as necessary, free of charge. The recall is expected to begin on February 3, 2015. Owners may contact Spartan customer service at 1-517-543-6400. Spartan's number for this recall is 14023.

14V-812

Elgin Sweeper Company Inc. (Elgin) is recalling certain model year 2014 Elgin Eagle 4MF, and Road Wizard 4MW street sweepers manufactured October 3, 2014, to November 26, 2014. Due to the routing, the battery and the alternator wires may conduct higher current than designed, resulting in wire failure and charging system loss. The excessive current may result in melted wires and an electrical short, increasing the risk of a fire. Elgin has notified owners, and dealers will replace and reroute the affected wiring, free of charge. The recall began on December 18, 2014. Owners may contact Elgin customer service at 1-877-342-5374. Elgin's number for this recall is SB-0160.

14V-813

Caterpillar Inc. (Caterpillar) is recalling certain model year 2015 CT660, and CT681 trucks manufactured July 28, 2014, to November 5, 2014. The affected vehicles may experience brake drag due to an improperly seated diaphragm in the brake chamber. Brake drag may result in a wheel end fire. Caterpillar will notify owners, and dealers will inspect and replace the brake actuators, as necessary, free of charge. The recall is expected to begin on February 16, 2015. Owners may contact Caterpillar customer service at 1-309-675-5658. Caterpillar's number for this recall is 000387.

14V-814

BMW of North America, LLC (BMW) is recalling certain model year 2014 Mini Cooper Hardtop 2 door vehicles manufactured December 1, 2013, to May 14, 2014. The affected vehicles do not meet the side impact performance requirements for the rear seat passengers. Thus, these vehicles fail to comply with Federal Motor Vehicle Safety Standard (FMVSS) No. 214, "Side impact protection." If the side impact performance requirements are not met, rear seat passengers may be at a higher risk of injury during a crash. The remedy for this recall is still under development. The recall is expected to begin February 18, 2015. Owners may contact BMW customer service at 1-800-831-1117.

14V-815

Porsche Cars North America, Inc. (Porsche) is recalling certain model year 2015 Porsche 918 vehicles manufactured February 25, 2014, to September 18, 2014. The front lower control arms may fracture. The fracture of a lower control arm while the vehicle is being driven increases the risk of a crash. Porsche will notify owners, and dealers will replace the front lower control arms, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Porsche customer service at 1-800-767-7243. Porsche's number for this recall is AF01. Note: Owners are advised not to drive their vehicle until it has been remedied. Remedy parts are expected to be available at the end of February 2015.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2014**

Published January 8, 2015

14V-816

Chrysler Group LLC (Chrysler) is recalling certain model year 2004-2007 Dodge Ram 1500 and Durango, 2005-2007 Dodge Ram 2500, Charger, Magnum, Dakota, Chrysler 300, 300C, SRT8, 2006-2007 Dodge Ram 3500 and Mitsubishi Raider, and 2007 Chrysler Aspen. Upon deployment of the driver side frontal air bag, excessive internal pressure may cause the inflator to rupture. In the event of a crash necessitating deployment of the driver side frontal air bag, the inflator could rupture with metal fragments striking and potentially seriously injuring the vehicle occupants. Chrysler will notify owners, and dealers will replace the driver side frontal air bag inflator, free of charge. Some of the vehicles included in this recall were recalled under safety recall 14V-354, and that addresses vehicles sold, or currently registered, in Florida, Puerto Rico, Hawaii, and the U.S. Virgin Islands. Owners of those vehicles were notified earlier in December 2014. Chrysler has not determined a date for notifying the remaining owners of vehicles included in this national recall campaign. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is P81.

Note: This recall supersedes, in part, safety recall 14V-354 as to the driver's air bag inflators on the vehicles included in this recall.

14V-817

Mercedes-Benz USA, LLC. (MBUSA) is recalling certain model year 2015 E250 Diesel, E250 Blue Tec 4 Matic, E350 Sedan, E350 Sedan 4 Matic, E350 Wagon 4 Matic, E400 Sedan, E400 Sedan 4 Matic, E63 Sedan, and E63 Wagon vehicles manufactured October 8, 2014, to October 24, 2014. In the affected vehicles, the double seat belt buckle for the middle position of the rear passenger seat could fail under loading experienced in a severe frontal crash. If the middle position double seat belt buckle assembly fails under load such as in a severe frontal crash, there is an increased risk of injury to the seat occupant. MBUSA will notify owners, and dealers will replace the double seat belt buckle, free of charge. The recall is expected to begin in February 2015. Owners may contact MBUSA customer service at 1-800-367-6372. MBUSA's number for this recall is 2014120006.

14V-818

General Motors LLC (GM) is recalling certain model year 2015 Chevrolet Silverado 1500, and GMC Sierra 1500 vehicles manufactured November 24, 2014, to November 25, 2014. Due to an improper heat-treatment, the rear axle shaft may fracture while the vehicle is being driven. If the rear axle shaft fractures, the rear wheel may separate from the axle shaft, increasing the risk of a crash. GM will notify owners, and dealers will inspect the rear axles, and replace any that were improperly heat-treated, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact GM customer service at 1-800-222-1020 (Chevrolet) or 1-800-462-8782 (GMC). GM's number for this recall is 14892.

14V-819

General Motors LLC (GM) is recalling certain model year 2015 Chevrolet Silverado HD diesel vehicles manufactured September 30, 2014, to October 21, 2014, and GMC Sierra HD diesel vehicles manufactured October 8, 2014, to October 21, 2014. In the affected vehicles, the hose clamp that secures the fuel tank vent line may not have been properly tightened during assembly. A loose hose clamp could allow the fuel tank vent

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2014**

Published January 8, 2015

line to detach which may result in a fuel leak, increasing the risk of a fire. GM will notify owners, and dealers will inspect and tighten the fuel tank vent line hose clamp, as necessary, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact GM customer service at 1-800-222-1020 (Chevrolet), or 1-800-462-8782 (GMC). GM's number for this recall is 14855.

14V-820

Champion Bus, Inc. (Champion) is recalling certain model year 2012-2014 American Crusader, Challenger, Crusader, CTS-FE, CTS-RE, Defender, EZ-Street, HC American, HCAC, LF Transport, M1235, Platinum Shuttle, Stacked Rail, and Federal Coach Premier, and Spirit transit buses manufactured January 1, 2012, to October 1, 2014, equipped with certain triangle warning signs manufactured by Imperial Supplies, LLC. Test reports indicate that the triangle warning signs, labeled C&J, may reflect an inadequate amount of light. As such, these triangle warning kits fail to comply with Federal Motor Vehicle Safety Standard No. 125, "Warning devices." Warning triangles that do not properly reflect light may fail to warn others that a vehicle is parked, increasing the risk of a crash. Champion will notify owners to inspect their triangles for production dates between April 2011, to April 2014, and the affected triangles will be replaced, free of charge. The recall is expected to begin January 5, 2015. Owners may contact Champion customer service at 1-810-724-6474.

14V-821

Kia Motors America (Kia) is recalling certain model year 2010-2013 Kia Soul vehicles manufactured January 8, 2009, to October 2, 2013, equipped with a sun roof. A headliner plate may detach during deployment of the curtain air bag. A detached headliner plate may increase the risk of injury to the occupant during a vehicle crash. Kia will notify owners, and dealers will install industrial adhesive strips to secure the headliner plates, free of charge. The recall is expected to begin February 2, 2015. Owners may contact Kia customer service at 1-800-333-4542. Kia's number for this recall is SC112.

14V-822

Forest River, Inc. (Forest River) is recalling certain model year 2015 Vibe VBT272BHS travel trailers manufactured July 15, 2014, to December 19, 2014. These trailers may have incorrect tire size and tire pressure information on the Federal Certification and Tire labels. The information on the label lists the installed tires as ST225/75R15/C inflated to 50 PSI, however the tires that are actually mounted on the trailer are ST225/75R15/D inflated to 65 PSI. As such, these trailers fail to comply with Federal Motor Vehicle Safety Standard (FMVSS) number 110, "Tire Selection and Rims and Motor Home/Recreation Vehicle Trailer Load Carrying Capacity Information for Motor Vehicles with a GVWR of 4,536 Kilograms (10,000 Pounds) or Less." If the tires are replaced with the tires indicated on the label, the tires may be insufficient to carry the load and a tire blow out may result, increasing the risk of a crash. Forest River will send new labels to dealers and owners with the correct tire information, free of charge. The recall is expected to begin on January 5, 2015. Owners may contact Forest River customer service at 1-206-593-4005. Forest River's number for this recall is 59-12232014.

14V-823

Porsche Cars North America, Inc. (Porsche) is recalling certain model year 2015 Cayenne Diesel and Cayenne S vehicles manufactured November 26, 2014, to November 27, 2014. Due to a manufacturing error, the

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2014**

Published January 8, 2015

suspension alignment on the front and rear axles may not have been performed correctly and the screw connections of the camber, toe and caster may not have been tightened with the specified torque. If the suspension alignment was incorrectly performed, vehicle handling could be reduced, increasing the risk of a crash. Porsche will notify owners, and dealers will perform a front and rear suspension alignment, and check the screw connections for the proper torque, retightening as necessary, free of charge. The manufacturer has not yet provided a notification date. Owners may contact Porsche customer service at 1-800-767-7243. Porsche's number for this recall is AF04.

14V-824

Dodgen Industries, Inc. (Dodgen) is recalling certain model year 2006-2014 Dodgen Mobile Tech. Mobility RV's manufactured January 1, 2006, to November 24, 2014, equipped with certain model S2005, S2010, S5005, S5010, S5505, and S5510 wheelchair lifts manufactured by Ricon Corporation. The platform side plate of the affected wheelchair lifts may crack. If the platform side plates crack, the lift platform can separate from the lift and come to rest against the vehicle's lift door. When the doors are opened, the platform may fall out, increasing the risk of injury to the lift operator. Dodgen will notify owners to take their RV's to a Ricon dealer or service center who will install supplemental platform support bumpers. Any platform that has already started cracking will be replaced, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Dodgen customer service at 1-515-332-3755, or Ricon customer service at 1-800-322-2884.

14V-825

Dodgen Industries, Inc. (Dodgen) is recalling certain model year 2014-2015 Born Free RV and Born Free Mobility RV vehicles manufactured from September 13, 2014, to December 22, 2014, and equipped with Liquid Spring-brand aftermarket suspension kits. The mounting bracket that attaches the suspension fluid tank to the frame may fail allowing the fluid tank to separate from the vehicle. If the suspension fluid tank mount fractures and the tank separates from the chassis, the tank may become a road hazard, increasing the risk of a crash. Dodgen will notify owners, and dealers will install a new re-designed bracket, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Dodgen customer service at 1-515-332-3755 or LiquidSpring at 1-765-474-7816. Dodgen's number for this recall is 14E-034.

14V-826

General Motors LLC (GM) is recalling certain model year 2011-2012 Cadillac Escalade, Escalade ESV, Escalade EXT, Chevrolet Avalanche, Silverado HD, Silverado LD, Suburban, Tahoe, GMC Sierra LD, Sierra HD, Yukon, and Yukon XL vehicles. In the affected vehicles, the ignition lock actuator may bind, making turning the key difficult or causing the ignition to get stuck in the "Start" position. If stuck in the "Start" position, the ignition may suddenly snap back into the "Accessory" position, causing a loss of engine, steering, and braking power, increasing the risk of a vehicle crash. If the vehicle is in a crash, the air bags may not deploy, increasing the risk of occupant injury. GM will notify owners, and dealers will inspect and replace the ignition lock housing, as necessary, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact GM customer service at 1-800-458-8006 (Cadillac), 1-800-222-1020 (Chevrolet), or 1-800-462-8782 (GMC). GM's number for this recall is 14696 for the original equipment, and 14912 for the service replacement parts.

14V-827

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2014**

Published January 8, 2015

Southeast Toyota Distributors, LLC (SET) is recalling certain model year 2014-2015 Toyota 4Runner, Tacoma, FJ Cruiser, Land Cruiser, RAV4, Scion FRS, and XB vehicles. The affected vehicles may have accessories installed by SET, such as running boards or other items, that were incorrectly installed. The accessory attaching fasteners were not tightened with the proper torque, possibly causing the accessory to detach from the vehicle. Accessories that detach from a vehicle may result in a vehicle crash and/or personal injury. SET will notify owners, and dealers will inspect and tighten the affected bolts, free of charge. The recall is expected to begin February 9, 2015. Owners may contact SET customer service at 1-866-405-4226. SET's number for this recall is SET-14B.

14V-828

Spartan Motors, Inc. (Spartan) is recalling certain model year 2015 K3 Chassis manufactured November 22, 2013, to October 28, 2014. The steering slip shaft, located between the steering column and steering gear, may prematurely wear. Premature wear of the steering slip shaft may increase the risk of a vehicle crash. Spartan will notify owners, and dealers will replace the affected slip shaft, free of charge. The recall is expected to begin February 27, 2015. Owners may contact Spartan customer service at 1-517-543-6400. Spartan's number for this recall is 14022.

14V-829

Subaru of America, Inc. (Subaru) is recalling certain model year 2008-2011 Impreza, 2008-2014 WRX and STI, and 2009-2013 Forester vehicles, currently, or formerly, registered in Connecticut, Delaware, Illinois, Indiana, Iowa, Maine, Maryland, Massachusetts, Michigan, Minnesota, Missouri, New Hampshire, New Jersey, New York, Ohio, Pennsylvania, Rhode Island, Vermont, West Virginia, Wisconsin and the District of Columbia that were remedied under recall 14V-311 prior to December 23, 2014. The brake lines may experience brake line corrosion due to salt water splashing on the brake lines through a gap in the fuel tank protector. Brake fluid may leak due to the brake line corrosion and may result in longer distances being required to slow or stop the vehicle, increasing the risk of a crash. Subaru will notify owners, and dealers will apply an anti-corrosion wax to the four-way joint connector area of the brake line system, free of charge. The recall is expected to begin on January 26, 2015. Owners may contact Subaru customer service at 1-800-782-2783. Subaru's number for this recall is WQQ-52. Notes: This recall is specific to affected Forester, Impreza, WRX, and STI customers who had their car remedied under NHTSA recall no. 14V-311 prior to December 23, 2014. Subaru has determined that this remedy was inadequate due to incomplete repair instructions provided to dealers. Affected Forester, Impreza, WRX, and STI vehicles that were not repaired under NHTSA recall no. 14V-311 prior to December 23, 2014 will continue to be processed under NHTSA recall no. 14V-311. Affected vehicles not currently, or formerly, registered in the salt belt states identified in this recall are eligible for repair, at no cost to the customer, upon request.

14V-830