

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING DECEMBER 2015**

*Published January 15, 2016*

**CHILD SEATS:**

None during December 2015.

**EQUIPMENT:**

American Grease Stick Company (AGS) is recalling certain bottles of Carquest DOT5 Silicone Brake Fluid manufactured October 9, 2013, to July 8, 2015. The affected bottles may not clearly show the minimum wet equilibrium reflux boiling point (ERP) rating, and may not contain the words "Motor Vehicle" on the label where the bottle identifies the contents as DOT Brake Fluid. As such, these bottles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 116, "Motor Vehicle Brake Fluids." If a customer were confused by the label, they might use the wrong brake fluid, which could result in decreased braking performance and thereby increase the risk of a crash. AGS will notify purchasers and the bottles will be returned and relabeled with the correct label, free of charge. The recall began on December 23, 2015. Owners may contact AGS customer service at 1-800-253-0403.

**15E-093**

Vanguard National Parts OEX (Vanguard) is recalling certain SAF-Holland tapered axles, part numbers 24790745090, 24790175090, and 24790165090, manufactured January 17, 2012, to January 10, 2013. In the affected axles, the wheel end may separate from the axle due to an out of specification material thickness on the spindle. A wheel end that separates from the trailer axle increases the risk of a crash. Vanguard will notify owners, and the affected axles will be inspected and replaced as necessary, free of charge. The recall is expected to begin in January 2016. Owners may contact Vanguard customer service at 1-219-253-2000, or SAF-Holland customer service at 1-888-396-6501. Vanguard's number for this recall is 15E-080.

**15E-094**

**TIRES:**

Cooper Tire & Rubber Co. (Cooper) is recalling certain Cooper Zeon LTZ tires size 275/55R20 XL Extra Load tubeless tires manufactured September 1, 2015, to September 14, 2015. The affected tires may experience tread cracking or tread lug chunking during use. As such, these tires fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) No. 139, "New Pneumatic Radial Tires for Light Vehicles." Tread cracking or tread lug chunking may cause a loss of tire pressure, increasing the risk of a crash. Cooper will notify owners, and dealers will replace the tires, free of charge. The recall began on January 4, 2016. Owners may contact Cooper customer service at 1-800-854-6288. Cooper's number for this recall is 161.

**15T-022**

Hankook Tire America Corp. (Hankook) is recalling certain Ventus S1 Noble 2 tires, size 245/45R18 96W, manufactured May 20, 2013, to February 14, 2015, and size 245/40R19 94W and 275/35R19 96W tires manufactured May 22, 2013, to February 14, 2015 supplied for 2015 Hyundai Genesis vehicles as well as being sold as replacement tires. The affected tires may develop cracks in the tire sidewall, resulting in a loss of air. A

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING DECEMBER 2015**

*Published January 15, 2016*

loss of tire pressure may cause tire failure and a loss of vehicle control, increasing the risk of a crash. Hankook will notify the purchasers of the replacement tires and Hankook dealers will pay or credit the cost of the tire, free of charge. Owners of affected Hyundai vehicles will be notified by Hyundai and Hyundai dealers will replace the tires, free of charge. The recall began on December 18, 2015. Owners may contact Hankook customer service at 1-800-426-5665.

**15T-024**

**VEHICLES:**

General Motors LLC (GM) is recalling certain model year 2016 Chevrolet Colorado trucks manufactured August 25, 2015 to September 24, 2015, and GMC Canyon trucks manufactured August 28, 2015 to September 24, 2015. The affected vehicles have a console compartment lid latch assembly that may fail to keep the compartment door closed in the event of a crash. As such, these vehicles fail to comply with the requirements of the Federal Motor Vehicle Safety Standard (FMVSS) number 201, "Occupant Protection in Interior Impact." If the console compartment door does not remain closed in a crash, the contents stored in the console may strike the vehicle occupants, increasing their risk of injury. GM will notify owners, and dealers will replace the console compartment door latch assembly, free of charge. The recall began on January 5, 2016. Owners may contact Chevrolet customer service at 1-800-222-1020, or GMC customer service at 1-800-462-8782. GM's number for this recall is 16370.

**15V-807**

Newmar Corporation (Newmar) is recalling certain model year 2008-2014 King Aire, 2009-2014 Essex, 2011-2015 Mountain Aire, Ventana, and Dutch Star, 2012-2014 Ventana LE, 2012-2015 Canyon Star, and 2015 London Aire motorhomes. The affected vehicles are equipped with refrigerator door latches that may inadvertently lock without the operator's knowledge. If an individual climbed into the refrigerator and the door inadvertently latched, the person would not be able to open the door, increasing their risk of injury. Newmar will notify owners, and dealers will install a new replacement door latch that will not automatically latch, free of charge. The recall is expected to begin January 24, 2016. Owners may contact Newmar customer service at 1-800-731-8300.

**15V-808**

Altec Industries Inc. (Altec) is recalling certain model year 2011-2015 DC610 and DSC6 Brush Chippers manufactured June 1, 2011, to April 1, 2015. The affected brush chippers may have improper or missing welds. Additionally, the DSC6 chippers may be equipped with incorrect anvil spacers. Improper or missing welds and/or incorrect anvil spacers may cause the anvil to detach and interfere with the cutting blades, significantly damaging the chipper and increasing the risk of injury. Altec will notify owners, and dealers will inspect and repair any of the missing or incorrect anvil welds, and will replace the improper anvil spacers, free of charge. The recall is expected to begin January 5, 2016. Owners may contact Altec customer service at 1-800-860-0183. Altec's number for this recall is CSN 626.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING DECEMBER 2015**

*Published January 15, 2016*

**15V-810**

Ferrari North America, Inc. (FNA) is recalling certain model year 2016 California T vehicles manufactured September 8, 2015, to November 11, 2015. The affected vehicles have a low pressure fuel line that may not connect properly to the fuel pump feed pipe. The improper low pressure fuel line connection can result in a fuel leak in the engine compartment which may increase the risk of a fire. FNA has notified owners, and dealers will replace the low pressure fuel line assembly, free of charge. The recall began on December 18, 2015. Owners may contact Ferrari customer service at 1-201-816-2600.

**15V-811**

Ford Motor Company (Ford) is recalling certain model year 2013 Explorer, Explorer Police Utility, Taurus, Taurus Police Interceptor, Flex, Lincoln MKS, and Lincoln MKT vehicles. In the affected vehicles, the fuel delivery module may crack, allowing fuel to leak. A fuel leak in the presence of an ignition source may result in a fire. Ford will notify owners, and dealers will replace the fuel delivery module, free of charge. The recall began on December 21, 2015. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 13S04-S1.

**15V-812**

Ford Motor Company (Ford) is recalling certain model year 2013 Escape vehicles manufactured January 11, 2012, to April 1, 2013, and 2013-2014 Focus ST vehicles manufactured May 03, 2012, to October 14, 2013. Insufficient compression in the engine wiring harness splices to the Manifold Absolute Pressure (MAP) sensor may provide incorrect signals to the powertrain control module (PCM). The incorrect signals could cause the vehicle to hesitate or the engine to stall, increasing the risk of a crash. Ford will notify owners, and dealers will replace the current crimped splices with new splices, free of charge. The recall began on January 7, 2016. Owners may contact Ford customer service 1-866-436-7332. Ford's number for this recall is 14S17-S1.

**15V-813**

ShowHauler Trucks, Inc. is recalling one 2013 ShowHauler 20'6" msl recreational vehicle equipped with an Atwood on demand water heater (ODWH) model OD45, OD50, or OD50CW. The affected water heater has a water and gas valve that may cause the water heater to overheat the water in the hot water supply tap. The overheating of the water may result in the release of steam, possibly causing the operator is to scald themselves and increasing the risk of injury. Showhauler will notify the owner and Atwood will provide a remedy kit, free of charge. Owners may contact Atwood customer service at 1-574-264-2131 and/or ShowHauler customer service 1-574-825-6764.

**15V-814**

Mitsubishi Motors North America, Inc. (MMNA) is recalling certain model year 2014-2015 Mitsubishi Mirage vehicles manufactured August 7, 2013, to September 2, 2015 and originally sold in, or ever registered in, Connecticut, Delaware, Illinois, Indiana, Iowa, Kentucky, Maine, Maryland, Massachusetts, Michigan, Minnesota, Missouri, New Hampshire, New Jersey, New York, Ohio, Pennsylvania, Rhode Island, Vermont, Virginia, West Virginia, Wisconsin, and District of Columbia. If the driver enters an affected vehicle with their boots covered with snow mixed with road salt, the melting snow may soak through the carpet and cause

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING DECEMBER 2015**

*Published January 15, 2016*

corrosion to a wiring connector located in a junction box behind a kick panel to the left of the driver's footrest. In the event of a crash, corrosion of the connector could delay deployment of the frontal air bags, increasing the risk of injury to the driver and the front seat passenger. MMNA will notify owners, and dealers will inspect the affected connectors, replacing any found to be corroded. A waterproof sheet will be installed over the connectors to prevent future corrosion. These repairs will be performed free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact MMNA customer service at 1-888-648-7820. MMNA's number for this recall is SR-16-001.

**15V-815**

Daimler Trucks North America LLC (DTNA) is recalling certain model year 2013-2015 Freightliner Cascadia vehicles manufactured March 27, 2015, to November 4, 2014, and powered by compressed natural gas (CNG). The affected vehicles have a tailpipe that allows hot exhaust to exit near the CNG tank pressure relief device (PRD). Hot exhaust in close proximity to the PRD may cause the PDR to activate and CNG to be unexpectedly released from the tank. Discharge of CNG in the presence of an ignition source can increase the risk of a fire. DTNA will notify owners, and dealers will extend the tailpipe beyond the pressure relief device, free of charge. The recall is expected to begin February 1, 2016. Owners may contact DTNA customer service at 1-800-745-8000. DTNA's number for this recall is FL-695.

**15V-816**

Triple E Recreational Vehicles (Triple E) is recalling certain model year 2014 Regency GT 24MB motorhomes manufactured September 1, 2013, to December 1, 2013, equipped with certain Atwood on demand water heaters. The affected water heaters have a water and gas valve that may cause the water heater to overheat the water in the hot water supply tap. The overheating of the water may result in the release of steam, possibly causing the operator is to scald themselves, increasing the risk of injury. Triple E will notify owners and Atwood dealers will remedy the hot water heater issue, free of charge. The recall began on January 8, 2016. Owners may contact Triple E customer service at 1-204-325-4361, or Atwood customer service at 1-574-264-2131. Triple E's number for this recall is Atwood Water Heater.

**15V-817**

Tiny Idahomes LLC (Tiny Idahomes) is recalling certain model year 2014-2016 Clear Creek and Cascade vehicles manufactured May 1, 2014, to December 1, 2015, and 2015-2016 Carpathian vehicles manufactured May 1, 2015, to December 1, 2015, and equipped with certain Atwood on demand water heaters. The affected water heaters have a water and gas valve that may cause the water heater to overheat the water in the hot water supply tap. The overheating of the water may result in the release of steam, possibly causing the operator is to scald themselves and increasing the risk of injury. Tiny Idahomes will notify owners and Atwood dealers will remedy the hot water heater issue, free of charge. The recall began on January 6, 2016. Owners may contact Tiny Idahomes customer service at 1-208-468-0576, or Atwood customer service at 1-574-264-2131.

**15V-819**

Polaris Industries, Inc. (Polaris) is recalling certain model year 2015 GEM EL, ES, E4, E4S, ELXD, E6, E6S, and E2 vehicles manufactured December 15, 2014, to August 25, 2015. The seat belts in the affected vehicles

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING DECEMBER 2015**

*Published January 15, 2016*

have retractor mechanisms that may fail, causing the seat belt to be stuck in one position. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 209, "Seat Belt Assemblies." If the seat belt does not retract or extend, the seat occupant may not be properly secured in the event of a crash, increasing their risk of injury. GEM will notify owners, and dealers will replace the seat belt assemblies, free of charge. The recall began on December 31, 2015. Owners may contact GEM Consumer Service Department at 1-855-743-3436. Polaris' number for this recall is L-15-02.

**15V-820**

Honda (American Honda Motor Co.) is recalling certain model year 2010, 2012 and 2013 VFR1200F and VFR1200FD motorcycles. Manufacturing or assembly errors may result in the affected motorcycles having driveshaft universal joint bearings that may prematurely wear which can cause the universal joint to separate or break. If the universal joint separates, the motorcycle would stall. If the universal joint breaks, it may interfere with the swing arm and lock the rear wheel. Either condition could increase the risk of a crash. Honda will be notify owners, and dealers will replace the driveshaft, free of charge. The recall began on December 29, 2015, however parts may not be available until mid-2016. Owners may contact Honda customer service at 1-800-999-1009. Honda's number for this recall is JW2.

**15V-821**

Grand Design RV, LLC (Grand Design) is recalling certain model year 2016 Momentum trailers, models 397th, 398M, and 388M, manufactured September 2, 2015, to November 12, 2015. The affected trailers may be equipped with a Federal Certification Label that lists an incorrect unloaded vehicle weight (UVW), causing the cargo carrying capacity (CCC) to be overstated. As such, these vehicles fail to comply with the requirements of 49 CFR Part 567, "Certification." If the operator loads vehicle per the information on the label, the vehicle may exceed the Gross Vehicle Weight Rating (GVWR), thereby increasing the risk of a crash. Grand Design will notify owners, and dealers will install a corrected label, free of charge. The recall began on January 11, 2016. Owners may contact Grand Design customer service at 1-574-825-9679. Grand Design's number for this recall is 910005.

**15V-822**

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain model year 2012-2013 Audi A6 vehicles manufactured March 28, 2011, to March 25, 2013, and 2012-2013 Audi A7 vehicles manufactured January 25, 2011, to March 19, 2013. In vehicles with heated and cooled seats, the Passenger Occupant Detection System (PODS), used to enable the front passenger air bags, may malfunction and prevent the passenger-side air bags from deploying in a crash. An air bag that does not deploy as intended increases the risk of occupant injury in a crash. Volkswagen will notify owners, and Audi dealers will install a PODS system repair kit, free of charge. The recall is expected to begin in February 2016. Owners may contact Audi customer service at 1-800-253-2834. Volkswagen's number for this recall is 74D1.

**15V-823**

Volkswagen Group of America, LLC (Volkswagen) is recalling certain model year 2015 Audi A3 Cabriolet vehicles manufactured June 5, 2014, to April 1, 2015. The affected vehicles have a driver or front passenger seat whose cover may be incorrectly stitched, preventing the side air bag from properly deploying in the event of

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING DECEMBER 2015**

*Published January 15, 2016*

a crash. Improper side air bag deployment may increase the risk of injury in the event of a crash. Volkswagen will notify owners, and dealers will replace the driver's and/or front passenger's seatback cover, free of charge. The recall is expected to begin in February 2016. Owners may contact Audi customer service at 1-800-253-2834. Volkswagen's number for this recall is 74C9.

**15V-824**

Strick Trailers, LLC (Strick) is recalling certain model year 2007, 2009, and 2015 Dry Freight Van Trailers, equipped with rear impact guard gussets 59653 and 59654. These rear impact guard gussets increase the chances of injury in the event of a crash. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) No. 223, "Rear Impact Guards." If the rear impact guards do not meet safety standards, it can increase the risk of injury in the event of a crash. Strick will notify owners, and dealers will install reinforcements, or replace the rear impact guards, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Strick customer service at 1-704-436-2590.

**15V-825**

Chrysler (FCA US LLC) is recalling certain model year 2015-2016 Jeep Cherokee vehicles manufactured February 18, 2015, to September 10, 2015 and equipped with the power liftgate option. In the affected vehicles, water may leak into the Power Liftgate Control Module and result in a high resistance short circuit. A short circuit in the module increases the risk of a fire. Chrysler will notify owners, and dealers will inspect the module and connectors for corrosion, replacing the damaged components as necessary. The mastic shield will be removed and the module will be covered with a water shield. These repairs will be performed free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is R67.

**15V-826**

Ameritrans Bus, Inc. (Ameritrans) is recalling certain model year 2012-2014 CTV, 225, 200, 245, 285, 375, and 395 vehicles manufactured August 1, 2012, to July 10, 2014, equipped with certain model S2005, S2010, S5005, S5010, S5505, and S5510 wheelchair lifts manufactured by the Ricon Corporation. The affected lifts are equipped with folding link arms that may have pivot holes that are too big, allowing the bearings to move out of position. If the bearings move out of position, the stowed platform may have excessive movement resulting in failure of the platform mounting. This failure could cause the wheel chair lift platform to fall out of the vehicle when the doors are opened, increasing the risk of injury for the lift operator. Ameritrans will notify owners, and dealers will inspect the link arms for damage or for displaced bearings. The platform will be inspected for cracks. Any damaged parts will be replaced, free of charge. The recall is expected to begin in January 2016. Owners may contact Ameritrans customer service at 1-574-262-8935, or Ricon customer service at 1-800-322-2884.

**15V-827**

Halcore Group, Inc. (Halcore) is recalling certain model year 2015 Horton 623, 603, 503, 553 and 453 ambulances manufactured October 1, 2015, to November 16, 2015 and equipped with the i4G system for controlling the ambulance body electrics. Due to a circuit board component being installed incorrectly, the ambulance body may have electrical system failure of the interior and exterior lights, as well as other life saving

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING DECEMBER 2015**

*Published January 15, 2016*

electrical equipment such as the oxygen system. Failure of ambulance body electrics can hinder emergency response and/or rescue efforts, increasing the risk of injury to ambulance patients. Halcore will notify owners, and Horton will replace the affected electrical component, free of charge. The recall began on January 4, 2016. Owners may contact Horton customer service at 1-800-282-5113.

**15V-828**

Newmar Corporation (Newmar) is recalling certain model year 1997-2005 Dutch Star and Mountain Aire, 1998-1999 London Aire, 2004 Essex and 1997-1998 Kountry Aire motorhomes. The affected vehicles have a steering gear mounting bracket that may crack, causing a loss of steering ability. A loss of steering increases the risk of a crash. Newmar will notify owners, and Spartan dealers will replace the steering gear mounting brackets, free of charge. The recall is expected to begin February 5, 2016. Owners may contact Newmar customer service at 1-800-731-8300 or Spartan customer service at 1-800-543-4277. Newmar's number for this recall is 15V 633.

**15V-829**

General Motors LLC (GM) is recalling certain model year 2016 Chevrolet Silverado and GMC Sierra pick up trucks manufactured October 13, 2015, to October 14, 2015. In the affected vehicles, the mounting stud used to secure the air bag sensing and diagnostic Module (SDM) may be incorrectly positioned, and as a result, the SDM housing could fracture. If the SDM housing fractures, water may get into SDM causing it to malfunction and hinder the proper deployment of the air bags in the event of a crash, thereby increasing the risk of occupant injury. GM will notify owners, and dealers will have the mounting stud repositioned and the SDM replaced, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Chevrolet customer service at 1-800-222-1020 or GMC customer service at 1-800-462-8782. GM's number for this recall is 15794.

**15V-830**

Forest River, Inc. (Forest River) is recalling certain model year 2016 Evo, Salem, Sandstorm, Shockwave, Stealth, and Wildwood recreational trailers. The affected vehicles were mistakenly not equipped with a carbon monoxide detector to warn occupants of elevated levels of carbon monoxide. If occupants are not warned elevated carbon monoxide levels, they are at an increased risk of injury. Forest River will notify owners, and dealers will remove the existing Liquid Propane (L.P.) Detector and install a combination L.P./carbon monoxide detector, free of charge. The recall is expected to begin February 2, 2016. Owners may contact Forest River customer service at 1-909-873-3777, extension 53. Forest River's number for this recall is 51-12072015-0119.

**15V-831**

Roush Performance Products, Inc. (Roush) is recalling certain model year 2015 Ford Mustang GT Roush Stage 3 vehicles manufactured April 1, 2015, to October 31, 2015, and equipped with Roush Extreme Duty Half Shafts. The affected vehicles have a brake caliper guide pin that may not have been sufficiently tightened during installation of the half shafts. As a result, the caliper guide pin may loosen while driving, reducing the vehicle's rear braking ability. A partial loss of the rear braking system can increase the risk of a crash. Roush will notify owners, and Roush-authorized Ford dealers will tighten the caliper guide pin to the proper specification, free of

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING DECEMBER 2015**

*Published January 15, 2016*

charge. The recall is expected to begin during January 2016. Owners may contact Roush customer service at 1-800-597-6874.

**15V-832**

General Motors LLC (GM) is recalling certain model year 2016 Chevrolet Traverse, GMC Acadia, and Buick Enclave vehicles manufactured November 6, 2015, to November 12, 2015. The affected vehicles have a the third row left lower seat frame that may have welds that are not in the correction location. If the seat frame is not welded in the correct places, the seat may not perform as intended, and in the event of a crash, the seat occupant could be at an increased risk of injury. GM will notify owners, and dealers will inspect the third row left side lower seat frame, replacing it as necessary, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Chevrolet customer service at 1-800-222-1020, GMC customer service at 1-800-462-8782 or Buick customer service at 1-800-521-7300. GM's number for this recall is 21930.

**15V-833**

Highland Ridge RV (Highland) is recalling certain model year 2015 Open Range fifth wheels and 2015-2016 3X fifth wheels and Highlander travel trailers manufactured May 8, 2014, to December 4, 2015 and equipped with a side vented sewer drainage system termination valve. The affected vehicles may be missing a caution label to inform the operator not to leave the drain valve open to prevent an escape of sewer gas. If the drain valve is left open, sewer gas may fill the recreational vehicle, increasing the risk of occupant injury. Highland will notify owners and send them the missing label, free of charge. The recall is expected to begin in January 2016. Owners may contact Highland customer service at 1-260-768-7771. Highland's number for this recall is 9904272.

**15V-834**

Trail Boss Conversions, Inc. (Trail Boss) is recalling one model year 2013 Bloomer Horse Trailer manufactured October 1, 2013, to November 29, 2013, and equipped with an Atwood on-demand water heaters. The affected water heater has a water and gas valve that may cause the water heater to overheat the water in the hot water supply tap. The overheating of the water may result in the release of steam, possibly causing the operator is to scald themselves and increasing the risk of injury. Trail Boss will notify the owner and an Atwood dealer will install a remedy kit, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Trail Boss customer service at 1-816-690-7133, or Atwood customer service at 1-574-264-2131.

**15V-835**

McLaren Automotive Incorporated (McLaren) is recalling certain model year 2014-2015 P1 hybrid vehicles manufactured March 1, 2013, to October 31, 2015. The affected vehicles have a secondary hood latch that may not properly re-engage. As a result, if the primary latch is released inadvertently, the hood may open while the vehicle is moving. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 113, "Hood Latch System." If the hood opens while driving it may increase the risk of a crash. McLaren will notify owners, and dealers will replace the hood latch with a newly-designed latch, free of charge. The recall is expected to begin in January 2016. Owners may contact McLaren customer service at 1-646-429-8916.

**15V-836**



**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING DECEMBER 2015**

*Published January 15, 2016*

Motor Coach Industries (MCI) is recalling certain model year 2015 D4500 motor coaches manufactured January 23, 2015, to May 1, 2015, and D4505 motor coaches manufactured May 12, 2015, to May 13, 2015. The affected coaches have drive axles that may be missing welds on the hanger brackets, allowing the hanger bracket to separate from the axle housing. If the bracket separates from the axle housing, vehicle control may be affected, increasing the risk of a crash. MCI will notify owners, and dealers will inspect the coaches and replace the affected axles, free of charge. The recall began on January 4, 2016. Owners may contact MCI customer service at 1-800-241-2947. MCI's number for this recall is SB 429.

**15V-837**

Charmac Trailers Inc. (Charmac) is recalling certain model year 2015-2016 Horse and Cargo trailers manufactured March 16, 2015, to September 25, 2015, and equipped with certain 3500lb-capacity torsion model axles. The weld that secures the torsion arm assembly may fail allowing the tire, wheel, hub, and torsion arm to separate from the trailer. A separation of the torsion arm can result in a loss of trailer stability and control, increasing the risk of a crash. Charmac will notify owners, and dealers will replace the suspect axles, free of charge. The recall is expected to begin in January 2016. Owners may contact Charmac customer service at 1-208-733-5241.

**15V-838**

Altec Industries, Inc. (Altec) is recalling certain model year 2013-2014 Manitex/PM Knuckle Boom Cranes, 3852 series, manufactured January 1, 2013, to December 31, 2014. The affected vehicles have outriggers whose welds may crack causing the outriggers to fail. If the outriggers fail, the truck may tip over, increasing the risk of injury. Altec will notify owners, and dealers will inspect the outriggers and repair any cracks found, and install reinforcing collars, free of charge. The recall began on January 8, 2016. Owners may contact Altec customer service at 1-205-991-7733. A ltec's number for this recall is CSN 627.

**15V-839**

Open Range R.V. Company (Open Range) is recalling certain model year 2014-2015 3X recreational trailers, model 388RKS, manufactured June 12, 2013, to May 1, 2014, and equipped with a side vented sewer drainage system termination valve. The affected vehicles may be missing a caution label to inform the operator not to leave the drain valve open to prevent an escape of sewer gas. If the drain valve is left open, sewer gas may fill the recreational vehicle, increasing the risk of occupant injury. Open Range will notify owners and send them the missing label, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Open Range customer service at 1-260-768-7771.

**15V-840**

Great Dane Trailers (Great Dane) is recalling certain model year 2015-2016 Reefer semi trailers manufactured December 19, 2013, to June 28, 2015, and equipped with certain Meritor EX225L2, EX225L+, or Bendix ADB22X axles. The affected axle assemblies have caliper bolts that may not have been properly tightened, allowing the caliper mounting bolts to back out and the caliper to detach from the axle flange. If the caliper detaches from the axle flange, braking performance would be reduced, increasing the risk of a crash. Great Dane will notify owners, and dealers will inspect the caliper bolts, tightening them as necessary, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Great Dane customer service at

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING DECEMBER 2015**

*Published January 15, 2016*

1-912-232-4471, or Meritor customer service at 1-866-668-7221.

**15V-841**

Daimler Trucks North America, LLC (DTNA) is recalling certain model year 2016 Thomas Built Buses Saf-T-Liner C2 school buses manufactured May 1, 2015, to August 1, 2015. The affected buses are equipped with push-out tempered glass windows that may not remain attached to the bus in the event of a crash. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) No. 217, "Bus Emergency Exits and Window Retention and Release." In the event of a crash, the affected windows may not be able to retain the bus occupants, increasing their risk of injury. DTNA will notify owners, and dealers will modify the windows to ensure that they meet the window retention requirements, free of charge. The recall is expected to begin February 9, 2016. Owners may contact DTNA customer service at 1-800-745-8000. DTNA's number for this recall is FL-697.

**15V-842**

Daimler Trucks North America, LLC (DTNA) is recalling certain model year 2016-2017 Thomas Built Buses Saf-T-Liner C2, Saf-T-Liner HDX, Minotour DRW and Saf-T-Liner EFX school buses manufactured August 19, 2014, to October 22, 2015, and equipped with certain Syntec S3B Track Mounted Seats in 30", 36", 39" and 45" widths. In the event of a severe rear-end collision, the seats may tilt rearward. As such, these seats fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) 222, "School Bus Passenger Seating and Crash Protection." In the event of a severe rear-end collision, the seats may tilt rearward and result in injuries to the passenger's knees and/or impede the exiting of the bus. DTNA will notify owners, and dealers will install a toe-clamp on the front feet of the S3B track mounted seats, free of charge. The recall is expected to begin February 9, 2016. Owners may contact DTNA customer service at 1-800-745-8000, or Syntec customer service at 1-336-862-7509. DTNA's number for this recall is FL-698.

**15V-843**

Suzuki Motor of America, Inc. (Suzuki) is recalling certain model year 2013 Suzuki SFV650 motorcycles manufactured March 23, 2013, to April 8, 2013, 2014 Suzuki SFV650 motorcycles manufactured October 24, 2013, to November 26, 2013 and 2015 Suzuki SFV650 motorcycles manufactured August 9, 2014, to September 12, 2014. During assembly of the motorcycle, the fuel tank breather hose may have not been positioned properly and may become kinked. If the fuel tank breather hose is kinked, pressure may build inside the fuel tank and cause the tank to crack, resulting in a fuel leak, increasing the risk of a fire. Suzuki will notify owners, and dealers will inspect and replace the fuel tank breather hose. If the existing breather hose was found to be kinked and obstructed, the fuel tank will also be replaced. These repairs will be performed free of charge. The recall began on January 8, 2016. Owners may contact Suzuki customer service number at 1-714-572-1490. Suzuki's number for this recall is 2A49.

**15V-844**

Mercedes-Benz USA, LLC (MBUSA) is recalling certain model year 2015 C300 and C400 4matic sedans manufactured January 27, 2014, to December 1, 2014. Due to an error in the electric power steering control unit software, the affected vehicles may have a loss of electric power steering assist. If the vehicle experiences a loss of power steering assist, extra steering effort will be required, especially at lower speeds, increasing the risk

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING DECEMBER 2015**

*Published January 15, 2016*

of a vehicle crash. MBUSA will notify owners, and dealers will update the power steering software, free of charge. The recall is expected to begin in January 2016. Owners may contact MBUSA customer service at 1-800-367-6372.

**15V-845**

Vanguard National Trailer Corporation (Vanguard) is recalling certain model year 2015-2016 CIMC Dry Freight and Refrigerated trailers manufactured October 22, 2014, to October 2, 2015, and equipped with certain Meritor EX225L2 or EX225L+ axles. The affected axle assemblies have caliper bolts that may not have been properly tightened, allowing the caliper mounting bolts to back out and the caliper to detach from the axle flange. If the caliper detaches from the axle flange, braking performance would be reduced, increasing the risk of a crash. Vanguard will notify owners, and dealers will inspect the caliper bolts, tightening them as necessary, free of charge. The recall is expected to begin in January 2016. Owners may contact Vanguard customer service at 1-219-253-2000, or Meritor customer service at 1-866-668-7221. Vanguard's number for this recall is 15E083.

**15V-847**

Jayco Inc. (Jayco) is recalling certain model year 2016 Alante motorhomes manufactured November 3, 2015, to November 23, 2015. The affected vehicles have forward and rearward facing dinette seats whose seat belts may not have the proper plate to anchor the seat belt brackets. This can allow the seat belt end to detach from the vehicle in the event of a crash. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 210, "Seat Belt Assembly Anchorages." A seat belt that is not properly anchored to the vehicle may not restrain the occupant in a crash, increasing their risk of injury. Jayco will notify owners, and dealers will install the correct seat belt bracket backer plate, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Jayco customer service at 1-800-517-9137. Jayco's number for this recall is 9903273.

**15V-848**

Maserati North America, Inc. (Maserati) is recalling certain model year 2016 Granturismo and Granturismo Convertible vehicles manufactured September 1, 2015, to November 30, 2015. The affected vehicles are equipped with a non-galvanized main fuel delivery line that may corrode and result in a fuel leak. A fuel leak in the presence of an ignition source can increase the risk of a fire. Maserati will notify owners, and dealers will replace the main delivery fuel line, free of charge. The recall began on January 7, 2016. Owners may contact Maserati customer service at 1-201-816-2600. Maserati's number for this recall is 300.

**15V-849**

Mitsubishi Fuso Truck of America, Inc. (MFTA) is recalling certain model year 2012-2015 FEC52, FEC72, FEC92, and FGB72 trucks manufactured April 8, 2011, to July 22, 2014. The affected vehicles have a fuel return hose that may deteriorate due to being exposed to chemicals or lubricants, causing the hose to swell and detach. If the fuel hose detaches a fuel leak may result, increasing the risk of a fire. MFTA will notify owners, and dealers will inspect the fuel return hose, replacing it with an improved hose, as necessary, free of charge. The manufacturer has not yet provided a notification schedule. Owners may call MFTA customer service at 1-877-711-0707. MFTA's number for this recall is C1008210.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING DECEMBER 2015**

*Published January 15, 2016*

**15V-850**

Suzuki Motor of America, Inc. (Suzuki) is recalling certain model year 2014 Suzuki DL 1000 motorcycles manufactured January 17, 2014, to June 5, 2014, 2015 Suzuki DL1000 motorcycles manufactured November 4, 2014, to February 6, 2015 and 2016 Suzuki DL1000 motorcycles manufactured June 11, 2015, to July 15, 2015. The affected motorcycles have a wiring harness that may rub against the bottom of the fuel tank. Vibration from riding may cause the wiring insulation to wear off, allowing a bare wire to short circuit against the fuel tank. A short circuit may cause the engine to stall, increasing the risk of a crash. Suzuki will notify owners, and dealers will inspect the motorcycles and reroute the wiring harnesses as necessary. Any damaged harnesses will be repaired or replaced. This work will be performed free of charge. The recall is expected to begin on January 22, 2016. Owners may contact Suzuki customer service number at 1-714-572-1490. Suzuki's number for this recall is 2A53.

**15V-851**

Suzuki Motor of America, Inc. (Suzuki) is recalling certain model year 2013-2014 SFV650 and AN650A, and 2012-2014 DL650A motorcycles. Contamination from component production and storage combined with manufacturing variations may result in excessive tappet and camshaft wear within the engines of the affected motorcycles. The excessive wear may result in an engine stall, increasing the risk of a crash. Suzuki will notify owners, and dealers will inspect the tappet clearance, replacing the tappets and camshafts, as necessary. All motorcycles that have less than 2500 miles will have their tappets and camshafts replaced since wear may not be evident. These repairs will be performed free of charge. The recall is expected to begin February 1, 2016. Owners may contact Suzuki customer service at 1-714-996-7040. Suzuki's number for this recall is 2A50, 2A51, and 2A52.

**15V-852**

Suzuki Motor of America, Inc. (Suzuki) is recalling certain model year 2014 Suzuki DL1000 motorcycles manufactured January 17, 2014 to June 5, 2014, and 2015 Suzuki DL1000 motorcycles manufactured November 5, 2014, to February 6, 2015. Due to corrosion or being attached to the painted engine case, the battery ground connection may have poor electrical conductivity. As a result of the poor conductivity, the engine may stall and be unable to be restarted, increasing the risk of a crash. Suzuki will notify owners, and dealers will relocate the battery ground connection to an unpainted surface and replace the ground wire protector with a high-heat resistance tube, free of charge. The recall is expected to begin on January 22, 2016. Owners may contact Suzuki customer service number at 1-714-996-7040. Suzuki's number for this recall is 2A53.

**15V-853**

Suzuki Motor of America, Inc. (Suzuki) is recalling certain model year 2014 DL1000 motorcycles manufactured January 17, 2014, to June 5, 2014, and 2015 DL1000 motorcycles manufactured November 5, 2014, to February 6, 2015. The ignition switch terminals of the affected vehicles may corrode if they come into contact with liquid such as salt water. As a result, the motorcycle's electrical power may be disconnected or the switch may be bypassed, preventing the engine from being shut off with the ignition key. If electrical power is lost, the engine would stall, increasing the risk of a crash. Suzuki will notify owners, and dealers will install a cover for the ignition switch connector, and any corroded ignition lead wire and wire harnesses will be replaced. These repairs

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING DECEMBER 2015**

*Published January 15, 2016*

will be performed free of charge. The recall is expected to begin January 22, 2016. Owners may contact Suzuki customer service at 1-714-996-7040. Suzuki's number for this recall is 2A53.

**15V-854**

Starcraft RV (Starcraft) is recalling certain model year 2015-2016 Autumn Ridge, and Solstice fifth wheel trailers manufactured August 12, 2014, to October 16, 2015, and equipped with a side vented sewer drainage system termination valve. The affected vehicles may be missing a caution label to inform the operator not to leave the drain valve open to prevent an escape of sewer gas. If the drain valve is left open, sewer gas may fill the recreational vehicle, increasing the risk of occupant injury. Starcraft will notify owners, and send them the missing label, free of charge. The recall began on January 13, 2016. Owners may contact Starcraft customer service at 1-800-945-4787. Starcraft's number for this recall is 9902274.

**15V-856**

McNeilus Truck & Manufacturing, Inc. (McNeilus) is recalling certain model year 2015 Atlantic front loader refuse trucks manufactured May 22, 2015, to October 26, 2015, and equipped with an optional tailgate for a compressed natural gas (CNG) system. The affected trucks may have been manufactured without rear and side rear red reflectors. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Assoc. Equipment." Missing reflectors can cause the vehicle to be less visible to other drivers, increasing the risk of a crash. McNeilus will notify owners, and dealers will install the missing four reflectors, free of charge. The recall began on January 8, 2016. Owners may contact McNeilus customer service at 1-888-686-7278. McNeilus' number for this recall is VSR-TSB-015.

**15V-857**

Ford Motor Company (Ford) is recalling certain model year 2016 Ford F-650 and F-750 trucks manufactured April 15, 2015, to December 15, 2015, and equipped with rear air suspension. In the affected vehicles, the rear brake hoses may contact and chafe on the rear axle housing while driving. A chafed rear brake line may result in an air leak, reducing the rear braking ability and increasing the risk of a crash. Ford will notify owners, and dealers will install revised rear brake air chambers and replace any damaged rear air brake lines, free of charge. The recall is expected to begin during January 2016. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 15S38.

**15V-858**

Daimler Trucks North America, Inc. (DTNA) is recalling certain model year 2015-2016 Freightliner 108SD, 114SD, Business Class M2, and Western Star 4900 vehicles manufactured September 26, 2014, to November 6, 2015, and equipped with certain drive axles manufactured by Marmon-Herrington. The affected axles have hex nuts on the flange yoke that may not have been properly tightened. If the hex nuts are not tightened to specification, the driveshaft may disconnect from the drive axle, resulting in a loss of propulsion and increasing the risk of a crash. DTNA will notify owners, and dealers will inspect the hex nuts, tightening them as necessary, free of charge. The recall is expected to begin February 16, 2016. Owners may contact DTNA customer service at 1-800-745-8000, or Marmon-Herrington customer service at 1-502-253-0277. DTNA's number for this recall is FL-699.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING DECEMBER 2015**

*Published January 15, 2016*

**15V-859**

Forest River, Inc. (Forest River) is recalling certain model year 2016 Cardinal recreational trailers, model CAF3850RL. The affected vehicles have Federal Certification Placards that list an incorrect gross axle weight from what is actually installed on the vehicle. As such, these vehicles fail to comply with the requirements of 49 CFR Part 567, "Certification." Incorrect placards may result in improper trailer loading. Improper loading may increase the risk of a crash. Forest River will notify owners and mail them a corrected Federal placard label, free of charge. The recall is expected to begin on February 16, 2016. Owners may contact Forest River customer service at 1-574-206-7600. Forest River's number for this recall is 15-12112015-0122.

**15V-860**

Ford Motor Company (Ford) is recalling certain model year 2003-2005 Ford Crown Victoria and Mercury Grand Marquis vehicles manufactured October 3, 2001, to August 2, 2005. The affected vehicles have a lighting control module (LCM) that may fail, resulting in a loss of headlights. A loss of headlights can reduce driver visibility and increase the risk of a crash. Ford will notify owners, and dealers will replace the LCM, free of charge. Parts are not currently available to remedy the affected vehicles. Owners will be mailed interim notifications beginning on January 19, 2016. A second notice will be mailed when remedy parts are available. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 15S39.

**15V-861**

Motor Coach Industries (MCI) is recalling certain model year 2016 MCI J4500 motor coaches manufactured August 26, 2015, to December 3, 2015, and equipped with Kiel passenger seats. During assembly, one of the seat mounting bolts was installed incorrectly. In the event of a crash, the seat may detach from its floor mounting, increasing the risk of injury to the seat occupant. MCI will notify owners, and dealers will correct the seat mounting, free of charge. The recall is expected to begin in January 2016. Owners may contact MCI at 1-800-241-2947. MCI's number for this recall is SB 430.

**15V-862**

Kaufman Trailers (Kaufman) is recalling certain model year 2016 Flatbed and Wedge Car Hauler trailers manufactured September 11, 2015, to October 14, 2015, equipped with certain 10,000 lb dual wheel axle assemblies. The affected trailers were manufactured with mismatched axle hub and cone assemblies that may cause leaking bearing oil seals, thus resulting in wheel bearing failure. Premature bearing failure may increase the risk of a crash. Kaufman has notified owners, and dealers will replace the affected axle assemblies, free of charge. The recall began on December 21, 2015. Owners may contact Kaufman customer service at 1-336-790-6817.

**15V-863**

Hyundai Motor America (Hyundai) is recalling certain model year 2015 Genesis vehicles manufactured March 3, 2014, to February 9, 2015, and equipped with Hankook Ventus S1 noble2 tires installed as original equipment. The affected tires may develop cracks in the tire sidewall, resulting in a loss of air. Tire sidewall cracks could cause a rupture during use, resulting in a rapid air loss and loss of vehicle control, increasing the risk of a crash. Hyundai will notify owners, and dealers will replace the factory tires with tires of another brand, free of charge.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING DECEMBER 2015**

*Published January 15, 2016*

The recall is expected to begin on February 19, 2016. Owners may contact Hyundai customer service at 1-855-671-3059. Hyundai's number for this recall is 138.

**15V-864**

Ford Motor Company (Ford) is recalling certain model year 2015 Ford Transit vehicles manufactured May 1, 2015, to June 26, 2015, and equipped with dual rear wheels. The affected vehicles have a left or right rear axle drive shafts that may fracture, resulting in loss of drive power. Additionally, the vehicle may unexpectedly roll if it is parked without the parking brake applied. A loss of drive power or vehicle rollaway after being parked can increase the risk of a vehicle crash. Ford will notify owners, and dealers will replace the left and right axle drive shafts, free of charge. The recall is expected to begin February 8, 2016. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 15S37.

**15V-865**

Winnebago Industries, Inc. (Winnebago) is recalling certain model year 2015-2016 Winnebago Sightseer, Vista, and Adventurer motorhomes manufactured August 1, 2014 through August 31, 2015, and 2015-2016 Itasca Sunova, Sunstar, and Suncruiser motorhomes manufactured August 1, 2014, through August 31, 2015. The affected vehicles have electrically operated entry/exit steps that may extend down and out while the vehicle is moving. If the steps extend while the vehicle is being driven, the steps may strike a person or another vehicle, increasing the risk of injury or a crash. Winnebago will notify owners, and dealers will replace the step switch connections at no charge. The manufacturer has not yet provided a notification schedule. Owners may contact Winnebago customer service at 1-641-585-3535.

**15V-866**

Ford Motor Company (Ford) is recalling certain model year 2015 Ford F-150 SuperCrew trucks manufactured January 22, 2015, to March 17, 2015. The affected vehicles may be equipped with driver or front passenger seat belt anchorage assemblies whose pretensioner cable was not properly crimped. As a result, the seat belts may not properly restrain the seat occupant in the event of a crash. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 209, "Seat Belt Assemblies" and 210, "Seat Belt Assembly Anchorages." An occupant that is not be properly restrained is at an increased risk of injury in the event of a crash. Ford will notify owners, and dealers will replace the driver and/or front passenger side seat belt retractor(s) and pretensioner(s), free of charge. The recall is expected to begin February 8, 2016. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 15C17.

**15V-867**

Navistar, Inc. is recalling certain model year 2007-2015 IC BE and CE school buses, 2013-2015 IC AE school buses, 2007-2011 IC FE school buses, and 2007-2014 IC RE school buses equipped with certain model S2005, S2010, S5005, S5010, S5505, and S5510 wheelchair lifts by Ricon. The affected lifts are equipped with folding link arms that may have pivot holes that are too big, allowing the bearings to move out of position. If the bearings move out of position, the stowed platform may have excessive movement resulting in failure of the platform mounting. This failure could cause the wheel chair lift platform to fall out of the vehicle when the doors are opened, increasing the risk of injury for the lift operator. Navistar will notify the purchasers of the lifts, and dealers will inspect the link arms for damage or for displaced bearings. The platform will be inspected for

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING DECEMBER 2015**

*Published January 15, 2016*

cracks. Any damaged parts will be replaced, free of charge. The recall is expected to begin on February 22, 2016. Owners may contact Navistar customer service at 1-800-448-7825. Note: These buses and wheelchair lifts were subject to a similar recall in 2014. All vehicles that received that recall remedy are still affected by this recall as well.

**15V-868**

Mazda North American Operations (Mazda) is recalling certain model year 2003-2008 Mazda6 vehicles manufactured May 29, 2002, to May 5, 2008, 2006-2007 Mazdaspeed6 vehicles manufactured July 1, 2005, to June 29, 2007, and a limited production of model year 2004 RX-8 vehicles manufactured June 25, 2003, to June 30, 2003. The inflators in the front passenger air bags are susceptible to rupture in the event of a crash necessitating the deployment of the front passenger air bag. In the event of a crash necessitating deployment of the passenger's frontal air bag, the inflator could rupture with metal fragments striking the vehicle occupants potentially resulting in serious injury or death. Mazda will notify owners, and dealers will replace the passenger's frontal air bag with a new one, free of charge. Owners may contact Mazda customer service at 1-800-222-5500. Mazda's number for this recall is 9015L. Note: This recall supersedes recalls 13V-130 and 14V-362 in their entirety. This recall partially supersedes recall 14V-773 in that model year 2003-2006 Mazda6 vehicles covered by that recall are now covered by this campaign.

**15V-869**

Navistar, Inc. is recalling certain model year 2007-2015 IC CE transit buses, 2008-2011 IC FE transit buses and 2009-2013 IC RE transit buses equipped with certain model S2005, S2010, S5005, S5010, S5505, and S5510 wheelchair lifts by Ricon. The affected lifts are equipped with folding link arms that may have pivot holes that are too big, allowing the bearings to move out of position. If the bearings move out of position, the stowed platform may have excessive movement resulting in failure of the platform mounting. This failure could cause the wheel chair lift platform to fall out of the vehicle when the doors are opened, increasing the risk of injury for the lift operator. Navistar will notify the purchasers of the lifts, and dealers will inspect the link arms for damage or for displaced bearings. The platform will be inspected for cracks. Any damaged parts will be replaced, free of charge. The recall is expected to begin on February 22, 2016. Owners may contact Navistar customer service at 1-800-448-7825. Note: These buses and wheelchair lifts were subject to a similar recall in 2014. All vehicles that received that recall remedy are still affected by this recall as well.

**15V-870**

Hyundai Motor America (Hyundai) is recalling certain model year 2011-2012 Elantra vehicles manufactured October 29, 2010, to October 25, 2011. Due to an electronic stability control (ESC) sensor malfunction, the brakes for one or more wheels may be applied unexpectedly and the engine power may be reduced. These symptoms will be accompanied by illumination of the ESC indicator lamp in the instrument cluster. If the one or more of the brakes are inappropriately applied, control of the vehicle may be lost, increasing the risk of a crash. Hyundai will notify owners, and dealers will verify the proper operation of the ESC sensors, and update the ESC system's calibration, free of charge. The recall is expected to begin February 19, 2016. Owners may contact Hyundai customer service at 1-800-633-5151. Hyundai's number for this recall is 137.

**15V-871**



**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING DECEMBER 2015**

*Published January 15, 2016*

Allied Recreation Group, Inc. (ARG) is recalling certain model year 2010-2011 Holiday Rambler Admiral, 2009-2014 Holiday Rambler Ambassador, 2010 Holiday Rambler Arista, 2010-2014 Holiday Rambler Endeavor, 2009-2011 Holiday Rambler Neptune, 2011-2014 Holiday Rambler Vacationer, 2009-2011 Monaco Cayman, 2010-2014 Monaco Diplomat, 2014 Monaco Dynasty, 2009-2014 Monaco Knight, 2012-2013 Monaco LaPalma, 2009-2013 Monaco Monarch, 2009-2011 Monaco Riptide, 2008 Safari Passage, and 2008 Safari Simba motorhomes. The affected vehicles are equipped with certain Lippert-brand Coachstep Double Electric Steps. These steps use a bolt to attach the fan gear assembly to the steps. This bolt may fracture allowing the fan gear to disengage from the steps. As a result, the steps may not remain in the expected position and may be unstable. Unstable entry and exit steps increase the risk of injury. ARG will notify owners and dealers will install a retainer bracket to reinforce the operating mechanism, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact ARG customer service number at 1-800-509-3417. ARG's number for this recall is 151216REV.

**15V-872**

H&H Trailers, LLC (H&H) is recalling certain model year 2015-2016 GCA Golf Car Trailers, AMS Bike Trailers, RSA Rail Side Single Axle Utility Trailers, RSA Rail Side Tandem Axle Utility Trailers, SSA Solid Side Single Axle Utility Trailers, and SSA Solid Side Tandem Axle Utility Trailers manufactured November 1, 2014, to October 16, 2015. The affected trailers may be equipped with aluminum gate hinges that may bend and possibly break. If the hinge breaks, the gate may open unexpectedly, increasing the risk of a crash. H&H will notify owners, and dealers will replace the hinges, free of charge. The recall is expected to begin in January 2016. Owners may contact H&H customer service at 1-712-542-2618.

**15V-873**

Honda (American Honda Motor Co.) is recalling certain model year 2012-2014 VT750CA, VT750C2 and VT750C2F, 2011-2016 VT750C, 2013-2016 VT750CS, 2010-2016 VT750C2B and 2013-2014 VT750C2S motorcycles. Engine vibration may cause the bank angle sensor wire to rub on the wire harness joint connector, resulting in a loss of the sensor signal. Without the bank angle sensor signal, the engine may stall while riding, increasing the risk of a crash. Honda will notify owners, and dealers will relocate the joint connector and replace the bank angle sensor, free of charge. The recall is expected to begin February 19, 2016. Owners may contact Honda Motorcycle customer service at 1-866-784-1870. Honda's number for this recall is JW7.

**15V-874**

Forest River, Inc. (Forest River) is recalling certain model year 2016 Prime Time recreational trailers, models FHT2614X, FHT2910 and FHT2912X, manufactured September 14, 2015, to December 17, 2015. The affected vehicles may be equipped with a Federal Placard that lists an incorrect tire size of ST225/75R15 Load Range E, when the correct tire size is ST225/75R15 Load Range D. The actual tires installed on the trailer have a maximum tire pressure lower than what the placard lists and may be overinflated if filled per the placard specifications. As such, these vehicles fail to comply with the requirements of 49 CFR Part 567, "Certification." Over inflated tires may result in sudden tire failure and increase the risk of a crash. Forest River will notify owners and will provide a corrected Federal placard, free of charge. The recall is expected to begin February 17, 2016. Owners may contact Forest River customer service at 1-574-862-3001. Forest River's number for this recall is 49-12182015-0124.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING DECEMBER 2015**

*Published January 15, 2016*

**15V-875**

General Motors LLC (GM) is recalling certain model year 2015 Chevrolet Cruze vehicles manufactured September 24, 2014, to May 29, 2015. In the affected vehicles, one of the driver-side seat belt assembly bolts may not be properly tightened. An insufficiently torqued bolt may prevent the seat belt from holding the required load in a crash, increasing the risk of injury. GM will notify owners, and dealers will inspect and tighten the bolts, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Chevrolet customer service at 1-800-222-1020. GM's number for this recall is 15777.

**15V-876**

Entegra Coach (Entegra) is recalling certain model year 2008 and 2010-2011 Aspire and Anthem motorhomes, 2008 and 2010 Cornerstone motorhomes, 2008 Emblem and Alante motorhomes, and 2009-2011 Insignia motorhomes. The affected vehicles are equipped with certain Lippert-brand Coachstep Double aElectric Steps. These steps use a bolt to attach the fan gear assembly to the steps. This bolt may fracture allowing the fan gear to disengage from the steps. As a result, the steps may not remain in the expected position and may be unstable. Unstable entry and exit steps increase the risk of injury. Entegra will notify owners, and dealers will install a retainer bracket on the double step assemblies and the Coachstep Linkage Assembly will be replaced and a retainer bracket will be installed on the trip step assemblies. The manufacturer has not yet provided a notification schedule. Owners may contact Entegra customer service at 1-800-945-4787, or Lippert customer service at 1-574-537-8900. Entegra's number for this recall is 9903275.

**15V-877**

Chrysler (FCA US LLC) is recalling certain model year 2015 Jeep Compass and Patriot vehicles manufactured January 1, 2015, to May 11, 2015. During assembly, the power steering hose retention clamp may have been installed at an incorrect location, resulting in the detachment of the low pressure return hose. If the power steering fluid return hose detaches, it would leak fluid and increase the risk of a fire. Chrysler will notify owners, and dealers will inspect the return power steering hose clamp, repositioning the clamp as necessary, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is R68.

**15V-878**

Chrysler (FCA US LLC) is recalling certain model year 2011-2013 Dodge Durango and Jeep Grand Cherokee vehicles manufactured December 3, 2009, to September 1, 2012. In the affected vehicles, the wiring for the vanity lamp in the sun visor may short circuit, after having been remedied for a prior recall for the vanity lamp wiring. This recall is also addressing certain vehicles that have not been remedied under that prior recall. The vanity lamp wiring may short, increasing the risk of a vehicle fire. Chrysler will notify owners. The remedy plan is still being developed. The manufacturer has not yet provided a notification schedule. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is R71.

**15V-879**

Ferrari North America (FNA) is recalling certain model year 2016 488 GTB vehicles manufactured September 9, 2015, to November 6, 2015. The affected vehicles may be equipped with a low pressure fuel line connection

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING DECEMBER 2015**

*Published January 15, 2016*

that was not properly coated during manufacturing. This may cause a fuel vapor leak during engine start. A fuel vapor leak during engine start increases the risk of a fire. Ferrari will replace the low pressure fuel line assembly connection, free of charge. Affected vehicles are located in dealer inventory and will be remedied before customer retail. The recall began on December 18, 2015. Owners may contact FNA customer service at 1-866-551-2828.

**15V-881**

BMW of North America, LLC (BMW) is recalling certain model year 2015 i8 vehicles manufactured May 29, 2015, to June 5, 2015. Improperly drilled holes within the Dynamic Stability Control (DSC) hydraulic unit may restrict one or more pistons impairing the DSC functions, including braking. Impaired DSC functionality may negatively impact vehicle handling and braking and increase the risk of a crash. BMW will notify owners, and dealers will inspect the DSC hydraulic unit, and replace if necessary, free of charge. The recall is expected to begin February 10, 2016. Owners may contact BMW customer service at 1-800-525-7417.

**15V-882**

Corp. Micro Bird Inc. (Micro Bird) is recalling certain model year 2014-2016 MBII and G5 school buses manufactured May 21, 2014, to November 24, 2015. The affected vehicles may have a camber caster kit bolt that was insufficiently torqued, causing the bolt to come loose. An insufficiently torqued bolt may become loose and fall out causing vehicle misalignment. Loss of vehicle control is possible, increasing the risk of a crash. Micro Bird will notify owners, and dealers will correct the torque, free of charge. The recall is expected to begin January 29, 2016. Owners may contact Micro Bird customer service at 1-819-477-2012. Micro Bird's number for this recall is 10-065-AUS.

**15V-883**

Corp. Micro Bird Inc. (Micro Bird) is recalling certain model year 2014-2016 MBII and G5 transit buses manufactured September 5, 2014, to November 24, 2015. The affected vehicles may have a camber caster kit bolt that was insufficiently torqued, causing the bolt to come loose. An insufficiently torqued bolt may become loose and fall out causing vehicle misalignment. Loss of vehicle control is possible, increasing the risk of a crash. Micro Bird will notify owners, and dealers correct the torque, free of charge. The recall is expected to begin January 29, 2016. Owners may contact Micro Bird customer service at 1-819-477-2012. Micro Bird's number for this recall is 15-065-AUC.

**15V-884**

Temsa Global Sanayi Ve Ticaret A.S. (Temsa) is recalling certain model year 2008-2016 TS35C buses manufactured July 21, 2008, to December 12, 2015. In the affected vehicles, the steering gearbox bracket fastener may loosen. If the bracket fastener loosens it can cause loss of vehicle control, increasing the risk of a crash. Temsa will notify owners, and dealers will replace the fastener bolts, free of charge. The recall is expected to begin during January 2016. Owners may contact Temsa customer service at 1-404-602-0151.

**15V-885**

Corp. Micro Bird Inc. (Micro Bird) is recalling certain model year 2015 MBII and G5 school buses manufactured between May 1, 2015, and December 18, 2015, equipped with Transpec stop arms, part

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING DECEMBER 2015**

*Published January 15, 2016*

numbers T6000-, T6100-, and T7000-. The STOP decal may peel off the plastic blade of the stop arm. Thus, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) No. 131, "School Bus Pedestrian Safety Devices." Absence of the reflective decal would reduce visibility to other drivers, increasing the risk of a crash. Micro Bird will notify owners and recall repair kits will be available free of charge. The recall is expected to begin on January 18, 2016. Owners may contact Micro Bird customer service at 1-819-477-2012.

**15V-886**

BMW of North America, LLC (BMW) is recalling one model year 2016 MINI Cooper Hardtop 2 Door vehicle manufactured November 24, 2015, and one BMW X1 Sports Activity vehicle manufactured October, 19 2015. The steering gearbox may have been manufactured with incorrect parts. A gearbox malfunction may cause a loss of vehicle control and increase the risk of a crash. BMW will replace the steering gearbox, free of charge. Affected vehicles are located in dealer inventory and will be remedied before customer retail. The recall began on December 28, 2015. Owners may contact BMW customer service at 1-800-525-7417.

**15V-887**

Gillig LLC (Gillig) is recalling certain model year 2014-2015 Low Floor vehicles manufactured November 20, 2014, to June 2, 2015. The affected vehicles may be equipped with front brake chambers with an incorrect drain hole orientation. This can allow water to build up within the brake chamber, causing corrosion, deterioration, and reduce braking ability. Corrosion, part deterioration, or frozen water in the brake chamber may reduce braking ability, increasing the risk of a crash. Gillig will notify owners and the brake chambers will be replaced free of charge. The recall is expected to begin February 19, 2016. Owners may contact Gillig customer service at 1-800-735-1500.

**15V-888**

PACCAR Incorporated (PACCAR) is recalling certain model year 2015 Peterbilt model 388 vehicles manufactured from January 28, 2014, through February 3, 2014. The affected vehicles were built with Michelin MN295/60 R22.5 XZA front tires and 8.25" wheels and were certified to a GAWR greater than the maximum 12,350 lbs allowed. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 120, "Tire Selection and Rims for Motor Vehicles Other Than Passenger Cars." If the truck exceeds the load rating on the tire, the tire may suddenly fail, increasing the risk of a crash. Peterbilt will notify owners, and dealers will replace the 8.25" front wheels with 9.00" wheels and re-program the maximum vehicle speed to the appropriate settings, free of charge. The recall is expected to begin on January 29, 2016. Owners may contact Peterbilt customer service at 1-940-591-4000. PACCAR's recall campaign number for this recall is 1115Q.

**15V-889**

Compass Conversions, LLC (Compass Conversions) is recalling one model year 2014 Bloomer Horse Trailer and one 2015 Platinum Horse Trailer with Atwood Model on-demand water heaters. Additionally, one Atwood water heater from Compass Conversions inventory is being recalled. The affected on-demand water heaters have a gas valve that may cause the water heater to overheat the water in the hot water supply tap. The overheating of the water may result in the release of steam, possibly causing the operator is to scald themselves

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING DECEMBER 2015**

*Published January 15, 2016*

and increasing the risk of injury. Compass Conversions will notify the owners and Atwood dealers will install a remedy kit, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Compass Conversion customer service at 1-254-771-9909 or Atwood customer service at 1-574-264-2131.

**15V-890**