

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JANUARY 2015**

Published February 12, 2015

CHILD SEATS:

None during January 2015.

EQUIPMENT:

Tucker Rocky Distribution (Tucker Rocky) is recalling certain Speed and Strength SS500DVD motorcycle helmets manufactured April 12, 2011, to August 31, 2013, sizes XS, S, and M. The helmets fail to meet certain performance requirements of Federal Motor Vehicle Safety Standard (FMVSS) 218, "Motorcycle Helmets." A rider may not be adequately protected in the event of a crash, increasing the risk of serious injury. Tucker Rocky will notify owners, and replace any XS, S, and M size Speed and Strength SS500 helmets with a compliant Speed and Strength SS400 helmet, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Tucker Rocky customer service at 1-817-258-9247.

15E-001

Tucker Rocky Distribution (Tucker Rocky) is recalling certain Speed and Strength SS200, SS300, and SS400 motorcycle helmets manufactured February 1, 2013, to December 7, 2013, sizes XS-XXL. The helmets fail to meet certain performance requirements of Federal Motor Vehicle Safety Standard (FMVSS) No. 218, "Motorcycle Helmets." A rider may not be adequately protected in the event of a crash, increasing the risk of serious injury. The remedy for this recall is still under development. The manufacturer has not yet provided a notification schedule. Owners may contact Tucker Rocky customer service at 1-817-258-9247.

15E-002

Nova Bus is recalling certain N67588 alternator cables manufactured December 1, 2011, to December 1, 2013 and sold as service parts for 2010-2014 LFS transit buses. The affected alternator cables may have been damaged during installation. This damage can cause the cable terminal to fracture and result in the cable arcing to other components. Arcing of the alternator cable may result in an engine compartment fire. Nova Bus will notify owners, and dealers will inspect the terminal and replace the cable if it is damaged, free of charge. The recall began on January 29, 2015. Owners may contact Nova Bus customer service at 1-450-472-6410. Nova Bus' numbers for this recall are CR3230E and CR3231E. Note: Buses that were manufactured with the subject alternator cable are covered under recall 14V381.

15E-003

TIRES:

Goodyear Tire & Rubber Company (Goodyear) is recalling certain Fortera HL P255/65R18 109S tires manufactured November 30, 2014, to January 10, 2015. The affected tires experienced cracking of the tread during tire endurance testing inspection. Thus, these tires fail to comply with requirements of Federal Motor Vehicle Safety Standard (FMVSS) No. 139, "New pneumatic radial tires for light vehicles." If the tires experience tread cracking, it may result in a loss of tire pressure and possible tire failure, increasing the risk of a vehicle crash. Those tires installed as original equipment on certain 2015 Buick Enclave, Chevrolet Traverse, and GMC Acadia are being replaced free of charge by General Motors under safety recall 15V-044. GM will notify

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JANUARY 2015**

Published February 12, 2015

the affected vehicle owners. Replacement equipment tires are being replaced free of charged by Goodyear. Goodyear will notify all owners for which it has registration information. The recall is expected to begin February 20, 2014. GM vehicle owners may contact GM at 1-800-521-7300 (Buick), 1-800-222-1020 (Chevrolet), or 1-800-462-8782 (GMC). GM's number for this recall is 15025/15067. Owners of replacement equipment tires may contact Goodyear at 1-800-592-3267.

15T-002

VEHICLES:

Motor Coach Industries (MCI) is recalling certain model year 2013-2015 MCI J4500 motorcoaches manufactured December 23, 2013, to December 19, 2014 and equipped with ZF axles and independent front suspension. The routing and clamping of the steering axle brake hose to the steering axle brake chamber may allow the brake hose to rub the front tire. The rubbing may wear a hole into the brake hose resulting in a loss of air pressure in the front brake chamber, reducing brake performance and increasing the risk of a crash. MCI will notify owners. The remedy for this recall is still under development. The manufacturer has not yet provided a notification schedule. Owners may contact MCI customer service at 1-800-241-2947.

15V-001

Polaris Industries, Inc. (Polaris) is recalling certain model year 2013-2014 Victory Cross Country, Cross Roads, Hammer Eight Ball, High Ball, Jackpot, Vegas Eight Ball, 2014 Victory Cross Country Eight Ball, Cross Roads Eight Ball, Ness Cross Country, 2015 Victory Gunner, and 2013 Victory Hardball motorcycles. The fuel pump in the affected motorcycles may have been incorrectly crimped during manufacturing, which may result in the fuel pump seizing. If the fuel pump seizes, the motorcycle will stall, increasing the risk of a crash. Victory will notify owners, and dealers will replace the fuel pump, free of charge. The recall began on January 14, 2015. Owners may contact Victory consumer service at 1-877-737-7172. Polaris' number for this recall is V-15-01 A/B.

15V-002

Lance Camper Manufacturing Corp. (Lance) is recalling certain model year 2015 Slide-In Campers and Travel Trailers manufactured August 1, 2014, to October 27, 2014, and equipped with certain Latitude awnings manufactured by Carefree of Colorado. The mounting brackets of the affected awnings may crack, and the awnings may fall. If an awning falls, there is an increased risk of injury to anyone under the awning. Lance will notify owners, and dealers will remove and replace all the mounting brackets, free of charge. The recall began November 26, 2014. Owners may contact Lance customer service at 1-661-949-3322.

15V-003

Thor Motor Coach (TMC) is recalling certain model year 2015 Challenger, Four Winds 5000, Hurricane, Miramar, Chateau Citation, Chateau, Windsport, and Palazzo motorhomes manufactured April 24, 2014, to December 11, 2014, and equipped with certain Latitude awnings manufactured by Carefree of Colorado. The affected awnings may have screws that attach the lateral arm brackets to the mounting brackets that were not manufactured to specification. The screws could fail, causing the supporting bracket to fail, and the awning to fall and potentially strike and injure a person beneath it. TMC will notify owners, and dealers will remove and replace the defective screws, free of charge. The recall began January 23, 2015. Owners may contact TMC

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JANUARY 2015**

Published February 12, 2015

customer service at 1-877-500-1020. TMC's number for this recall is RC000097.

15V-004

Ford Motor Company (Ford) is recalling certain model year 2014 Ford Escape vehicles manufactured April 15, 2014, to May 8, 2014, and 2015 Lincoln MKC vehicles manufactured April 21, 2014, to May 15, 2014. Improper nickel plating of components within the fuel pump may result in the fuel pump failing. If the fuel pump fails, the vehicle may stall without warning, increasing the risk of a crash. Ford will notify owners, and dealers will replace the fuel pump, free of charge. The recall is expected to begin February 23, 2015. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 14S30.

15V-005

Ford Motor Company (Ford) is recalling certain model year 2015 Lincoln MKC vehicles manufactured August 20, 2013, to September 9, 2014. In the affected vehicles, the Push-to Start/Stop (PTS) button that is located at the bottom of the shift transmission controls may inadvertently be pushed, causing the engine to shut off. If the PTS switch is inadvertently pressed, the vehicle may stop unexpectedly, increasing the risk of a crash. In the event of a crash with the vehicle turned off, the air bags and seat belt restraints may not function as intended, increasing the risk of injury. Ford will notify owners, and dealers will relocate the PTS switch and reprogram the Powertrain Control Module (PCM), free of charge. The recall is expected to begin February 23, 2015. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 14S29.

15V-006

Piaggio Group Americas, Inc. (Piaggio) is recalling certain model year 2014-2015 Aprilia Shiver 750 motorcycles manufactured February 10, 2014, to October 28, 2014 and 2015 Aprilia Caponord 1200 motorcycles manufactured November 14, 2013, to October 16, 2014. Due to improper machining of the output gear shaft face, the fastening screw on the sprocket may loosen and the rear wheel may lock up. A rear wheel lock up increases the risk of a crash. Piaggio will notify owners, and dealers will inspect the output shaft, replacing any that are found to be defective, free of charge. The recall is expected to begin in February 2015. Owners may contact Piaggio customer service at 1-212-380-4433.

15V-007

Winnebago Industries, Inc. (Winnebago) is recalling certain model year 2014-2015 Winnebago Trend, Travato, and Itasca Viva motorhomes manufactured November 13, 2013, to December 23, 2014. In the affected vehicles, the Tire Pressure Monitoring System (TPMS) may fail to learn the locations of the individual sensors while the vehicle is being driven. As a result, the low tire pressure warning light will illuminate, despite the the tire pressures being within specification. Should one of the tires lose air pressure, the driver would not be notified of the change in air pressure. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard No. 138, "Tire Pressure Monitoring Systems." If the TPMS light illuminates because the sensors cannot be located, it could mask an actual low tire pressure condition, possibly resulting in tire failure, increasing the risk of a crash. Winnebago will have Chrysler notify owners, and dealers will update the TPMS module software, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Winnebago customer service at 1-800-537-1885. Winnebago's number for this recall is P62.

15V-008

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JANUARY 2015**

Published February 12, 2015

Entegra Coach (Entegra) is recalling certain model year 2015 Aspire motorhomes manufactured July 14, 2014, to October 29, 2014, and equipped with certain Latitude awnings manufactured by Carefree of Colorado. The affected awnings may have screws that attach the lateral arm brackets to the mounting brackets that were not manufactured to specification. The screws could fail, causing the supporting bracket to fail, and the awning to fall and potentially strike and injure a person beneath it. Entegra will notify owners, and dealers will remove and replace the defective screws, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Entegra customer service at 1-800-945-4787.

15V-009

Winnebago Towable is recalling certain model year 2013-2015 Winnebago Minnie 2201DS and 2450BHS travel trailers manufactured May 7, 2012, to November 13, 2014, and 2013-2015 Sunnybrook Remington 2200DS and 2451BHS travel trailers manufactured May 7, 2013, to November 13, 2014. The axle may contact the black liquid propane pipe fitting, resulting in the fitting cracking or breaking. If the propane pipe fitting cracks or breaks, propane may leak, increasing the risk of a fire. Winnebago Towable will notify owners. The remedy for this recall is still under development. The manufacturer has not yet provided a notification schedule. Owners may contact Winnebago Towable customer service at 1-574-825-5250.

15V-010

Southeast Toyota Distributors, LLC (SET) is recalling certain model year 2013-2015 Toyota Rav4 vehicles manufactured June 1, 2013, to December 29, 2014, and equipped with an accessory trailer light module. The software within the module may incorrectly detect an electrical short and preventively turn off the electrical current and the trailer lights. If the system incorrectly detects an electrical short and turns off the trailer lights while the trailer is being towed at night, there is an increased risk of a crash. SET will notify owners, and dealers will replace the trailer light module with a new unit with corrected software, free of charge. The recall is expected to begin February 23, 2015. Owners may contact SET customer service at 1-866-405-4226. SET's number for this recall is SET-15A.

15V-011

Nissan North America, Inc. (Nissan) is recalling certain model year 2014-2015 Nissan Pathfinder and Infiniti QX60 vehicles manufactured August 14, 2014, to November 5, 2014, and 2014-2015 Nissan Rogue vehicles manufactured August 12, 2014, to November 15, 2014. During the assembly process, the front wheel hub assembly fasteners may not have been properly torqued. The under-torqued fasteners may result in a brake caliper separating from the wheel assembly causing a reduction in braking performance or reduced steering control. These conditions increase the risk of a crash. Nissan will notify owners, and dealers will inspect the vehicles and tighten any loose bolts to the proper specification, free of charge. The recall is expected to begin February 25, 2015. Owners may contact Nissan customer service at 1-800-647-7261.

15V-012

Toyota Motor Engineering & Manufacturing (Toyota) is recalling certain model year 2014-2015 Toyota Prius V vehicles manufactured November 7, 2013, to January 7, 2015. The occupant classification system (OCS) that activates or deactivates the passenger seat air bag system may be improperly calibrated. As a result, the passenger air bag may not deploy in a vehicle crash. As such, these vehicles fail to comply with Federal Motor

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JANUARY 2015**

Published February 12, 2015

Vehicle Safety Standard (FMVSS) No. 208, "Occupant Crash Protection." If the air bag does not deploy as intended, there is an increased risk of injury in the event of a crash. Toyota will notify owners, and dealers will recalibrate of the OCS system, free of charge. The recall is expected to begin February 15, 2015. Owners may contact Toyota customer service at 1-800-331-4331.

15V-013

Spartan Motors, Inc. (Spartan) is recalling certain model year 2015 Spartan MM chassis manufactured October 2, 2013, to November 19, 2014. In the affected vehicles, the front sway bar mounting brackets may break, causing the sway bar to detach from the mounting frame. If the sway bar detaches, additional vehicle sway may occur, increasing the risk of a crash. The remedy for this recall is still under development. The manufacturer has not yet provided a notification schedule. Owners may contact Spartan customer service at 1-517-543-6400.

15V-014

Kia Motors America (Kia) is recalling certain model year 2014 Kia Forte vehicles manufactured December 5, 2012, to April 17, 2014. In the affected vehicles, the cooling fan resistor may overheat and melt. If the cooling fan resistor overheats and melts, there is an increased risk of a vehicle fire. Kia will notify owners, and for vehicles produced from December 5, 2012 to January 27, 2014, dealers will replace the cooling fan resistor and multi-fuse unit. For vehicles produced from January 28, 2014 to April 17, 2014, dealers will replace the multi-fuse unit only. Owners of vehicles with a 1.8L engine will also have the engine control unit software updated. The recall is expected to begin February 24, 2015. Owners may contact Kia customer service at 1-800-333-4542. Kia's number for this recall is SC113.

15V-015

Porsche Cars North America, Inc. (Porsche) is recalling certain model year 2011-2012 Cayenne S Hybrid, and Panamera S Hybrid vehicles manufactured April 26, 2011, to August 2, 2012. The fuel injection system may leak. A fuel leak in the presence of an ignition source increase the risk of a fire. Porsche will notify owners, and dealers will replace the fuel rails, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Porsche customer service at 1-800-767-7243.

15V-016

Jayco, Inc. (Jayco) is recalling certain model year 2015 Eagle 30.5 BHLT fifth wheel trailers manufactured March 13, 2014, to August 1, 2014. The affected trailers have incorrect tire size information on the tire label. As such, these trailers fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) No. 110, "Tire Selection and Rims and Motor Home/Recreation Vehicle Trailer Load Carrying Capacity Information for Motor Vehicles with a GVWR of 4,536 kilograms (10,000 pounds) or less." If the trailer tires are replaced with the ones listed incorrectly on the label, the trailer may be overloaded, resulting in poor handling or tire failure. Either of these conditions may increase the risk of a crash. Jayco will notify owners, send them new labels with the corrected information, free of charge. The recall began February 2, 2015. Owners may contact Jayco customer service at 1-800-283-8267. Jayco's number for this recall is 9901227.

15V-017

Frontline Communications (Frontline) is recalling certain model year 2007-2011 Mobile Medical Unit vehicles

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JANUARY 2015**

Published February 12, 2015

manufactured from December 13, 2007, to February 17, 2011, and equipped with certain model S2005, S2010, S5005, S5010, S5505, and S5510 wheelchair lifts manufactured by Ricon Corporation. The platform side plate of the affected wheelchair lifts may crack. If the platform side plates crack, the lift platform can separate from the lift and come to rest against the vehicle's lift door. When the doors are opened, the platform may fall out, increasing the risk of injury to the lift operator. Frontline will notify owners to contact Ricon Customer Service to arrange for the installation of supplemental platform support bumpers. Any platform that has already started cracking will be replaced, free of charge. The recall is expected to begin January 30, 2015. Owners may contact Frontline customer service at 1-727-573-0400, or Ricon customer service at 1-800-322-2884.

15V-018

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain model year 2011-2012 Audi S4, S5, Q7, 2012 Audi A6, Volkswagen Touareg Hybrid, and 2012-2013 Audi A7 vehicles. In the affected vehicles the fuel injection system may experience a fuel leak. A fuel leak in the injection system in the presence of an ignition source, increases the risk of a fire. Volkswagen will notify owners, and dealers will replace the fuel rails and corresponding seals, free of charge. The recall is expected to begin March 10, 2015. Owners may contact Audi customer service at 1-800-822-2834 or Volkswagen customer service at 1-800-893-5298. Volkswagen's numbers for this recall are 24AP for Audi customers and 24BK for Volkswagen customers.

15V-019

Polaris Industries, Inc. (Polaris) is recalling certain model year 2015 Slingshot motorcycles manufactured August 26, 2014, to December 16, 2014, and 2015 Slingshot SL motorcycles manufactured August 18, 2014, to December 15, 2014. The affected motorcycles may be equipped with roll hoops that do not meet hardness specifications. If the roll hoops do not meet strength specifications, in the event of a rollover crash they may not provide proper protection, increasing the risk of a personal injury. Polaris will notify owners, and dealers will replace the roll hoops, free of charge. The recall began on January 30, 2015. Owners may contact Polaris customer service at 1-651-408-7579. Polaris' number for this recall is SLI-15-01.

15V-020

Polar Tank Trailer, LLC (Polar) is recalling certain model year 2015 SRJH, APX0, and ATB6 trailers manufactured August 27, 2014, to November 29, 2014, equipped with certain Haldex Life Seal Type 30/30 Long Stroke Air Brake Actuators manufactured January 9, 2014, to October 28, 2014. The affected actuators may have an incomplete attachment of the internal rubber diaphragm to the actuation mechanism of the parking brake section of the Life Seal actuator. If the diaphragm is not completely attached, there may be internal leakage from the service section past the diaphragm, potentially trapping air pressure in the parking brake section. This air pressure in turn, if not vented, may prevent full release of the actuator unit, and may induce brake drag and may result in overheated wheelend service brakes, increasing the risk of a fire. Polar will notify owners, and dealers will inspect and replace the actuators, as necessary, free of charge. The recall is expected to begin February 17, 2015. Owners may contact Polar customer service at 1-320-746-2255. Polar's number for this recall is 14E075.

15V-021

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JANUARY 2015**

Published February 12, 2015

Polaris Industries, Inc. (Polaris) is recalling certain model year 2015 Slingshot motorcycles manufactured August 26, 2014, to January 9, 2015, and 2015 Slingshot SL motorcycles manufactured August 18, 2014, to January 10, 2015. In the affected motorcycles, the upper pinion bearing may fail on the steering rack assembly, resulting in the pinion gear disengaging from the steering rack. If the steering pinion gear disengages from the steering rack, a loss of steering control could result, increasing the risk of a crash. Polaris will notify owners, and dealers will replace the steering rack assembly, free of charge. The recall began on January 30, 2015. Owners may contact Polaris customer service at 1-855-863-2284. Polaris' number for this recall is SLI-15-02.

15V-022

Great Dane Trailers (Great Dane) is recalling certain model year 2015 Reefer and Van Trailers manufactured March 3, 2014, to October 31, 2014 equipped with certain Haldex Life Seal Type 30/30 Long Stroke Air Brake Actuators manufactured January 9, 2014, to October 28, 2014. The affected actuators may have an incomplete attachment of the internal rubber diaphragm to the actuation mechanism of the parking brake section of the Life Seal actuator. If the diaphragm is not completely attached, there may be internal leakage from the service section past the diaphragm, potentially trapping air pressure in the parking brake section. This air pressure in turn, if not vented, may prevent full release of the actuator unit, and may induce brake drag and may result in overheated wheelend service brakes, increasing the risk of a fire. Great Dane will notify owners, and dealers will inspect the brake actuator and replace, as necessary, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Great Dane customer service at 1-912-232-4471.

15V-023

Life Line Emergency Vehicles (Life Line) is recalling certain model year 2014-2015 Life Line-modified Ford F-Series emergency vehicles that are equipped with Liquid Spring-brand aftermarket suspension kits. The mounting bracket that attaches the suspension fluid tank to the frame may fail allowing the fluid tank to separate from the vehicle. If the suspension fluid tank mount fractures and the tank separates from the chassis, the tank may become a road hazard, increasing the risk of a crash. The remedy for this recall is still under development. The manufacturer has not yet provided a notification schedule. Owners may contact Life Line customer service at 1-563-578-3317.

15V-024

Mack Trucks, Inc. (Mack) is recalling certain model year 2015 CXU trucks manufactured May 20, 2014, to November 12, 2014 equipped with certain Haldex Life Seal Type 30/30 Long Stroke Air Brake Actuators manufactured January 9, 2014, to October 28, 2014. The affected actuators may have an incomplete attachment of the internal rubber diaphragm to the actuation mechanism of the parking brake section of the Life Seal actuator. If the diaphragm is not completely attached, there may be internal leakage from the service section past the diaphragm, potentially trapping air pressure in the parking brake section. This air pressure in turn, if not vented, may prevent full release of the actuator unit, and may induce brake drag and may result in overheated wheelend service brakes, increasing the risk of a fire. Mack will notify owners, and dealers will inspect the brake actuator and replace, as necessary, free of charge. The recall is expected to begin February 27, 2015. Owners may contact Mack customer service at 1-610-709-2131. Mack's number for this recall is SC0387.

15V-025

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JANUARY 2015**

Published February 12, 2015

Volvo Trucks North America (Volvo) is recalling certain model year 2015 VHD, VNL, and VNM trucks manufactured May 20, 2014, to November 20, 2014 equipped with certain Haldex Life Seal Type 30/30 Long Stroke Air Brake Actuators manufactured January 9, 2014, to October 28, 2014. The affected actuators may have an incomplete attachment of the internal rubber diaphragm to the actuation mechanism of the parking brake section of the Life Seal actuator. If the diaphragm is not completely attached, there may be internal leakage from the service section past the diaphragm, potentially trapping air pressure in the parking brake section. This air pressure in turn, if not vented, may prevent full release of the actuator unit, and may induce brake drag and may result in overheated wheelend service brakes, increasing the risk of a fire. Volvo will notify owners, and dealers will inspect the brake actuator and replace, as necessary, free of charge. The recall is expected to begin February 27, 2015. Owners may contact Volvo customer service at 1-800-528-6586. Volvo's number for this recall is RVXX1501.

15V-026

Autocar, LLC (Autocar) is recalling certain model year 2015 Xpeditor trucks manufactured May 22, 2014, to July 17, 2014. The Cummins ISB or ISL engines in these vehicles may have been equipped with Fleetguard UFF-XT fuel filters, part number FF63009, whose filter shell may separate from the fuel filter nut plate causing the engine to stall without warning. If the engine stalls unexpectedly there is an increased risk of a crash. Cummins will notify owners for Autocar, and dealers will replace the fuel filter with a non-defective one, free of charge. The recall began September 29, 2014. Owners may contact Autocar customer service at 1-765-489-5499, or Cummins customer service at 1-800-343-7357. Autocar's number for this recall is A-1410.

15V-027

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain model year 2014-2015 Jetta vehicles manufactured March 28, 2014, to November 24, 2014, 2014-2015 Passat vehicles manufactured April 7, 2014, to November 18, 2014, 2015 Golf and GTI vehicles manufactured July 1, 2014, to November 20, 2014, and 2014-2015 Beetle and Beetle Convertible vehicles manufactured March 31, 2014, to November 27, 2014. A sealing cap at the fuel rail may fail, allowing fuel to leak into the engine compartment. A fuel leak, in the presence of an ignition source, can result in a vehicle fire. Volkswagen will notify owners, and dealers will replace the fuel rails with new parts, free of charge. The recall began February 6, 2015. Owners may contact Volkswagen customer service at 1-800-822-8987. Volkswagen's number for this recall is 24BL. Note: This recall expands and supersedes recall 14V-809 (Volkswagen recall number 24Bi) and only affects vehicles not previously repaired under that campaign.

15V-028

TOR Truck Company (TOR) is recalling certain model year 2008 DR8490 drilling roq carrier vehicles, manufactured January 1, 2008, to June 1, 2008. In the affected vehicles the accelerator pedal mechanical power spring, may fail prematurely. This could cause the accelerator pedal to not return to idle position. If the mechanical power spring fails prematurely causing the accelerator pedal not to return to idle, it can increase the risk of a vehicle crash. TOR will notify owners, and dealers will inspect and replace the accelerator if stamped

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JANUARY 2015**

Published February 12, 2015

with a suspect serial number, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact TOR customer service at 1-514-912-0053.

15V-029

Highland Ridge RV (Highland) is recalling certain model year 3x recreational trailers manufactured August 5, 2014, to November 17, 2014 equipped with recalling Latitude Awnings styles GX and G manufactured April 10, 2014, to November 4, 2014 manufactured by Carefree of Colorado. The affected awnings may have screws that attach the lateral arm brackets to the mounting brackets that were not manufactured to specification. The screws could fail, causing the supporting bracket and the awning to fall and potentially injure a person beneath it. Highland will notify owners, and dealers will replace the defective screws, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Highland customer service at 1-260-768-7771, or Carefree customer service at 1-800-621-2617.

15V-030

General Motors LLC (GM) is recalling certain model year 2015 Chevrolet Corvette vehicles manufactured September 26, 2014, to October 2, 2014. In the affected vehicles the toe link outer ball joint on the rear suspension may not have been properly tightened during the assembly process. The Toe link may loosen with the vehicle use and eventually separate.

A toe link separation can result in a reduction in vehicle stability and steering control, increasing the risk of a vehicle crash. GM will notify owners, and dealers will inspect and replace any damaged parts, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact GM customer service at 1-800-222-1020 (Chevrolet). GM's number for this recall is 14857.

15V-031

Nissan North America, Inc. (Nissan) is recalling certain model year 2008-2013 Nissan Rogue vehicles manufactured March 7, 2007, to November 26, 2013, and 2014 Nissan Rogue Select vehicles manufactured September 23, 2013, to July 2, 2014. The affected vehicles may experience an electrical short in the harness connector due to a mixture of snow/water and salt seeping through the carpet on the driver side floor near the harness connector. An electrical short can cause a vehicle fire. Nissan will notify owners, and dealers will inspect the kick panel wiring harness connector and will if necessary install a new harness connector and waterproof seal, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Nissan customer service at 1-800-647-7261.

15V-032

Nissan North America, Inc. (Nissan) is recalling certain model year 2013-2014 Nissan Pathfinder vehicles manufactured June 20, 2012, to November 18, 2013, 2014 Nissan Pathfinder Hybrid vehicles manufactured July 18, 2013, to November 18, 2013, 2013 Infiniti JX35 vehicles manufactured November 29, 2011, to June 14, 2013, and 2014 QX60 vehicles manufactured May 16, 2013, to November 18, 2013, and 2014 Infiniti QX60 Hybrid vehicles manufactured July 18, 2013, to November 18, 2013. In the affected vehicles the hood release cable assembly may have been installed incorrectly preventing the latching claw from fully engaging. The secondary latch may remain in the open position when the hood is closed. If the primary hood latch is released and the secondary latch fails during operation of the vehicle, it could cause the hood to open during vehicle

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JANUARY 2015**

Published February 12, 2015

operation impairing the driver's vision, increasing the risk of a vehicle crash. Nissan will notify owners, and dealers will modify the angle of the hood release mechanism to provide additional length to the release cable, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Nissan customer service at 1-800-647-7261.

15V-033

BMW of North America, LLC (BMW) is recalling certain model year 2014-2015 MINI Cooper Hardtop two door vehicles manufactured December 1, 2013, to December 14, 2014. The affected vehicles may have been manufactured with an incorrect maximum capacity weight stated on the Tire Information Placard. Thus, these vehicles fail to comply with Federal Motor Vehicle Safety Standard (FMVSS) No. 110, "Tire Selection and Rims and Motor Home/Recreation Vehicle Trailer Load Carrying Capacity Information for Motor Vehicles with a GVWR of 4,536 kilograms (10,000 pounds) or less." The maximum weight listed on the label is incorrect (too low) and therefore does not comply with Federal Regulations. MINI will notify owners, and dealers will replace the incorrect labels with corrected labels, free of charge. Owners will notified by March 13, 2015. Owners may contact MINI customer service at 1-866-825-1525.

15V-034

DS Corp DBA Crossroads RV (DS Corp) is recalling certain model year 2015 Crossroads Z1 trailers manufactured June 26, 2014, to January 14, 2015. The affected trailers may have been produced with the incorrect front loading ramp weight rating on the labels, the label states the maximum load of 700 lbs and it should be a maximum load of 500 lbs. If the front loading ramps are overloaded it can cause the ramps to fail, increasing the risk of personal injury. DS Corp will notify owners, and supply with them with a corrected label to place over the existing labels, free of charge. The recall began February 3, 2015. Owners may contact DS Corp 1-260-593-3850. DS Corp's number for this recall is 35.

15V-035

PACCAR Incorporated (PACCAR) is recalling certain model year 2015 Peterbilt 389 Pride and Class edition vehicles manufactured October 1, 2014, to December 4, 2014, and equipped with electronic stability control (ESC). The affected vehicles were manufactured with an incorrect horn contact plate that may damage the ESC steering angle sensor. If the steering angle sensor is damaged, the ESC sensor may malfunction, increasing the risk of a vehicle crash. Peterbilt will notify owners, and dealers will replace the horn contact plate and the ESC steering angle sensor, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Peterbilt customer service at 1-940-591-4000. PACCAR's number for this recall is 115A.

15V-036

Jaguar Land Rover North America, LLC (Jaguar) is recalling certain model year 2015 Jaguar XJ vehicles manufactured July 2, 2014, to December 4, 2014. The affected vehicles may have an incorrect description of the operation of Occupant Sensor System (OSS) in the owner's manual. Since the manual does not correspond with the actual Air Bag Status Indicator Lamp, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) No. 208, "Occupant Crash Protection." If the occupant does not correctly understand how air bag functions, they may be at an increased risk of personal injury in the event of a crash. Jaguar will notify owners, and supply a supplement to add to the owner's handbook, free of charge. The

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JANUARY 2015**

Published February 12, 2015

recall is expected to begin March 13, 2015. Owners may contact Jaguar customer service at 1-800-452-4827. Jaguar's number for this recall is J050.

15V-037

Jaguar Land Rover North America, LLC (Jaguar) is recalling certain model year 2012-2015 Jaguar XK vehicles manufactured March 4, 2011, to March 20, 2014. In the affected vehicles, the front side lamps (parking lamps) may turn off after approximately 5 minutes. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) No. 108, "Lamps, Reflective Devices, and Associated Equipment." If the parking lamps turn off, the vehicle will have reduced conspicuity, increasing the risk of a crash. Jaguar will notify owners, and dealers will update software that controls the front side lamps, free of charge. The recall is expected to begin March 13, 2015. Owners may contact Jaguar customer service at 1-800-452-4827. Jaguar's number for this recall is J049.

15V-038

Jaguar Land Rover North America, LLC (Land Rover) is recalling certain model year 2006-2012 Land Rover Range Rover vehicles manufactured April 15, 2005, to September 4, 2012. One or both of the flexible front brake hoses may rupture causing loss of brake fluid. If one or both of the flexible brake hoses fails, the vehicle may require a longer distance to stop, increasing the risk of a crash. Land Rover will notify owners, and dealers will replace the left and right front brake hoses, free of charge. The recall is expected to begin March 13, 2015. Owners may contact Land Rover customer service at 1-800-637-6837. Land Rover's number for this recall is P054.

15V-039

Ford Motor Company (Ford) is recalling certain model year 2010-2013 Ford Taurus vehicles manufactured December 1, 2009, to July 31, 2010, and 2011-2013 Lincoln MKS vehicles manufactured June 1, 2011, to October 31, 2011. In the affected vehicles, the interior door handle return spring may unseat, resulting in interior door handle that does not return to the fully stowed position after actuation. If the interior door handle return spring is unseated, the door may unlatch in the event of a side impact crash, increasing the risk of personal injury. Ford will notify owners, and dealers will inspect all four of the interior door handles and either repair or replace them, free of charge. The recall is expected to begin March 16, 2015. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 15S02.

15V-040

Chrysler is recalling certain model year 2014-2015 Jeep Cherokee vehicles manufactured January 1, 2013, to November 19, 2014. The affected vehicles may experience unintended side curtain and seat air bag deployment during vehicle operation. If the air bags deploy unexpectedly during vehicle operation, it can increase the risk of personal injury and increase the risk of a crash. Chrysler will notify owners, and dealers will re-flash the occupant restraint control module software, free of charge. The recall is expected to begin on March 26, 2015. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is R05.

15V-041

Jaguar Land Rover North America, LLC (Land Rover) is recalling certain model year 2013-2014 Land Rover

SAFETY DEFECT/NONCOMPLIANCE NOTICES RECEIVED DURING JANUARY 2015

Published February 12, 2015

Range Rover vehicles manufactured August 16, 2012, to January 8, 2014, and 2014 Land Rover Range Rover Sport vehicles manufactured May 7, 2013, to January 8, 2014. In the affected vehicles, the brake vacuum hose may have been incorrectly routed allowing a hole to be worn into it. If a hole is worn into the brake vacuum hose, a complete loss of braking assistance could occur, lengthening the distance required to stop the vehicle and increasing the risk of a crash. Land Rover will notify owners, and dealers will inspect the brake vacuum hose and correctly route it, as necessary, free of charge. Any brake vacuum hose that is damaged will be replaced, free of charge. The recall is expected to begin March 13, 2015. Owners may contact Land Rover customer service at 1-800-637-6837. Land Rover's number for this recall is P052.

15V-042

Toyota Motor Engineering & Manufacturing (Toyota) is recalling certain model year 2003-2004 Toyota Corolla vehicles manufactured December 28, 2001, to May 2, 2004, 2003-2004 Toyota Corolla Matrix vehicles manufactured January 6, 2002, to April 29, 2004, 2003-2004 Avalon vehicles manufactured June 5, 2002, to December 20, 2004, and 2003-2004 Pontiac Vibe vehicles manufactured January 18, 2002, to April 27, 2004. Due to electrical noise, a component in the air bag control module may fail, causing the front air bags, side air bags, and/or seatbelt pretensioners to deploy inadvertently while the vehicle is being operated. Inadvertent deployment of the air bags or the seat belt pretensioners increases the risk of an injury or crash. Toyota will notify their owners. Pontiac Vibe owners will be notified by GM. Dealers will replace the air bag control module, free of charge. These parts are not currently available, however, an interim repair is available, free of charge, that reduces the risk of an inadvertent deployment. This recall remedy was applied during earlier recall campaigns of these vehicles under safety recalls 13V-029 and 14V-147. All owners that have not had a recall repair performed under safety recalls 13V-029 or 14V-147 are strongly encouraged to have it performed and not wait for the final remedy to be deployed to the field. The replacement ECU parts needed for the final remedy are not expected to be available until the latter part of 2015. Owners will be mailed an interim notification in late March 2015 and will be mailed a follow up notification when new air bag control modules are available. Toyota owners may contact Toyota customer service at 1-800-331-4331. Pontiac owners may call 1-800-620-7668. Note: This recall supersedes recalls 13V-029 and 14V-147. Vehicles that had a noise filter installed as the remedy for one of those campaigns need to have the air bag control module replaced under this campaign.

15V-043

General Motors LLC (GM) is recalling certain model year 2015 Buick Enclave vehicles manufactured December 9, 2014, to January 14, 2015, 2015 Chevrolet Traverse vehicles manufactured December 9, 2014, to January 20, 2015, and 2015 GMC Acadia vehicles manufactured December 9, 2014, to January 16, 2015, and all equipped with Goodyear P255/65R18 Fortera HL tires. These vehicles are equipped with tires that may experience tread cracking. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) No. 110, "Tire Selection and Rims and Motor Home/Recreation Vehicle Trailer Load Carrying Capacity Information for Motor Vehicles with a GVWR of 4,536 kilograms (10,000 pounds) or Less." If the tire treads crack, a loss of tire pressure and possible tire failure may result, increasing the risk of a crash. GM will notify owners, and dealers will replace the tires that were manufactured within a specific date range, free of charge. This manufacturer has not yet provided a notification schedule. Owners may contact GM customer service at 1-800-521-7300 (Buick), 1-800-222-1020 (Chevrolet), or 1-800-462-8782 (GMC). GM's number for this recall is 15025/15067. Note: This recall is for Goodyear P255/65R18 Fortera HL tires

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JANUARY 2015**

Published February 12, 2015

installed as original equipment. For tires that were purchased as replacement equipment, see recall 15T-002.

15V-044

Honda is recalling certain model year 2003-2004 Honda Odyssey vehicles manufactured February 13, 2002, to August 13, 2004, and 2003 Acura MDX vehicles manufactured February 21, 2002, to September 23, 2003. Due to electrical noise, a component in the air bag control module may fail, causing the front air bags, side air bags, and/or seatbelt pretensioners to deploy inadvertently while the vehicle is being operated. Inadvertent deployment of the air bags may increase the risk of injury and the possibility of a vehicle crash. Honda dealers will replace the supplemental restraint system electronic control unit (SRS ECU). These parts are not currently available, however, an interim repair is available free of charge that reduces the risk of an inadvertent deployment. This recall remedy was applied during an earlier recall campaign of these vehicles under safety recall 13V-412. All owners that have not had the recall repair performed under safety recall 13V-412 are strongly encouraged to have it performed and not wait for the final remedy to be deployed to the field. The replacement ECU parts needed for the final remedy are not expected to be available until the latter part of 2015. Owners will be mailed an interim notification by late March 2015. Owners may contact Honda customer service at 1-800-999-1009. Honda's number for this recall is JN6 (Odyssey), and JN7 (MDX). Note: This recall supersedes recall 13V-412. Vehicles that had a noise filter installed as the remedy for that campaign need to have the SRS ECU replaced under this campaign.

15V-045

Chrysler (FCA US LLC) is recalling certain model year 2002-2003 Jeep Liberty vehicles manufactured January 9, 2001, to March 28, 2003, 2002-2004 Jeep Cherokee vehicles manufactured February 13, 2001, to May 23 2003, and 2003-2004 Dodge Viper vehicles manufactured November 1, 2001, to June 30, 2004. Due to electrical noise beyond the tolerance of the air bag electronic control module (ECM), a component in the ECM may fail, causing the front air bags, side air bags, and/or seatbelt pretensioners to deploy inadvertently while the vehicle is being operated. Inadvertent deployment of the air bags may increase the risk of injury and the possibility of a vehicle crash. Chrysler dealers will replace the air bag control module and front and/or side impact sensors as required, free of charge. These parts are not currently available, however, an interim repair is available free of charge that reduces the risk of an inadvertent deployment. This recall remedy was applied during earlier recall campaigns of these vehicles under safety recalls 12V527 and 13V040. All owners that have not had the recall repair performed under safety recalls 12V527 or 13V040 are strongly encouraged to have it performed and not wait for the final remedy to be deployed to the field. The replacement ECM parts needed for the final remedy are not expected to be available until the latter part of 2015. Owners will be mailed an interim notification in late March 2015 and will be mailed a follow up notification when new air bag control modules are available. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is R06.

15V-046

Toyota Motor Engineering & Manufacturing (Toyota) is recalling certain model year 2011-2012 Toyota Avalon vehicles manufactured February 9, 2010, to October 22, 2012. In the affected vehicles, the sub-woofer speaker located in the trunk may experience an intermittent electrical short, causing damage to the integrated circuit (IC), creating a short circuit between the power supply and the sub-woofer. If the wiring to the sub-woofer short

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JANUARY 2015**

Published February 12, 2015

circuits, it may overheat, increasing the risk of a fire. Toyota will notify owners, and dealers will provide a remedy for the audio system, free of charge. Until the remedy is available, Toyota will mail an interim notice and dealers will disconnect the sub-woofer. The manufacturer has not yet provided a notification schedule. Owners may contact Toyota customer service at 1-888-270-9371.

15V-047

Grech Motors L.L.C. (Grech) is recalling certain model year 2014-2015 G40M2 shuttle buses built on Freightliner M2 truck chassis, manufactured August 26, 2013, to December 10, 2014. In the affected vehicles, the batteries may not be installed in the correct position which could allow the positive battery terminals and clamps to contact the grounded battery retention bracket. If the positive battery terminals contact the retention bracket, an electrical short would result, increasing the risk of a fire. Grech will notify owners, and dealers will correct the battery installation, free of charge. The recall is expected to begin in February 2015. Owners may contact Grech customer service at 1-855-994-7324.

15V-048

Heartland Recreational Vehicles, LLC (Heartland) is recalling certain model year 2015 Heartland Big Country 3800FL vehicles manufactured October 22, 2014, to December 16, 2014 and 2015 Heartland Big Country 3900FLP vehicles manufactured September 23, 2014, to January 12, 2015, 2015 Heartland Big Horn 3750FL vehicles manufactured September 3, 2014, to January 14, 2015. In the affected recreational vehicles, the axles may be placed too far forward on the frame resulting in improper weight distribution across the axles. Improper weight distribution across the axles may result in poor handling, increasing the risk of a crash. Heartland will notify owners, and dealers will move the axles rearward to help with weight distribution on the Big Horn, and 3800 FL Big Country, and will add a ballast to the pin box to improve handling the 3900 FLP Big Country, free of charge. The recall is expected to begin February 16, 2015. Owners may contact Heartland customer service at 1-877-262-8032. Heartland's number for this recall is 99-01-19.

15V-049

Ford Motor Company (Ford) is recalling certain model year 2014 Ford Transit Connect vehicles manufactured November 6, 2013, to September 20, 2014. In the affected vehicles, the upper seat belt bolts may have been improperly torqued, allowing them to loosen over time. If the seat belt anchorage fasteners loosen over time, there is an increased risk of personal injury in the event of a crash. Ford will notify owners, and dealers will replace the original seatbelt fasteners with properly torqued fasteners, free of charge. The recall is expected to begin March 23, 2015. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 15S03.

15V-050

PACCAR Incorporated (PACCAR) is recalling certain model year 2015 Peterbilt 210, 220, 320, and Kenworth K270, K370, T660, T800, T880 trucks manufactured July 21, 2014, to September 16, 2014. The brake caliper bolts may not be properly torqued. As a result, the brake caliper bolts may loosen, reducing the effectiveness of the brakes and increasing the risk of a crash. PACCAR will notify owners, and dealers will inspect, and tighten or replace any loose caliper bolts, as necessary, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Peterbilt customer service 1-940-591-4000, or Kenworth

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JANUARY 2015**

Published February 12, 2015

customer service at 1-425-828-5000. PACCAR's number for this recall is 15KWA (Kenworth) and 115B (Peterbilt).

15V-051

All Wheel Drive Equipment Mfg., Inc. (All Wheel) is recalling one model year 2011 Ford F-550 truck with a 6.8L gasoline engine manufactured May 14, 2010, to May 28, 2010. The affected vehicle is equipped with a PTO Assembly Pressure Switch, part number FR67, used with power take off (PTO) assemblies for Ford F-550 chassis. The PTO switch may leak oil onto the thermal blanket. The leaking oil may soak into the thermal blanket covering the exhaust, which when combined with heat from exhaust, may result in an increased risk of fire. All Wheel has notified the owner and will install a new pressure switch kit that moves the switch away from the exhaust system, free of charge. Owners may contact All Wheel customer service at 1-800-311-4778.

15V-052