

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2015**

Published April 20, 2015

CHILD SEATS:

None during March 2015.

EQUIPMENT:

Ford Motor Company (Ford) is recalling certain Motorcraft STG-454 service replacement steering gears manufactured July 1, 2014, to October 17, 2014. These steering gears are for use on 2008-2010 model year F-250 and F-350 vehicles equipped with 6.4L diesel engines. The affected steering gears may not install properly, and as a result, there may be insufficient clamp load on the joints which may cause the steering gear retention bolts to fracture. Steering gear retention bolt fractures may cause a loss of steering control, increasing the risk of a vehicle crash. Ford will notify owners, and dealers will install a spacer between the steering gear and the vehicle frame rail to ensure adequate clamp load on the joints, free of charge. The interim notices are expected to be mailed in April 2015. A second notice will be mailed to owners when parts become available. A remedy is expected in June 2015. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 15S08.

15E-014

Agility Fuel Systems (Agility) is recalling certain LNG Fuel Systems, part numbers 23811000, 23812000, 23813000, 23820000, 23821000 and 23822000, manufactured October 1, 2013, to February 27, 2015 and installed on heavy duty vehicles originally sold in, or currently registered in, Connecticut, Delaware, Illinois, Indiana, Iowa, Maine, Maryland, Massachusetts, Michigan, Minnesota, Missouri, New Hampshire, New Jersey, New York, Ohio, Pennsylvania, Rhode Island, Vermont, West Virginia, Wisconsin and the District of Columbia. The affected fuel systems have solenoid valves may corrode from exposure to road salt. The corrosion may cause the solenoid valve coil to fail and stop the flow of fuel to the engine. As a result, the vehicle would stall, increasing the risk of a crash. Agility will notify the affected vehicle manufacturers and they will contact their owners. Dealers will replace or repair the defective solenoid valve coils, free of charge. The recall is expected to begin April 20, 2015. Owners may contact Agility customer service at 1-949-236-5520.

15E-015

Taizhou Tianda Rope & Belt Co. Ltd (Taizhou Tianda) is recalling certain Seat Belts, model TN (part number 67SA1-04501-A1), manufactured June 1, 2013, to October 20, 2013. Improper manufacturing of the seat belt buckle may prevent the seat belts from being easily unlatched. If the seat belt cannot be easily unlatched, egress from the vehicle could be hindered, increasing the risk of injury in the event of an emergency. Taizhou Tianda will notify the affected vehicle manufacturer who will contact the owners and replace the defective buckles, free of charge. The recall began March 31, 2015. Owners may contact Taizhou Tianda customer service at 1-866-617-2127.

15E-016

Haldex Commercial Vehicle Systems (Haldex) is recalling certain Haldex Life Seal Type 30/30 Long Stroke Air Brake Actuators, part number 1533030XXX/LC3030L, manufactured December 17, 2013, to February 18, 2015. The affected actuators may have an incomplete attachment of the internal rubber diaphragm to the actuation mechanism of the parking brake section of the Life Seal actuator. If the diaphragm is not completely

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2015

Published April 20, 2015

attached, there may be internal leakage from the service section past the diaphragm, potentially trapping air pressure in the parking brake section. This air pressure in turn, if not vented, may prevent full release of the actuator unit, and may induce brake drag and may result in overheated wheelend service brakes, increasing the risk of a fire. Haldex will notify their affected vehicle manufacturing customers, and their dealers will remove and replace the Haldex Life Seal Type 30/30 long stroke actuators with Haldex Gold Seal Type 30/30 long stroke actuators, free of charge. The recall is expected to begin in March 2015. Owners may contact Haldex customer service at 1-800-752-2501 or HaldexHotline@Haldex.com. Note: This recall supersedes recall 14E-075. Any affected vehicle whose brake chamber was previously inspected but not replaced is included in this recall.

15E-017

Multiprens, USA, Inc. (Multiprens) is recalling certain STK-100 triangle kits manufactured October 4, 2011, to July 21, 2014. The affected triangle kits may have an incorrect inner border of the orange florescent material, the triangles may not be as reflective as required, and the reflector color may not be correct. Additionally, the triangles may also move under wind load, and may be subject to joint separation and discoloration after being used. As such, these triangle kits fail to comply with the requirements of Federal Motor Vehicle Safety Standard No. 125, "Warning Devices." Failure of the warning triangles to meet the Safety Standard requirements may result in other vehicles not being warned about a disabled vehicle, increasing the risk of a crash. Multiprens will notify owners and advise them to return the triangle kits for a full refund. The recall is expected to begin in April 2015. Owners may contact Multiprens customer service at 1-913-371-6999. Multiprens' number for this recall is MUSA0814.

15E-018

Harbor Freight Tools (Harbor Freight) is recalling certain Haul Master LED Trailer Light Kits, item number 60597, manufactured May 3, 2013, to February 5, 2015, Haul Master Deluxe 12V Trailer Light Kits, item number 93861, manufactured February 4, 2006, to February 5, 2015, and Haul Master Deluxe 12V Trailer Light Kits, item number 69624, manufactured March 29, 2013, to February 5, 2015. Item 60597 may be missing red side-marker lamps. Item 93861 may have an incorrectly positioned rear lamp bracket that may not illuminate the license plate. Item 69624 may have lenses that are not compliant. As such, these kits fail to meet the requirements of Federal Motor Vehicle Safety Standard (FMVSS) No. 108, "Lamps, Reflective Devices, and Associated Equipment." If the trailer lights fail to comply with the safety standards, the trailer may be less visible to other drivers, increasing the risk of a crash. Harbor Freight will notify its website or catalogue customers by direct mail. In addition, Harbor Freight will notify its customers by posting notices at its retail store locations and on its online website. Harbor Freight will provide affected customers with a complete tail light replacement package at no charge to customer. The manufacturer has not yet provided a notification schedule. Owners may contact Harbor Freight customer service at 1-805-388-1000.

15E-019

Meritor, Inc. (Meritor) is recalling certain MT-40-14X Rear Drive Train axles manufactured November 11, 2014, to December 18, 2014. Due to an incorrect carrier and housing combination, the axles may have low lubricant levels that can cause the axle sump to inadequately circulate lubricant to the wheel end hub assembly. Without adequate lubrication to the wheel end hub assembly, the bearings may fail prematurely, increasing the

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2015**

Published April 20, 2015

risk of a crash. Meritor will notify owners, and dealers will change the axle, and inspect the wheel ends for damage, replacing the components of the wheel ends, as necessary, free of charge. Owners may contact Meritor customer service at 1-248-435-1725. Meritor's number for this recall is C15AC.

15E-020

Bendix Commercial Vehicle Systems LLC (Bendix) is recalling certain TR-3 Inversion Air Brake Valves, part number 101450, manufactured February 6, 2014, to October 15, 2014. The bodies of the affected inversion valves may have incorrect dimensions, possibly causing the brakes to drag and overheat. If the defective valve causes the brakes to drag and overheat, there is an increased risk of a wheel end fire. Bendix will notify the affected vehicle manufacturers who will notify their vehicle owners. Bendix will provide a repair kit, free of charge. The recall is expected to begin April 20, 2015. Owners may contact Bendix customer service at 1-800-247-2725 and select Option 1 for Customer Service.

15E-021

Buy4easy Inc (Buy4easy) is recalling certain TMS JX-A111 full face motorcycle helmets with visor, size large, manufactured June 1, 2013, to September 30, 2013. During testing, the shell of the affected motorcycle helmets fractured and the liner split thereby failing to meet the penetration and retention requirements. Additionally, the helmet label does not meet the DOT standard. As such, these helmets fail to meet the requirements of Federal Motor Vehicle Safety Standard (FMVSS) No. 218, "Motorcycle Helmets." The wearer of this helmet may not be properly protected in the event of crash, increasing their risk of injury. Buy4easy will notify owners and will offer a full refund. The recall is expected to begin on, or about, April 29, 2015. Owners may contact Buy4easy customer service at 1-626-388-9898.

15E-023

Gillig LLC (Gillig) is recalling one Recaro Automotive Seating Ergo M bus driver seat sold through the Gillig aftermarket parts department. The affected seat was manufactured in a way that the tether bar may push into the retractor panel door and potentially interfere with the seat belt locking mechanism. If the seat belt locking mechanism does not function as intended, the bus driver may not be properly restrained, increasing the risk of personal injury in the event of a crash. Gillig will notify the owner, and Recaro will provide a remedy that will reorient the seat belt retractor and tether bar mounting, free of charge. The recall began on March 31, 2015. Owners may contact Gillig customer service at 1-510-785-1500.

15E-024

Ohlins Racing AB (Ohlins) is recalling certain TTX36 aftermarket motorcycle shock absorbers manufactured November 5, 2013, to February 20, 2015. A complete list of the affected models and the motorcycles that they fit can be viewed by clicking on file RCORRD-15E025-7729.pdf under Associated Documents. The nut on the damper rod for these shock absorbers may loosen, resulting in a loss of damping and the possible disassembling of the shock. If the piston rod nut loosens, shock absorber performance would be affected, possibly causing a loss of vehicle control and increasing the risk of a crash. Ohlins will notify owners, and dealers will secure the rod nut, free of charge. Owners are advised not to ride their motorcycles until the recall remedy has been performed. The recall is expected to begin in April 2015. Owners may contact Ohlins customer service at 1-800-336-9029.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2015**

Published April 20, 2015

15E-025

Buy4easy Inc (Buy4easy) is recalling certain TMS JX-A5005 full face helmets with visors, size XL, manufactured June 1, 2013, to July 15, 2013. The affected motorcycle helmets failed the penetration test. Additionally, the helmet label does not meet DOT regulations. As such, these helmets fail to meet the requirements of Federal Motor Vehicle Safety Standard (FMVSS) No. 218, "Motorcycle Helmets." The wearer of this helmet may not be properly protected in the event of vehicle crash. Buy4easy will notify owners and will offer a full refund. The recall is expected to begin on, or about, May 6, 2015. Owners may contact Buy4easy customer service at 1-626-388-9898.

15E-026

TIRES:

None during March 2015.

VEHICLES:

Prevost Cars, Inc. (Prevost) is recalling certain model year 2014-2015 Prevost XLII-45, X3-45, X3-45 VIP, H3-41, H3-45, and H3-45 VIP motorcoaches manufactured July 23, 2013, to November 28, 2014, and equipped with certain Kidde plastic valve disposable handheld fire extinguishers. These fire extinguishers may not fully discharge as designed when the lever is pressed. In the event of a fire, if the fire extinguisher does not work correctly, there is an increased risk of injury to the bus occupants. Prevost will notify owners, and dealers will inspect and replace the fire extinguisher if necessary, free of charge. The recall began March 27, 2015. Owners may contact Prevost customer service at 1-877-773-8678. Prevost's number for this recall is SR15-03.

15V-119

Wheeled Coach Industries, Inc. (Wheeled Coach) is recalling certain model year 2010 ambulances manufactured May 4, 2010, to September 24, 2010 on Freightliner Business Class M2 chassis. The affected vehicles may have a loss of instrument panel cluster functions, loss of cab or instrument lighting and other electrical issues. Without cab or instrument lighting, the emergency responders are unable to service patients, potentially furthering their injuries. All affected vehicles have already been repaired by Wheeled Coach, free of charge. Owners may contact Wheeled Coach customer service at 1-800-628-8178.

15V-120

American Honda Motor Co. (Honda) is recalling certain model year 2014 Accord L4 vehicles manufactured July 29, 2014, to July 31, 2014, 2015 Accord L4 vehicles manufactured August 14, 2014, to January 30, 2015, and 2015 CR-V vehicles manufactured September 9, 2014, to February 6, 2015. The affected vehicles may have been assembled with improperly torqued connecting rod bolts, which can cause the engine to lose power or leak oil. Loss of engine power may result in a vehicle stall, increasing the risk of a crash. If the engine leaks oil in the proximity of hot engine or exhaust components, there is an increased risk of a fire. Honda will notify owners,

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2015**

Published April 20, 2015

and dealers will replace the engine short block, free of charge. The recall began on March 27, 2015. Owners may contact Honda customer service at 1-888-234-2138. Honda's number for this recall is JP2 (for Accord models) and JP3 (for CR-V models).

15V-121

Prevost Cars, Inc. (Prevost) is recalling certain model year 2007-2012 XLII, X3-45, H3-41, H3-45, and H3-45 VIP vehicles manufactured July 5, 2007, to May 11, 2012. The affected vehicles may be missing a fuel line locating clip, allowing the fuel line to rub against the braided coolant hose. The fuel line rubbing may result in abrasion and a fuel leak, increasing the risk of a fire. Prevost will notify owners, and dealers will inspect the fuel line for abrasion, replacing it as necessary, and will properly secure the fuel line and coolant line, free of charge. The recall began on March 26, 2015. Owners may contact Prevost customer service at 1-418-883-3391. Prevost's number for this recall is SR15-04.

15V-122

Kia Motors America (Kia) is recalling certain model year 2014-2015 Soul and Soul electric vehicles manufactured July 21, 2013, to January 8, 2015. A section of the accelerator pedal may bend and fracture. If the vehicle has a bent or broken accelerator pedal, the driver may have difficulty accelerating the vehicle, increasing the risk of a crash. Kia will notify owners, and dealers will add a supporting rubber underneath the pedal stopper, free of charge. The recall began on March 24, 2015. Owners may contact Kia customer service at 1-800-333-4542. Kia's number for this recall is SC116.

15V-123

Blue Bird Body Company (Blue Bird) is recalling certain 2016 All American school buses manufactured from September 11, 2014, through January 8, 2015. In the affected vehicles, a clamp on the steering shaft may come in contact with the rubber boot at the floor. If the steering shaft clamp comes into contact with the rubber boot, additional effort would be needed to steer the vehicle, increasing the risk of a crash. Blue Bird will notify owners, and dealers will relocate the rubber boot and install a new steering shaft clamp, free of charge. The recall began on March 25, 2015. Owners may contact Blue Bird Customer Service at 1-478-822-2242. Blue Bird's number for this recall is R14XE. Note: This recall is an expansion of recall 14V-309.

15V-124

Forest River, Inc. (Forest River) is recalling certain 2015 XLR XLF375AMP, XLR XLF380AMP, XLR XLF386X12HP, XLR XLF395AMP, XLR XLF415AMP, and XLR XLF425AMP recreational vehicles and toy haulers. The vehicles may be equipped with the incorrect hitch assembly rating information. The correct gross vehicle weight rating (GVWR) is 18,000lbs, however the Certification label states that the GVWR rating is 21,000lbs. As such, these trailers fail to conform to Part 567, "Certification." If the trailer is loaded based on the incorrect GVWR, the hitch assembly would be overloaded which may result in hitch assembly failure, causing a loss of control and increasing the risk of a crash. Forest River will notify owners and will send corrected Certification, Tire Information, and Cargo Carrying Capacity labels, free of charge. The recall began on March 25, 2015. Owners may contact Forest River customer service at 1-574-206-7600. Forest River's number for this recall is 45-03022015.

15V-126

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2015**

Published April 20, 2015

Daimler Trucks North America LLC (DTNA) is recalling certain model year 2007-2011 Freightliner Cascadia trucks manufactured March 26, 2007, to August 31, 2010. Water may leak into the Signal-detection and Activation Module (SAM) Chassis causing corrosion which may result in electrical shorts or possible intermittent operation of trailer lights. Intermittent operation of the trailer lights may prevent other drivers from knowing that the truck is slowing or stopping, increasing the risk of a vehicle crash. Additionally, an electrical short in the SAM chassis may result in a fire. DTNA will notify owners, and dealers will inspect the SAM chassis for corrosion, replacing it as necessary. Any vehicle that does not have a drip shield mounted in the cab over the SAM chassis will receive one. These repairs will be performed free of charge. The recall is expected to begin May 4, 2015. Owners may contact DTNA customer service at 1-800-745-8000. DTNA's number for this recall is FL-679.

15V-127

Forest River, Inc. (Forest River) is recalling certain model year 2015 Wildcat WCF275CKX, WCF272RLX, WCF295RSX, WCF293REX, WCF282RKX, and WCF312BHX recreational fifth wheel trailers manufactured November 6, 2014, to February 18, 2015. The affected vehicles may be equipped with Federal Certification Labels that incorrectly state the gross vehicle weight rating (GVWR) to be 13,000lbs. when the correct GVWR is 11,999lbs. As such, these trailers fail to conform to Part 567, "Certification." If the trailer is overloaded, the trailer pin box (the connection point for the trailer to the vehicle) may fail, resulting in a loss of control, increasing the risk of a crash. Forest River will notify owners and will send corrected Federal Certification Labels, free of charge. The recall began on March 24, 2015. Owners may contact Forest River customer service at 1-574-206-7600.

15V-128

NABI Bus, LLC (NABI) is recalling certain model year 2014 40LFW city transit buses manufactured September 12, 2014, to December 31, 2014. The affected buses have front axles whose tie rod nuts may be improperly torqued. If the tie rod nuts are not properly torqued, the tie rod may not be adequately secured, resulting in a loss of vehicle control and increasing the risk of a crash. NABI will notify owners, and dealers will be retorqued the tie rod nuts, free of charge. The recall began on March 20, 2015. Owners may contact NABI customer service at 1-256-241-1298. NABI's number for this recall is 20151.

15V-129

Forest River, Inc. (Forest River) is recalling certain model year 2015 XLR Nitro XLT31FQSL recreational vehicles manufactured July 21, 2014, to January 31, 2015 and configured with a garage in the rear of the trailer and an optional fueling station. If the fueling station nozzle is fully extended and pulled as far forward as possible, the hose may be too close to the fuel burning appliance to prevent the fuel vapors from igniting. If the vapor from the fueling nozzle is able to reach the fuel burning appliance, there is an increased risk of a vehicle fire. Forest River will notify owners, and dealers will relocate the fueling station box and hose nozzle to a safe distance from the fuel burning appliance, free of charge. The recall began on March 30, 2015. Owners may contact Forest River customer service at 1-574-642-0437. Forest River's number for this recall is 45-02102015.

15V-130

Forest River, Inc. (Forest River) is recalling one model year 2015 XLR Hyperlite XLR31FDK recreational

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2015**

Published April 20, 2015

vehicle manufactured September 30, 2014, to November 25, 2015, and equipped with a front deck for carrying motorcycles and quad runners and an optional fueling station. If the fueling station nozzle is fully extended and pulled as far forward as possible, the hose may be too close to the fuel burning appliance to prevent the fuel vapors from igniting. If the vapors released by fueling a vehicle stored in the trailer is able to reach the flame or heating element of a fuel burning appliance it may ignite, increasing the risk of a fire. The single unit affected by this campaign is still at the dealership and will be repaired by the dealer before delivery to the new owner. Therefore, an owner notification letter will not be issued for this campaign. The recall began on April 3, 2015. Owners may contact Forest River customer service at 1-574-642-0437. Forest River's number for this recall is 45-02172015.

15V-131

PACCAR Incorporated (PACCAR) is recalling certain model year 2006-2016 Peterbilt 587, 579, 567, 389, 388, 387, 385, 382, 379, 378, 367, 365 and 357 trucks manufactured July 25, 2005, to February 26, 2016. The affected vehicles may be equipped with Tire and Rim Certification Labels that list a tire pressure below the actual correct amount. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard No. 120, "Tire selection and rims and motor home/recreation vehicle trailer load carrying capacity information for motor vehicles with a GVWR of more than 4,536 kilograms (10,000 pounds)." If the tires are underinflated due to the incorrect inflation pressure listed on the label, the truck may not be able to carry the maximum gross vehicle weight rating (GVWR) load listed without experiencing tire failure which would increase the risk of a crash. Peterbilt will notify owners and mail them a corrected Tire and Rim certification label, free of charge. The recall is expected to begin in May 2015. Owners may contact Peterbilt customer service at 1-940-591-4000. PACCAR's number for this recall is 215-D.

15V-132

Tiffin Motorhomes, Inc. (Tiffin) is recalling certain model year 2014 Breeze motorhomes. The affected vehicles may be equipped with a steering knuckle that may fracture. If the steering knuckle fails while the motorhome is being driven, a loss of vehicle control may result, increasing the risk of a crash. Tiffin will notify owners, and dealer representatives will come to where the motorhome is parked, looking for any steering knuckle in the affected production lot. If the the motorhome has one the the subject steering knuckles, the vehicle will be towed to the dealer and the knuckle will be replaced, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Tiffin customer service at 1-256-356-8661.

15V-133

Toyota Motor Engineering & Manufacturing (Toyota) is recalling certain model year 2012-2015 Yaris vehicles manufactured August 31, 2011, to February 9, 2015, and sold in Puerto Rico. The affected vehicles may have been manufactured with a roof headliner that does not provide the proper occupant protection in the event of a crash. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) No. 201, " Occupant Protection in Interior Impact." If the vehicles are equipped with a headliner that does not meet the impact requirements, there is an increased risk of occupant injury in the event of a crash. Toyota will notify owners, and dealers will replace the headliner, free of charge. The recall is expected to begin in mid-April 2015. Owners may contact Toyota customer service at 1-800-331-4331.

15V-134

SAFETY DEFECT/NONCOMPLIANCE NOTICES RECEIVED DURING MARCH 2015

Published April 20, 2015

Winnebago Industries, Inc. (Winnebago) is recalling certain model year 2015 Winnebago ERA, View, and Itasca Navion vehicles manufactured September 11, 2014, to February 27, 2015 and built on a Mercedes-Benz Sprinter Chassis. In the affected vehicles, the abutting wedge, a component attached to the door jamb to make opening the door easier after a severe frontal impact, may have been installed incorrectly. If a vehicle that has an incorrectly installed abutting wedge is involved in a severe frontal accident, a greater force may be necessary to open the doors, increasing the risk of injury. Mercedes-Benz notify owners, and their dealers will check the installation of the abutting wedge, correcting it as necessary, free of charge. The recall began in March 2015. Owners may contact Mercedes-Benz Sprinter customer service at 1-877-762-8267.

15V-135

Blue Bird Body Company (Blue Bird) is recalling certain model year 2013-2016 All American A3FE, A3RE, T3FE, T3RE, and D3RE school buses manufactured June 28, 2012, to September 25, 2014, and 2013-2016 Vision BBCV school buses manufactured June 9, 2012, to September 30, 2014. Incorrect fasteners may have been used to secure the seat gusset reinforcement to the side wall resulting in the seat belts being improperly anchored. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) No. 210, "Seat Belt Assembly Anchorages." If the seat belts are improperly anchored, there is an increased risk of occupant injury in the event of a crash. Blue Bird will notify owners, and dealers will inspect the the seat gusset reinforcement mounting fasteners, and will install an additional gusset reinforcement bracket, as necessary, free of charge. The recall began on April 2, 2015. Owners may contact Blue Bird customer service at 1-478-822-2242. Blue Birds number for this recall is R15YC-SB.

15V-136

Mercedes-Benz USA, LLC. (MBUSA) is recalling certain model year 2015 CLS 400 and CLS 400 4matic, 2012-2015 CLS 550 and CLS 550 4matic, 2012-2013 CLS 63, 2014 CLS 63, and 2014-2015 CLS 63P. The affected vehicles have LED tail lights that may not light on the sides, reducing the rear side visibility of the vehicle. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) No. 108, "Lamps, Reflective Devices, and Associated Equipment." Reduced rear side marker illumination may prevent other drivers from seeing the vehicle, increasing the risk of a crash. MBUSA will notify owners, and dealers will update the lighting controller software, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact MBUSA customer service at 1-800-367-6372. MBUSA's number for this recall is 2015030005.

15V-137

Mercedes-Benz USA, LLC. (MBUSA) is recalling certain model year 2015 C300 4matic and C400 4matic vehicles manufactured April 7, 2014, to July 25, 2014. In the affected vehicles, the fuel delivery module may be improperly secured to the fuel tank. Secondly, electrical wires that connect to the fuel delivery module might have been pinched between the flange of the fuel delivery module and the tank. If the locking plate is not properly secured to the fuel delivery module it may become loose, and leak fuel, increasing the risk of a fire. If the electrical wires are pinched, the fuel pump may stop working, resulting in a stall, thereby increasing the risk of a crash. MBUSA will notify owners, and dealers will inspect the vehicles for improperly secured locking plates and pinched wires, correcting the vehicles as necessary, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact MBUSA customer service at 1-800-367-6372. MBUSA's number

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2015**

Published April 20, 2015

for this recall is 2015030004.

15V-138

Mack Trucks, Inc (Mack) is recalling certain model year 2012-2015 CXU trucks manufactured February 4, 2011, to December 23, 2014, and equipped with an air release fifth wheel latch. The affected vehicles have a switch to release the fifth wheel latch that may inadvertently be pushed and cause the trailer to unintentionally disconnect from the tractor after the parking brake has been released. An inadvertent decoupling of the trailer from the tractor may increase the risk of a crash. Mack will notify owners, and dealers will install a secondary action that operators will need to activate before the fifth wheel will release, free of charge. The recall is expected to begin May 4, 2015. Owners may contact Mack customer service at 1-800-528-6586. Mack's number for this recall is SC0390.

15V-139

Kalmar Solutions, LLC (Kalmar) is recalling certain model year 2014-2015 Ottawa terminal tractors manufactured June 20, 2014, to November 14, 2014. Due to improper routing, the battery ground cable may detach from its mounting on the transmission, and as a result, excessive current may travel through the vehicle's engine harness, melting it. Melting of the engine harness may cause an electrical short and increase the risk of a fire. Kalmar will notify owners, and dealers will replace the battery cable and correct its routing to eliminate stress on its attachment point, free of charge. The recall began on March 26, 2015. Owners may contact Kalmar customer service at 1-785-229-6327.

15V-140

BMW of North America, LLC (BMW) is recalling certain model year 2005-2010 R1200GS and R1200RT, 2006-2010 R1200GS Adventure, 2007-2010 R1200R, 2007 R1200S and K1200R Sport, 2005-2007 R1200ST, 2008-2009 HP2 Megamoto, 2006 HP2 Enduro, 2008-2010 HP2 Sport, 2005-2008 K1200S, 2006-2008 K1200R, K1200GT, 2009-2011 K1300S, 2010-2011 K1300R, and 2009-2010 K1300GT motorcycles. In the affected motorcycles, the rear wheel mounting flange may crack if the rear wheel mounting bolts are over tightened. If the rear wheel mounting flange cracks, the mounting bolts may loosen and the rear wheel may not remain secured to the motorcycle, causing a loss of stability and increasing the risk of a crash. BMW will notify owners, and dealers will replace the existing aluminum rear wheel flange with a steel one, free of charge. The recall is expected to begin April 21, 2015. Owners may contact BMW customer service at 1-800-525-7417.

15V-141

Indian Motorcycle Company (Indian) is recalling certain model year 2015 Scout N15MSA00AA, N15MSA00AH, N15MSA00AR, N15MSA00AS, N15MSA00BA, N15MSA00BH, N15MSA00BS, N15MSA00CA, and N15MSA00CS motorcycles manufactured May 12, 2014, to April 9, 2015. Due to a problem with the rear brake master cylinder, the motorcycles may have a reduction in, or a complete loss of, rear brake power. A full or partial loss of rear braking power may lengthen the distance needed to slow or stop the motorcycle, increasing the risk of a crash. Indian will notify owners, and dealers will inspect and replace the rear brake master cylinder, as necessary, free of charge. The recall began on March 6, 2015. Owners may contact the Indian Motorcycle Consumer Service Department at 1-877-204-3697. Indian's number for this recall is I-

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2015**

Published April 20, 2015

15-01 A/B.

15V-142

Toyota Motor Engineering & manufacturing (Toyota) is recalling certain model year 2012-2014 Rav4 EV vehicles manufactured July 24, 2012, to August 29, 2014. Due to a software issue within a component of the Electric Vehicle Traction Motor Assembly, the electric propulsion motor may shift to "neutral" resulting in a possible loss of drive power. A loss of drive power may increase the risk of a crash. Toyota will notify owners beginning in April 2015. The remedy is still under development, but will be provided free of charge. Owners may contact Toyota customer service at 1-800-331-4331.

15V-143

Toyota Motor Engineering & Manufacturing (Toyota) is recalling certain model year 2015 Camry, Camry Hybrid, Highlander, and Highlander Hybrid, and 2014-2015 Rav4 vehicles. A component of the electric power steering (EPS) electronic control unit (ECU) may have been damaged during the manufacturing process. Over time, this damage may result in failure of the electric power steering system. An unexpected loss of power steering increases the risk of a crash. Toyota will notify owners, and dealers will inspect the serial number of the EPS ECU or steering column assembly. If the number is within the affected range, the EPS ECU will be replaced, free of charge. The recall is expected to begin in April 2015. Owners may contact Toyota customer service at 1-800-331-4331.

15V-144

General Motors LLC (GM) is recalling certain model year 2011-2013 Volt vehicles manufactured August 25, 2010, to June 26, 2013. If the driver exits the vehicle without turning off the electrical system, the battery may drain low enough that the gasoline engine will automatically start itself to recharge the electric battery. If the engine runs for an extended period of time in an enclosed space, there may be a build up of carbon monoxide, increasing the risk of personal injury. GM will notify owners, and dealers will update the engine management software to limit the time that the stationary vehicle can be left in the ON position, free of charge. The recall began April 15, 2015. Owners may contact Chevrolet customer service at 1-800-222-1020. GM's number for this recall is 14617.

15V-145

General Motors LLC (GM) is recalling certain model year 2015 Buick Encore vehicles manufactured November 27, 2014, to February 24, 2015, and 2015 Chevrolet Trax vehicles manufactured November 18, 2014, to February 17, 2015. The steering column assembly housing may contact the power steering printed circuit board causing the circuit board to wear. The circuit board wear may cause a sudden loss of electric power steering assist, increasing the risk of a crash. GM will notify owners, and dealers will inspect and replace the steering column assembly, as necessary, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Buick customer service at 1-800-521-7300 or Chevrolet customer service at 1-800-222-1020. GM's number for this recall is 15168.

15V-146

BMW of North America, LLC (BMW) is recalling certain model year 2015 BMW X5 xDrive 35d Sports

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2015**

Published April 20, 2015

Activity Vehicles (SAV) manufactured August 19, 2014, to February 16, 2015, and 2014-2015 BMW X5 xDrive 35i, X5 sDrive 35i, X5 xDrive 50i, Sports Activity Vehicles (SAV) manufactured August 28, 2013, to February 16, 2015. In the affected vehicles, the Head Protection System (HPS) air bag may not be securely connected to the air bag inflator gas generator. Without a secure connection to the inflator, the HPS air bags may have insufficient inflation during a vehicle crash, increasing the risk of injury. BMW will notify owners, and dealers will replace the Head Protection System, free of charge. The recall is expected to begin April 1, 2015. Owners may contact BMW customer service at 1-800-525-7417.

15V-147

BMW of North America, LLC (BMW) is recalling certain model year 2015 428i Convertible, 428i xDrive Convertible, 435i Convertible, and 435i xDrive Convertible vehicles manufactured October 22, 2014, to February 27, 2015. Due to a programming error, the driver's front air bag deployment timing may be incorrect. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) No. 208, "Occupant Crash Protection." If the driver's front air bag deployment timing is incorrect, there is an increased risk of personal injury in the event of a vehicle crash. BMW will notify owners, and dealers will reprogram the air bag control module with corrected software version, free of charge. The recall is expected to begin in April 2015. Owners may contact BMW customer service at 1-800-525-7417.

15V-148

Newmar Corporation (Newmar) is recalling certain model year 2014-2015 King Aire, Essex, London Aire, and Mountain Aire motor homes manufactured November 26, 2013, to November 11, 2014. The wiper blades may separate from the wiper arm connectors, especially when the wipers are used at the high speed setting. If the wiper blades separate from the wiper arms, the driver may have reduced visibility, increasing the risk of a crash. The remedy for this recall is still under development. The manufacturer has not yet provided a notification schedule. Owners may contact Newmar customer service at 1-800-731-8300.

15V-149

Altec Industries Inc. (Altec) is recalling certain model year 2014 Aerial Devices manufactured April 1, 2014, to July 18, 2014, and equipped with certain SUN Hydraulics Corporation counterbalance valves. In the affected vehicles, the counterbalance valve may crack, allowing hydraulic fluid to leak, and possibly result in boom movement. Unintended boom movement of the aerial device increases the operator's risk of injury. Altec will notify owners, and dealers will replace the counterbalance valves, free of charge. The recall is expected to begin on April 27, 2015. Owners may contact Altec customer service at 1-877-462-5832. Altec's number for this recall is CSN 614.

15V-150

Spartan Tool, LLC (Spartan) is recalling certain model year 2013-2014 Sewer Jetters, model numbers 738, 740, and 758, manufactured November 1, 2013, to December 31, 2014. The trailer mounted Sewer Jetters may have their trailer hitch welds fail, and the trailer may detach from the tow vehicle. If the trailer detaches from the tow vehicle, there is an increased risk of a crash. Spartan will notify owners, and dealers will replace the hitch tubes with formed hitch tubes, free of charge. The recall began March 30, 2015. Owners may contact Spartan customer service at 1-800-435-3866.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2015**

Published April 20, 2015

15V-151

Ducati North America (Ducati) is recalling certain model year 2010-2014 Multistrada 1200 motorcycles. The inner sleeve of the opening throttle cable may move and prevent the full closing of the throttle. If the throttle cannot be fully closed, there is an increased risk of a crash. Ducati will notify owners, and dealers will replace the upper throttle cover with one that prevents the inner throttle sleeve from moving, free of charge. The recall is expected to begin May 11, 2015. Owners may contact Ducati customer service at 1-800-231-6696. Ducati's number for this recall is RCL-15-001.

15V-152

American Honda Motor Company, Inc. (Honda) is recalling certain model year 2008 Pilot vehicles. Upon deployment of the driver side frontal air bag, excessive internal pressure may cause the inflator to rupture. In the event of a crash necessitating deployment of the driver side frontal air bag, the inflator could rupture with metal fragments striking and potentially seriously injuring the vehicle occupants. Honda will notify owners, and dealers will replace the driver side frontal air bag inflator in all affected vehicles, free of charge. The recall is expected to begin in late April. Owners may contact Honda customer service at 1-800-999-1009. Note: This recall is an expansion of recall 14V-351.

15V-153

Hyundai Translead (HT) is recalling certain model year 2014-2015 Original, Composite, Composite XT, HyCube and Dolly trailers manufactured January 1, 2014, to December 31, 2014 equipped with certain Haldex Life Seal Type 30/30 Long Stroke Air Brake Actuators. The affected vehicles may experience brake drag due to an improperly seated diaphragm in the brake chamber. Brake drag may result in a wheel end fire. Hyundai Translead will notify owners, and dealers will replace the actuators, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Hyundai Translead customer service at 1-800-251-0871.

15V-154

EIDorado National-California, Inc. (EIDorado) is recalling certain model year 2014 EIDorado National E-Z Rider II and EIDorado National California Axess buses manufactured January 2, 2014, to December 31, 2014. The affected buses have front axles whose tie rod nuts may be improperly torqued. If the tie rod nuts are not properly torqued, the tie rod may not be adequately secured, resulting in a loss of vehicle control and increasing the risk of a crash. EIDorado will notify owners, and dealers will inspect the tie rod nut torque and replace the parts, as necessary, free of charge. The recall began on April 2, 2015. Owners may contact Eldorado customer service at 1-909-591-9557.

15V-155

Forest River, Inc. (Forest River) is recalling certain model year 2014 Palomino SolAire trailers manufactured July 1, 2014, to August 31, 2014. The affected vehicles may have been manufactured without an exterior furnace vent causing exhaust fumes to be vented into the trailer. Additionally, the lack of a furnace vent may result in a heat buildup around the furnace. Exhaust fumes inside the trailer may result in carbon-monoxide poisoning, increasing the risk of occupant injury. A heat build up, increases the risk of a fire. Forest River will notify

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2015**

Published April 20, 2015

owners, and dealers will install an exterior furnace vent in any affected trailer that does not have one, free of charge. The recall is expected to begin in April 2015. Owners may contact Forest River customer service at 1-574-389-4600. Forest River's number for this recall is 400-03032015-0016.

15V-156

Charles Machine Works Inc (Charles Machine) is recalling certain model year 2013-2015 Ditch Witch T18 tandem axle trailers manufactured January 1, 2013, to February 15, 2015, and with or without vacuum excavators mounted on them. The wheel hubs of the affected trailers may have incorrect bearing pre-loads which can cause the trailer wheels to lock up. A trailer wheel lock up would increase the risk of a crash. Charles Machine will notify owners, and dealers will inspect the axles, and replace the bearings, as necessary, free of charge. The recall is expected to begin April 10, 2015. Owners may contact Charles Machine customer service at 1-800-654-6481. Charles Machine's number for this recall is ID #0377453.

15V-158

Charles Machine Works Inc. (Charles Machine) is recalling certain model year 2002-2015 Ditch Witch T26 trailers. The affected trailers may have been manufactured with axles that have incorrect wheel bearings. The incorrect wheel bearings may not be able to support the trailer's rated load and, as a result, the bearings may fail and the wheel may detach. Bearing failure or wheel detachment would increase the risk of a crash. Charles Machine will notify owners, and dealers will inspect the wheel bearings and replace them, as necessary, free of charge. The recall is expected to begin in April 2015. Owners may contact Charles Machine customer service at 1-800-654-6481. Charles Machine's number for this recall is ID #0376152.

15V-159

Forest River, Inc. (Forest River) is recalling certain model year 2013-2014 Sabre travel trailers and fifth wheels manufactured August 1, 2013, to June 30, 2014. The wires that control the brakes may have been improperly routed resulting in the wires chaffing, breaking or shorting. Damage to the wires that control the brakes may unexpectedly lengthen the distance needed to stop the vehicle, increasing the risk of a crash. Additionally, a short in the wires may increase the risk of a fire. Forest River will notify owners, and dealers will inspect the trailers and reroute the brake wires, as necessary, free of charge. The recall began on April 6, 2015. Owners may contact Forest River customer service at 1-574-389-4600. Forest River's number for this recall is 430-03112015-0017.

15V-160

Jerr-Dan Corporation (Jerr-Dan) is recalling certain model year 2010 Standard Duty MPL-NGS, MPL-NG and MPL40 Wreckers manufactured August 3, 2010, through September 30, 2010. In the affected vehicles, the underlift boom tilt cylinder may drift down while a vehicle is being towed. If the underlift boom tilt cylinder drifts down during towing, the vehicle that is being towed may contact the road surface, increasing the risk of the vehicle crash. Jerr-Dan will notify owners and dealers will replace the underlift tilt circuit counterbalance valve, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Jerr-Dan customer service at 1-800-926-9666. Note: This recall is an expansion of 14V-248.

15V-161

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2015**

Published April 20, 2015

General Motors LLC (GM) is recalling certain model year 2015 Buick Encore vehicles manufactured August 26, 2014, to February 9, 2015, and 2015 Chevrolet Trax vehicles manufactured October 13, 2014, to February 3, 2015. The affected vehicles have tire placards that do not provide the rim size information for the front or rear wheels. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 110, "Tire Selection and Rims and Motor Home/Recreation Vehicle Trailer Load Carrying Capacity Information for Motor Vehicles with a GVWR of 4,536 kilograms (10,000 pounds) or less." If the label is missing front and rear rim size information, the owner may replace the rims with ones that are an incorrect size, increasing the risk of crash. GM will notify owners, and will send owners a corrected label, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Buick customer service at 1-800-521-7300, and Chevrolet customer service at 1-800-222-1020. GM's number for this recall is 15166.

15V-162

Terex South Dakota, Inc. (Terex) is recalling certain model year 2014-2015 Aerial Devices and General Digger Derricks manufactured March 28, 2014, to March 1, 2015. In the affected vehicles, the fasteners that attach the turntable bearing to the carrier and the aerial or the digger derrick may fail. If the attaching bolts fail, the boom may fall, increasing the risk of injury to the operator or those nearby. Terex will notify owners, and dealers will check the affected bolts, replacing them as necessary, free of charge. The recall is expected to begin in April 2015. Owners may contact Terex customer service at 1-800-982-8975. Terex's number for this recall is SN616.

15V-163

General Motors LLC (GM) is recalling certain model year 2013-2015 Chevrolet Malibu vehicles October 24, 2011, to March 5, 2015. In the affected vehicles, the Slide or Tilt switch for the roof panel may not be adequately recessed to prevent the switch from inadvertently being pressed. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) No. 118, "Power-Operated Window, Partition, and Roof Panel Systems." The Slide or Tilt roof panel switch may inadvertently be pressed and the roof panel may auto-close unexpectedly, increasing the risk of a pinch injury. GM will notify owners, and dealers will update the Body Control Module (BCM) software to remove auto-close feature for certain switch positions, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Chevrolet customer service at 1-800-222-1020. GM's number for this recall is 15176.

15V-164

Navistar, Inc. (Navistar) is recalling certain model year 2015-2016 International 9900, DuraStar, LoneStar, PayStar, ProStar, WorkStar and 2015 International TranStar and IC Bus CE vehicles equipped with a Haldex air braking system. The affected brake actuators may have been manufactured with an incomplete attachment of the internal rubber diaphragm to the actuation mechanism. This could cause dragging or overheated brakes. If the brakes drag and overheat there is an increased risk of a wheel end fire. Navistar will notify owners, and dealers will replace the Haldex Life Seal Brake chambers, free of charge. The recall is expected to begin May 18, 2015. Owners may contact Navistar customer service at 1-800-448-7825. Navistar's number for this recall is 15504. Note: This recall supersedes recall 14V-806.

15V-165

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2015**

Published April 20, 2015

Navistar, Inc. (Navistar) is recalling certain model year 2015-2016 IC CE school buses manufactured August 8, 2014, to February 20, 2015, and 2015-2016 IC RE school buses manufactured July 31, 2014, to January 9, 2015, equipped with Haldex air brake actuators. The affected brake actuators may have been manufactured with an incomplete attachment of the internal rubber diaphragm to the actuation mechanism. This could cause dragging or overheated brakes. If the brakes drag and overheat there is an increased risk of a wheel end fire. Navistar will notify owners, and dealers will replace the Haldex Life Seal Brake chambers, free of charge. The recall is expected to begin May 18, 2015. Owners may contact Navistar customer service at 1-800-448-7825. Navistar's number for this recall is 15505. Note: This recall supersedes recall 14V-808.

15V-166

Navistar, Inc. (Navistar) is recalling certain model year 2015-2016 IC RE school buses manufactured November 4, 2014, to December 23, 2014. In the affected vehicles, the air brake hose for the front wheel service brakes may contact the tires when the steering is fully turned. Contact with the tire may result in hose abrasion, resulting in an air leak, causing the vehicle to pull to one side when braking and/or requiring extra distance to stop the school bus. Either condition may increase the risk of a crash. Navistar will notify owners, and dealers will correct the front air brake hose fitting orientation, replacing any hose with signs of abrasion, as necessary, free of charge. The recall began on April 13, 2015. Owners may contact Navistar customer service at 1-800-448-7825. Navistar's number for this recall is 15507.

15V-167

Navistar, Inc. (Navistar) is recalling certain model year 2015 IC RE non-school Transit Buses manufactured November 4, 2014, to November 18, 2014. In the affected vehicles, the air brake hose for the front wheel service brakes may contact the tires when the steering is fully turned. Contact with the tire may result in hose abrasion, resulting in an air leak, causing the vehicle to pull to one side when braking and/or requiring extra distance to stop the bus. Either condition may increase the risk of a crash. Navistar will notify owners, and dealers will correct the front air brake hose fitting orientation, replacing any hose with signs of abrasion, as necessary, free of charge. The recall began on April 13, 2015. Owners may contact Navistar customer service at 1-800-448-7825. Navistar's number for this recall is 15508.

15V-168

Navistar, Inc. (Navistar) is recalling certain model year 1999-2002 International 4800 4x4 trucks manufactured June 30, 1999, through May 28, 2002, and equipped with Fabco TC-200 transfer cases. The field remedy that these vehicles received as part of Navistar recall 05501 (NHTSA recall number 03V-415), a double Cardan front driveshaft, may seize under certain conditions. If the double Cardan joint of the driveshaft seizes, the front driveshaft may separate and under certain conditions, potentially cause a front axle lockup, increasing the risk of a crash. Navistar will notify owners, and dealers will install front driveshaft guards at both ends of the shaft and lockout front wheel hubs. Any drive shaft that is found with loose or binding double Cardan joints at either end will be replaced, free of charge. The recall is expected to begin May 18, 2015. Owners may contact Navistar customer service at 1-800-448-7825. Navistar's number for this recall is 15506. Note: This recall supersedes recall 14V-520 which provided an interim-only remedy of disconnecting the front driveshaft.

15V-169

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2015**

Published April 20, 2015

Spartan Motors, Inc. (Spartan) is recalling certain model year 2011-2016 School Bus chassis manufactured April 21, 2011, to February 26, 2015. The fuel/water separator heater terminals and connectors may melt and allow air into the fuel system resulting in an engine stall. Additionally, heat from the terminals may ignite the connector, harness, and other materials. An engine stall increases the risk of a crash. Overheated terminals may result in a vehicle fire. The remedy for this recall is still under development, but owners have been advised to disconnect the harness from the heated fuel/water separator as an interim remedy. This recall began March 20, 2015. Owners may contact Spartan customer service at 1-517-543-6400. Spartan's number for this recall is 15006.

15V-170

Ford Motor Company (Ford) is recalling certain model year 2011-2013 Explorer vehicles. In the affected vehicles, the interior door handle return spring may unseat, resulting in interior door handle that does not return to the fully stowed position after actuation. If the interior door handle return spring is unseated, the door may unlatch in the event of a side impact crash, increasing the risk of personal injury. Ford will notify owners, and dealers will inspect all four of the interior door handles and either repair or replace them, free of charge. The recall is expected to begin on May 11, 2015. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 15S11.

15V-171

Ford Motor Company (Ford) is recalling certain model year 2013-2015 Lincoln MKT vehicles with a limousine and hearse prep package, manufactured March 6, 2012, to March 10, 2015. In the affected vehicles, the vacuum pump relay may overheat due to an internal fault or contamination. If the vacuum pump relay overheats, there is an increased risk of a vehicle fire. Ford will notify owners, and dealers will replace the vacuum pump relay with a new electro-mechanical relay, free of charge. The recall is expected to begin May 11, 2015. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 15S10.

15V-172

KZRV, L.P. (KZRV) is recalling certain model year 2015 KZ-RV Gold, Goldrush, Goldrush Klondike, and Prestige, 2014-2015 Goldrush Discovery, 2013-2015 Goldrush Nugget and 2012-2015 Stoneridge recreational vehicles manufactured May 27, 2011, to December 8, 2014. In the affected vehicles, a rivet for the quad entry steps may shear and fail, causing the steps to give when being used. If the rivet shears causing the quad step to fail, the step user may fall, increasing the risk of personal injury. KZRV will notify owners, and dealers will replace the defective rivets, free of charge. The recall is expected to begin in April 2015. Owners may contact KZRV customer service at 1-800-768-4016.

15V-173

Pierce Manufacturing (Pierce) is recalling certain model year 2015 Saber, Enforcer, Impel, and Velocity vehicles manufactured December 4, 2014, to March 23, 2015. The rear axle cast iron leaf spring spacer block may crack and fracture. If the leaf spring spacer block fractures, the pieces may become a road hazard. If the entire spacer block separates from the vehicle, the alignment of the rear axle may suddenly shift. Either condition could increase the risk of a crash. Pierce will notify owners, and dealers will replace the cast iron spring spacer block with a machined steel spring spacer block, free of charge. The recall began on March 23, 2015. Owners may

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2015**

Published April 20, 2015

contact Pierce customer service at 1-888-974-3723.

15V-174

Ford Motor Company (Ford) is recalling certain model year 2011-2015 Ford F-350, F-450, and F-550 trucks manufactured February 22, 2010, to January 30, 2015, and equipped with ambulance or fire engine preparation packages. The affected vehicles may detect an incorrect Exhaust Gas Temperature Sensor (EGT) fault indicating that the vehicle is too hot, causing the engine management system to shut down the engine and prevent its immediate restart. Engine shut down and a subsequent cool down period may delay medical treatment or assistance to those needing it, increasing their risk of injury. Ford will notify owners, and dealers will update the Powertrain Control Module (PCM) software, free of charge. The recall is expected to begin on May 11, 2015. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 15S09.

15V-175

Yamaha Motor Corporation, USA (Yamaha) is recalling certain model year 2015 FJ-09 (FJ09F/FC), FZ-09 (FZ09F/FC), FZ6R (FZ6RF/FC), Super Tenere (XTZ12F/FC), Super Tenere ES (XTZ12EF/EFC), and R6 (YZF-R6) motorcycles manufactured September 1, 2014, to November 17, 2014. The affected motorcycles may have an incorrectly manufactured shift cam segment stopper, having a sharp edge on the inside of the bend instead of a smooth radius. As a result, the stopper can crack and possibly fracture at this sharp edge. If the stopper fractures, the transmission may not shift properly, increasing the risk of a crash. Yamaha will notify owners, and dealers will replace the shift shaft assembly with a new one, free of charge. The recall is expected to begin in April 2015. Owners may contact Yamaha customer service at 1-800-962-7926.

15V-176

Kalmar Solutions, LLC (Kalmar) is recalling certain model year 2014-2015 Kalmar Ottawa T2 terminal tractors manufactured September 15, 2014, to February 10, 2015. The affected vehicles have the wiring for the rear axle antilock brake system (ABS) components wired incorrectly. Specifically, the left side components are connected to the right side of the ABS control module and vice versa. If the communication between the ABS components and the module is reversed, it can cause vehicle instability during braking, increasing the risk of a vehicle crash. Kalmar will notify owners, and dealers will correct the ABS wiring, free of charge. The recall is expected to begin April 27, 2015. Owners may contact Kalmar customer service at 1-785-229-6327.

15V-177

Chrysler (FCA US LLC) is recalling certain model year 2013-2014 Dodge Viper vehicles manufactured October 1, 2012, to February 6, 2014. Moisture may get into the door switch, resulting in the driver or passenger door opening unexpectedly while the vehicle is in motion. If the driver or passenger door opens unexpectedly while the vehicle is in motion, there is an increased risk of a crash and injury. Chrysler will notify owners, and dealers will replace the door handle assemblies and top covers, free of charge. The recall is expected to begin May 18, 2015. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is R14.

15V-178

Chrysler (FCA US LLC) is recalling certain model year 2013-2015 Fiat 500 EV vehicles manufactured March

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2015**

Published April 20, 2015

27, 2012, to November 1, 2014. If the vehicle goes in to limp home mode, incompatible software between Electric Vehicle Control Unit (EVCU) and Battery Pack Control Module (BPCM) may cause the electric propulsion system to fully shut down. An electric propulsion system shut down will cause a stall-like condition, increasing the risk of a crash. Chrysler will notify owners, and dealers will update the vehicle software to ensure compatibility between components, free of charge. The recall is expected to begin May 15, 2015. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is R15.

15V-179

Blue Bird Body Company (Blue Bird) is recalling certain model year 2015-2016 Vision non-school transit buses manufactured June 19, 2014, to December 11, 2014. In the affected vehicles, the voltage inverter for the illumination of the driver's heater control panel may fail. An inverter failure may produce smoke and increase the risk of a fire. Blue Bird will notify owners, and dealers will replace the inverter with an inverter from an alternate vendor, free of charge. The recall is expected to begin April 24, 2015. Owners may contact Blue Bird customer service at 1-478-822-2242. Blue Bird's number for this recall is R15YA-NSB.

15V-180

Blue Bird Body Company (Blue Bird) is recalling certain model year 2015-2016 Vision school buses manufactured June 19, 2014, to December 11, 2014. In the affected vehicles, the voltage inverter for the illumination of the driver's heater control panel may fail. An inverter failure may produce smoke and increase the risk of a fire. Blue Bird will notify owners, and dealers will replace the inverter with an inverter from an alternate vendor, free of charge. The recall is expected to begin April 24, 2015. Owners may contact Blue Bird customer service at 1-478-822-2242. Blue Bird's number for this recall is R15YA-SB.

15V-181

Daimler Trucks North America LLC (DTNA) is recalling certain model year 2014-2015 Western Star 4700, 4900, 5700, and 6900 trucks manufactured from July 23, 2013, through December 4, 2014, and equipped with certain Kidde disposable handheld fire extinguishers. These fire extinguishers may not fully discharge as designed when the lever is repeatedly pressed and released. In the event of a fire, if the fire extinguisher does not work correctly, there is an increased risk of injury to the truck occupants. DTNA will notify owners, and Kidde will provide a replacement extinguisher when contacted directly or affected owners may go to an authorized DTNA repair facility to order a replacement fire extinguisher, free of charge. The recall is expected to begin May 26, 2015. Affected owners may contact Kidde directly toll free at (855) 283-7991 from 8 a.m. to 5 p.m. ET Monday through Friday or owners may contact DTNA customer service at 1-800-745-8000. DTNA's number for this recall is FL680.

15V-182

Motor Coach Industries (MCI) is recalling certain model year 2007-2010 MCI E4500 and J4500 motor coaches manufactured November 21, 2006, to August 27, 2009, and equipped with certain Recaro Automotive Seating Ergo M bus driver seats. The affected seats were manufactured in a way that the tether bar may push into the retractor panel door and potentially interfere with the seat belt locking mechanism. If the seat belt locking mechanism does not function as intended, the bus driver may not be properly restrained, increasing the risk of personal injury in the event of a crash. The remedy for this recall is still under development. The manufacturer has

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2015**

Published April 20, 2015

not yet provided a notification schedule. Owners may contact MCI customer service at 1-800-241-2947.

15V-183

Motor Coach Industries (MCI) is recalling certain model year 2014 J4500 and model year 2015 D4000ISTV, D4005, D4500, and D4505 motor coaches manufactured August 26, 2014, to December 3, 2014. The affected motor coaches have front and steerable tag axles whose tie rod nuts may be improperly torqued. If the tie rod nuts are not properly torqued, the tie rod may not be adequately secured, resulting in a loss of vehicle control and increasing the risk of a crash. MCI will notify owners, and dealers will inspect the tie rod nut torque, replacing the parts as necessary, free of charge. The recall began on April 15, 2015. Owners may contact MCI customer service at 1-800-241-2947.

15V-184

Daimler Trucks North America LLC (DTNA) is recalling certain model year 2015 Freightliner Cascadia, Business Class M2, 108SD, 114SD, 122SD, Coronado, Western Star 4700, and Western Star 4900 trucks manufactured October 6, 2014, to February 16, 2015, and equipped with Haldex Life Seal brake chambers. The affected vehicles may experience brake drag due to an improperly seated diaphragm in the brake chamber. While traveling at highway speeds, brake drag may cause loss of vehicle control, increasing the risk of a crash. DTNA will notify owners, and dealers will replace the brake chambers, free of charge. The recall is expected to begin May 25, 2015. Owners may contact DTNA customer service at 1-800-745-8000. DTNA's number for this recall is FL676.

15V-185

DS Corp, doing business as Crossroads RV (Crossroads), is recalling certain model year 2016 Crossroads Sunset Trail, Cruiser Aire, Cruiser, Cameo, and ReZerve recreational trailers manufactured March 4, 2015, to March 20, 2015. In the affected vehicles, the screws that attach the expanding room to the sliding mechanism cable may fail allowing the room to extend unintentionally while the vehicle is in motion. If the room extends while vehicle is in motion, there is an increased risk of a crash. Crossroads will notify owners, and dealers will replace the slide room mechanism attaching screws, free of charge. The recall began on April 6, 2015. Owners may contact Crossroads customer service at 1-855-226-7496. Crossroads number for this recall is 36.

15V-186

Forest River, Inc. (Forest River) is recalling certain model year 2015 Coachmen Prism recreational vehicles manufactured from July 1, 2014, through October 14, 2014 and built on Mercedes-Benz Sprinter chassis. In the affected vehicles, the abutting wedge, a component attached to the door jamb to make opening the door easier after a severe frontal impact, may have been installed incorrectly. If a vehicle that has an incorrectly installed abutting wedge is involved in a severe frontal crash, greater force may be necessary to open the doors, increasing the risk of injury. Sprinter will notify owners, and Sprinter dealers will check the installation of the abutting wedge, correcting it as necessary, free of charge. The recall began in March 2015. Owners may contact Forest River customer service at 1-574-642-0437. Forest River's number for this recall is 15V-082.

15V-187

BMW of North America LLC (BMW) is recalling certain model year 2014 228i Coupe, M235i Coupe, 320i,

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2015**

Published April 20, 2015

320xi, 328i, 328xi, 335i, 335xi, ActiveHybrid 3, 328xi Sports Wagon, 428i Coupe, 428xi Coupe, 435i Coupe, 435xi Coupe, 428i Convertible, 428xi Convertible, 435i Convertible, 328xi Gran Turismo, 335xi Gran Turismo, and 2015 428i Gran Coupe, 428xi Gran Coupe, and 435i Gran Coupe vehicles. Improper nickel plating of components within the fuel pump may result in the fuel pump failing. If the fuel pump fails, the vehicle may stall without warning, increasing the risk of a crash. BMW will notify owners, and dealers will replace the fuel pump, free of charge. The recall is expected to begin April 30, 2015. Owners may contact BMW customer service at 1-800-525-7417.

15V-189

Airstream, Inc. (Airstream) is recalling certain model year 2015 Interstate motorhomes manufactured from October 6, 2014, through March 25, 2015, and built on a Mercedes-Benz Sprinter chassis. In the affected vehicles, the abutting wedge, a component attached to the door jamb to make opening the door easier after a severe frontal crash, may have been installed incorrectly. If a vehicle that has an incorrectly installed abutting wedge is involved in a severe frontal crash, a greater force may be necessary to open the doors, increasing the risk of injury. Mercedes Benz will notify owners on behalf of Airstream, and dealers will inspect and, if necessary, correct the abutting wedge installation, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Airstream customer service at 1-937-596-6111 or owners may contact Mercedes-Benz Sprinter Customer Service at 1-877-762-8267.

15V-190

Thor Motor Coach (Thor) is recalling certain model year 2015 Siesta and Citation motorhomes manufactured from September 26, 2014, through February 27, 2015, and built on a Mercedes-Benz Sprinter chassis. In the affected vehicles, the abutting wedge, a component attached to the door jamb to make opening the door easier after a severe frontal crash, may have been installed incorrectly. If a vehicle that has an incorrectly installed abutting wedge is involved in a severe frontal crash, a greater force may be necessary to open the doors, increasing the risk of injury. Mercedes-Benz will notify owners on behalf of Thor, and dealers will inspect and, if necessary, correct the installation of the abutting wedge, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Thor customer service at 1-877-500-1020 or owners may contact Sprinter Customer Service at 1-877-762-8267.

15V-191

Mercedes-Benz USA, LLC (MBUSA) is recalling certain model year 2014-2015 Smart Fortwo Coupes and Convertibles, and 2014 Fortwo Coupe Electric and Fortwo Convertible Electric vehicles. The affected vehicles have steering gear mounting bolts which may break during vehicle operation. If the steering gear mounting bolts break, vehicle handling could be affected, increasing the risk of a crash. MBUSA will notify owners, and dealers will replace the steering gear mounting bolts, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Smart customer service at 1-800-762-7887.

15V-192