

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JULY 2015**

Published September 2, 2015

CHILD SEATS:

None during July 2015.

EQUIPMENT:

Osram Sylvania Products, Inc. (Osram) is recalling certain Sealed Beam Headlamps manufactured from February 3, 2014, through June 19, 2015, with Part Number H5006, that fail to comply with the requirements of Federal Motor Vehicle Safety Standard No. 108, "Lamps, Reflective Devices, and Associated Equipment." The affected headlamps may not meet the minimum intensity requirements. These headlamps may not provide sufficient illumination of distant objects or the roadway. Insufficient illumination could result in a vehicle crash. Owners will be instructed to return affected lamps to the place of purchase for a refund or replacement. The recall is expected to begin in September 2015. Owners may contact OSRAM Sylvania Customer Service at 1C2Creplacement@sylvania.com or 1-800-648-3411.

15E-055

Osram Sylvania Products, Inc. (Osram) is recalling certain Sealed Beam Headlamps manufactured from February 3, 2014, through June 19, 2015, with Part Numbers H5001, that fail to comply with the requirements of Federal Motor Vehicle Safety Standard No. 108, "Lamps, Reflective Devices, and Associated Equipment." The affected headlamps may not meet the minimum intensity requirements. These headlamps may not provide sufficient illumination of distant objects or the roadway. Insufficient illumination could result in a vehicle crash. Owners will be instructed to return affected lamps to the place of purchase for a refund or replacement. The recall is expected to begin in September 2015. Owners may contact OSRAM Sylvania Customer Service at 1C2Creplacement@sylvania.com or 1-800-648-3411.

15E-056

Norco Industries Inc. (Norco) is recalling certain Accu Slide room mechanisms manufactured March 3, 2015, to March 16, 2015. The screws that attach the expanding room to the sliding mechanism cable may fail allowing the room to extend unintentionally while the vehicle is in motion. If the room extends while vehicle is in motion, there is an increased risk of a crash. Norco will notify owners, and dealers will replace the screws that secure the drive chain, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Norco customer service at 1-574-262-3400.

15E-057

Agility Fuel Systems (Agility) is recalling certain compressed natural gas (CNG) fuel systems, part numbers 23914000, 25640000, 25653000, 23913000, 23910000, 23903000, 25799500, 25600000, 23710031, 23708001, 24989800, 22989600, 22989700, 22999800, 24990722, 24990601, 25789600, 25789800, 22999500, 22999700, 25799800, 25799700, 25729800, 22929500, 22922500, 25769500, 25769700, 25799500, 22969500, 22969600, 22969700, 22969800, 22999600, 24269800, 24960800, 25789700, and 25799600, manufactured August 1, 2014, to June 1, 2015. The affected systems are equipped with pressure relief devices (PRDs) that may not function as designed and vent a buildup of pressure, such as could occur if the compressed natural gas (CNG) tank was exposed to fire. If the PRD does not activate in the event of a buildup of pressure, the CNG tank may explode, increasing the risk of fire and injury. Agility will notify owners, and

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JULY 2015**

Published September 2, 2015

dealers will replace the defective PRD's, free of charge. The recall began on August 20, 2015. Owners may contact Agility customer service at 1-949-267-7745.

15E-058

Emcara Gas Development Inc. (Emcara) is recalling certain Pressure Relief Devices (PRD), model numbers LT102B and LT130, manufactured from July 23, 2014, to December 31, 2014. The affected PRDs may not function as designed and vent a buildup of pressure, such as could occur if the compressed natural gas (CNG) tank was exposed to fire. If the PRD does not activate in the event of a buildup of pressure, the CNG tank may explode, increasing the risk of fire and injury. Emcara will notify the purchasers of the affected PRDs, and the defective PRDs will be replaced, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Emcara customer service at 1-519-821-5259.

15E-059

Flex-A-Lite is recalling certain aftermarket electric fan kits, part numbers 274 (Dual Electric Fan Kit) and 59274 (Aluminum Radiator and Dual Electric Fan Combination Kit), manufactured February 3, 2014 to May 27, 2015. The affected electric fan kits were not supplied with a fuse holder to be installed between the fan control module and the battery. Additionally, in the event of an electrical short, the circuit breakers that were supplied with the kits may not be sensitive enough to trip before electrical damage could occur. Use of an electric fan kit without the additional fuse holder between the battery and fan control module or with the original circuit breaker installed may result in electrical system damage in the event of an electrical short, increasing the risk of a vehicle fire. Flex-A-Lite will notify owners, and will provide purchasers with a replacement kit that includes a 60 amp fuse harness to be installed between the battery and fan control module as well as a 30 amp circuit breaker to replace the existing one between the fan motors and fan control module, free of charge. The recall began on June 24, 2015. Owners may contact Flex-A-Lite customer service at 1-800-851-1510.

15E-060

SAF-Holland is recalling certain CBX series Trailer Suspension Systems. The affected trailer suspensions have pivot bolts that may fail. The bolts were used in CBX20, CBX23, CBX25, CBX40, and CBX69 Trailer suspensions as well as part of various repair kits. Failure of the pivot bolts may cause the suspension and attached axle to separate from the trailer that it was connected to, increasing the risk of a crash. This recall expands the population of suspensions previously recalled under campaign 14E-024. SAF-Holland will notify the additional trailer owners, and dealers will replace the defective pivot bolts with new pivot bolts, free of charge. This notification began on August 10, 2015. Owners may contact SAF-Holland customer service at 1-888-396-6501. SAF-Holland's recall number for this campaign is P022. Note: This recall supersedes 14E-024.

15E-061

H&H Sports Protection (H&H) is recalling certain VCAN V528 Milano helmets, sizes XS, S, M, L and XL, manufactured April 1, 2008, to October 9, 2014. The helmet retention systems failed during high temperature testing. Also, the required labeling may not be found on the helmets. As such, these helmets do not meet the requirements of Federal Vehicle Safety Standard (FMVSS) number 218, "Motorcycle helmets." Failed helmet restraints can increase the risk of serious personal injury to the occupant. These helmets in size XL were

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JULY 2015**

Published September 2, 2015

originally recalled under campaign 14E-082. On July 15, 2015, H&H expanded the recall to include an additional 5,184 helmets in other sizes. H&H has notified the additional owners, retailers and dealers, and H&H will reimburse the full purchase price for the helmets. The recall began July 15, 2015. Owners may contact H&H customer service at 1-858-680-8226 or at OP@HHsportsprotection.com. Note: This recall supersedes recall 14E-082.

15E-062

TIRES:

Hercules Tire & Rubber Company (Hercules) is recalling certain All Trac A/T tires, sizes 235/70R16 106T, 235/75R15 109T XL, 245/70R16 107T, 255/70R16 111T, 265/70R16 112T, 265/75R16 116T and 275/70R16 114T. The affected tires may experience a tread separation. A tire tread separation may result in sudden air loss, increasing the risk of a vehicle crash. Hercules will notify owners, and dealers will replace the tires, free of charge. The recall began on August 13, 2015. Owners may contact Hercules customer service at 1-888-943-2402. Hercules number for this recall is 01-2015.

15T-011

Continental Tire the Americas, LLC (CTA) is recalling certain ContiProContact tires, size P205/65R15 95T Extra Load, manufactured February 8, 2015, to February 14, 2015, sold as aftermarket replacement tires. The affected tires may experience a tread separation. A tire tread separation may result in sudden air loss, increasing the risk of a vehicle crash. CTA will notify owners, and dealers will replace the affected tires and provide reimbursement to owners who replaced tires prior to the recall campaign. The recall began on July 31, 2015. CTA's number for this recall is 1-888-799-2168.

15T-012

Continental Tire the Americas, LLC (CTA) is recalling certain ContiProContact tires, size 225/45R17 91H, manufactured February 22, 2015, to May 16, 2015. Due to a manufacturing error, these aftermarket replacement tires may leak air from the bead area. A loss of air pressure may result in sudden tire failure and increase the risk of a crash. CTA will notify owners, and dealers will replace the affected tires, free of charge. The recall began on July 31, 2015. Owners may contact CTA customer service at 1-888-799-2168.

15T-014

Discount Tire is recalling certain Pathfinder SAT LT245/75R17E1 121R W tires manufactured September 16, 2013, to May 19, 2015, Pathfinder SAT LT265/75R16E1 123Q W tires manufactured August 5, 2013, to May 19, 2015, Pathfinder SAT LT265/70R17E1 121S B tires manufactured September 2, 2013, to May 19, 2015, and Pathfinder SAT LT275/65R18E1 123S B tires manufactured October 7, 2013, to May 19, 2015. These replacement light truck tires may have been manufactured with an inner liner gauge that is lower than specified. As a result, the tire tread may separate and cause rapid air pressure loss. If a tire experiences tread separation or air pressure loss, it can increase the risk of a vehicle crash. Discount Tire will notify owners, and dealers will provide replacement tires or refund the purchase price, free of charge. Owners may contact Discount Tire customer service at 1-888-519-6914.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JULY 2015**

Published September 2, 2015

15T-015

VEHICLES:

American Honda Motor Co. (Honda) is recalling certain model year 2014-2015 Acura MDX and MDX AWD vehicles manufactured April 23, 2013, to December 16, 2014. The affected vehicles have air conditioning compressor clutch drive bolts that may not have received the proper anti-corrosion coating. If a bolt was not coated, it may corrode and break as a result. If the bolt breaks, the compressor clutch plate may separate from the vehicle, possibly becoming a road hazard. Honda will notify owners, and dealers will replace the air conditioning compressor clutch drive bolt and install a new clutch plate if necessary, free of charge. The recall began on August 7, 2015. Owners may contact Acura client relations at 1-800-382-2238. Honda's number for this recall is JQ7.

15V-417

Nissan North America, Inc. (Nissan) is recalling certain model year 2014 Versa Sedan vehicles manufactured July 16, 2013, to January 29, 2014, 2013-2014 Cube vehicles manufactured July 3, 2013, to October 21, 2013, and 2013-2014 Juke vehicles manufactured July 3, 2013, to October 22, 2013. When exposed to hot temperatures, the affected vehicles have an engine start/stop button that may stick inside the button housing. If the engine start/stop button gets stuck in the housing, road vibrations may cause the engine to shut off unexpectedly while the vehicle is being driven, increasing the risk of a crash. Nissan will notify owners, and dealers will modify the start/stop switch housing, free of charge. The recall is expected to begin by late-August 2015. Owners may contact Nissan customer service at 1-800-647-7261.

15V-418

Subaru of America, Inc. (Subaru) is recalling certain 2012 model year Subaru Impreza 4-Door and Station Wagon vehicles (except WRX/STI models) manufactured April 21, 2011, to February 16, 2012. In the affected vehicles, the Occupant Detection System (ODS) may deactivate if a front seat passenger operates a device that is plugged into the power outlet such as a music player or cell phone, or touches a metal part of the vehicle such as the forward/rearward seat adjuster lever. If the ODS deactivates, the front passenger air bag will be turned off and the front passenger air bag will not deploy in the event of a crash, increasing the risk of injury to the seat occupant. Subaru will notify owners, and dealers will replace the Occupant Control Unit with a modified one, free of charge. The recall began on August 21, 2015. Owners may contact Subaru customer service at 1-800-782-2783. Subaru's number for this recall is WQT-55.

15V-419

Gillig LLC (Gillig) is recalling certain model year 2010-2015 Low Floor transit buses manufactured April 13, 2010, to June 12, 2015. Due to the routing of the grid heater electrical power cable, the cable may chafe against a fuel injector hard line. If the electrical power cable rubs against the injector fuel line, the cable may short circuit or the fuel line may leak fuel. Either possibility increases the risk of a fire. Gillig will notify owners, and dealers will inspect the grid heater power cable/hard injector fuel line for wear, and will properly route and support the grid heater power cable, free of charge. The recall began on July 17, 2015. Owners may contact Gillig customer service at 1-800-735-1500.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JULY 2015**

Published September 2, 2015

15V-420

General Motors LLC (GM) is recalling certain model year 2006-2010 Hummer H3 vehicles manufactured February 5, 2005, to May 24, 2010, and 2009-2010 Hummer H3T vehicles manufactured May 21, 2008, to May 24, 2010. In the affected vehicles, the connector module that controls the blower motor speed for the heating, ventilation and air conditioning system may overheat. If the blower motor connector module overheats, it can increase the risk of a fire. GM will notify owners, and dealers will replace part of the blower motor connector and harness, free of charge. Owners were sent interim notices on August 5, 2015. Owners will receive a second notice when the remedy becomes available. Owners may contact Hummer customer service at 1-800-732-5493. GM's number for this recall is 15042.

15V-421

Van Hool N.V. (Van Hool) is recalling certain model year 2014-2015 TD925 vehicles manufactured October 11, 2013, to December 12, 2014, and 2015 TDX925 vehicles manufactured on December 23, 2014. The affected vehicles are equipped with Cummins engines that may have their idle speed set too low. A prolonged engine idle at the low speed, combined with high electrical demand, may cause the alternator to overheat, increasing the risk of a fire. Van Hool will notify owners through its agent ABC Bus Inc., and Cummins service technicians will correct the engine idle speed setting. Additionally, the buses need to have their alternators replaced during the next scheduled maintenance. These repairs will be performed, free of charge. The recall is expected to begin in July 2015. Van Hool's number for this recall is P764.

15V-422

Terex Advance (Terex) is recalling certain model year 2015 Front Discharge Concrete Mixer Trucks manufactured April 1, 2015, to June 23, 2015. In the affected trucks, the bolts that secure the concrete mixing drum to the drum drive plate may not have been properly tightened. If the bolts are not properly tightened, the drum may separate from the vehicle, increasing the risk of injury or a crash. Terex will notify owners, and dealers will install new bolts using a thread locker, after removing the paint from under the fasteners. These repairs will be done free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Terex customer service at 1-800-433-6691.

15V-423

Honda (American Honda Motor Co.) is recalling certain model year 2016 Honda Pilot vehicles manufactured May 4, 2015, to June 5, 2015. Due to an assembly issue, the third row seatbelt may be trapped between the rear seat and the rear sideliner. If the third row seatbelt is trapped, the occupants may not be restrained properly, increasing the risk of injury. Honda will notify owners, and dealers will inspect and repair the rear third row seat belt, free of charge. The recall began on August 6, 2015. Owners may contact Honda customer service at 1-310-783-2000. Honda's number for this recall is JS7.

15V-424

Daimler Trucks North America LLC (DTNA) is recalling certain model year 2002-2004 Thomas Built Buses Saf-T-Liner ER, 2001-2005 Saf-T-Liner Conventional, 2002-2013 Saf-T-Liner MVP-EF, 2013 Saf-T-Liner EFX, 2001-2008 Saf-T-Liner FS65, 2005-2013 Saf-T-Liner C2, 2003-2013 Saf-T-Liner HDX, 2002-2003

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JULY 2015**

Published September 2, 2015

Saf-T-Liner MVP-ER, 2002 Vista, and 2002-2003 TL-960 non-school buses. In the affected vehicles, the stem that connects the outside emergency door handle to the emergency door opening mechanism may corrode. If the stem corrodes, the door handle could detach from the emergency door opening mechanism, delaying the opening of the door and the evacuation of the bus. In the event of an emergency, this may increase the risk of injury to the bus occupants. DTNA will notify owners, and dealers will either replace the stems or protect them against corrosion, free of charge. An interim notice was mailed to owners on August 28, 2015. A second notice will be mailed to owners when parts become available. Owners may contact DTNA customer service at 1-800-745-8000. DTNA's number for this recall is FL-685.

15V-425

Mercedes-Benz USA, LLC (MBUSA) is recalling certain model year 2014 CLA 250C vehicles manufactured September 10, 2014, to September 11, 2014, 2014 CLA 250C 4Matic vehicles manufactured September 13, 2014, to September 25, 2014, and 2014 CLA 45 AMG 4Matic vehicles manufactured September 10, 2014, to September 25, 2014. The affected vehicles have fuses that may have been incorrectly installed in the passenger side interior fuse boxes. If the fuses were not properly installed, they may lose electrical contact. In the event of a loss of electrical contact, certain systems may be impacted, including the function of the front passenger seat occupancy recognition system, the passenger side air bag indicator lamp, the instrument cluster and the windshield wipers. Should the function of the front passenger seat occupancy recognition system or the passenger side airbag indicator lamp be affected, the risk of injury for passengers in the event of a crash would be increased. Should the function of the instrument cluster and the windshield wipers be affected, the risk of a crash would be increased. MBUSA will notify owners, and dealers will inspect the position and orientation of the fuses, and if necessary, replace the fuse box, free of charge. The recall began on August 18, 2015. Owners may contact MBUSA customer service at 1-800-367-6372. MBUSA's number for this recall is 2015060007.

15V-426

Harley-Davidson Motor Company (Harley-Davidson) is recalling certain model year 2014-2015 Road King (FLHR), Street Glide (FLHX), Street Glide Special (FLHXS), Electra Glide Ultra Classic (FLHTCU), Ultra Limited (FLHTK), Police Road King (FLHP), Police Electra Glide (FLHTP), CVO Ultra Limited (FLHTKSE), 2014 CVO Road King (FLHRSE), and 2015 Electra Glide Ultra Classic Low (FLHTCUL), Ultra Limited Low (FLHTKL), Road Glide (FLTRX), Road Glide Special (FLTRXS), CVO Street Glide (FLHXSE), and CVO Road Glide Ultra (FLTRUSE) motorcycles. The affected motorcycles have saddlebag mounting receptacles that may not adequately secure the saddlebags to the motorcycle. If a saddlebag is not adequately secured, it may separate from the motorcycle while riding, creating a road hazard and increasing the risk of a crash. Harley-Davidson will notify owners, and dealers will replace the affected saddlebag mounting receptacles with updated receptacles, free of charge. The recall began on July 30, 2015. Owners may contact Harley-Davidson customer service at 1-800-258-2464. Harley-Davidson's number for this recall is 0166.

15V-427

Prevost Cars, Inc. (Prevost) is recalling certain model year 2015 X3-45 Commuter Coaches manufactured August 1, 2014, to June 1, 2015. The affected motorcoaches are equipped with hub carriers that may leak or crack. Cracks in the hub may result in hub failure, which could cause a loss of vehicle control, increasing the risk of a crash. Prevost will notify owners, and dealers will inspect and replace the affected hub carriers, free of

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JULY 2015**

Published September 2, 2015

charge. Owners may contact Prevost customer service at 1-877-773-8678. Prevost's number for this recall is SR15-330.

15V-428

Entegra Coach (Entegra) is recalling certain model year 2015 and 2016 Cornerstone Class A motorhomes, models 45B, 45J and 45K, manufactured from February 24, 2014, through August 18, 2015, and built on a Spartan Chassis. The affected motorhomes have rear jack plates that may rub on the tag axle brake air hose when the plates are retracted. If the rear jack plates rub on the air brake hose, an air leak may occur when the brake pedal is being pressed, reducing the braking performance of both the drive axle and the tag axle, lengthening the distance needed to stop the motorhome and increasing the risk of a vehicle crash. Entegra will notify owners on behalf of Spartan, and dealers will reposition the tag axle brake air hose so that it is clear of the jack plate, free of charge. The recall began on August 21, 2015. Owners may contact Entegra customer service at 1-800-945-4787.

15V-429

Starcraft Bus (Starcraft) is recalling certain model year 2008-2015 Prodigy and Quest school buses manufactured October 20, 2008, to June 1, 2015. The affected vehicles may be equipped with Tire Placards that display an incorrect kilopascal (kPa) value for tire pressures. The label may also be missing the spare tire information. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 110, "Tire Selection and Rims and Motor Home/Recreation Vehicle Trailer Load Carrying Capacity Information for Motor Vehicles with a GVWR of 4,536 kilograms (10,000 pounds) or less." If the tire is filled based on the incorrect information listed on the placard, the tire may be over inflated, possibly resulting in sudden tire failure, increasing the risk of a crash. Starcraft will notify owners and will provide them with corrected labels, free of charge. The recall is expected to begin during September 2015. Owners may contact Starcraft customer service at 1-800-348-7440.

15V-430

Chrysler (FCA US LLC) is recalling certain model year 2011-2015 Dodge Journey vehicles manufactured July 19, 2010, to May 26, 2015 and equipped with 2.4L engines. In the affected vehicles, the engine cover may detach from the engine and contact the exhaust manifold. If the displaced engine cover contacts the exhaust manifold, there would be an increased risk of a vehicle fire. Chrysler will notify owners, and dealers will install an improved mounting system for the engine cover, free of charge. Chrysler issued an interim notification to owners on August 12, 2015. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is R32.

15V-431

Daimler Trucks North America LLC (DTNA) is recalling certain model year 2002-2013 Thomas Built Buses Saf-T-Liner ER, 2001-2005 Saf-T-Liner Conventional, 2002-2013 Saf-T-Liner MVP-EF, 2013 Saf-T-Liner EFX, 2001-2008 Saf-T-Liner FS65, 2005-2013 Saf-T-Liner C2, 2003-2013 Saf-T-Liner HDX, 2002-2003 Saf-T-Liner MVP-ER, 2002 Vista, and 2002-2003 TL-960 school buses manufactured from February 5,

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JULY 2015**

Published September 2, 2015

2001, through May 29, 2012. In the affected vehicles, the stem that connects the outside emergency door handle to the emergency door opening mechanism may corrode. If the stem corrodes, the door handle could detach from the emergency door opening mechanism, delaying the opening of the door and the evacuation of the bus. In the event of an emergency, this may increase the risk of injury to the bus occupants. DTNA will notify owners, and dealers will either replace the stems or protect them against corrosion, free of charge. Daimler issued an interim notification to owners on August 25, 2015. The recall is expected to begin in early September, 2015. Owners may contact DTNA customer service at 1-800-745-8000. DTNA's number for this recall is FL-685.

15V-432

Ferrari North America, Inc. (FNA) is recalling certain model year 2015 Ferrari 458 Italia, 458 Spider, 458 Speciale, 458 Speciale A, California T, FF, F12 Berlinetta, and LaFerrari vehicles manufactured December 19, 2014, to April 29, 2015. The affected vehicles may be equipped with a driver side air bag module that was improperly assembled. This can cause the air bag to deploy in a rotated orientation. In the event of a crash, the deployment of the driver's air bag in a rotated orientation increases the risk of injury. FNA will notify owners, and dealers will replace the front Driver's Side Air Bag Module, free of charge. The recall began on August 10, 2015. Owners may contact Ferrari customer service at 1-866-551-2828. Ferrari's number for this recall is 57.

15V-433

Allied Recreation Group, Inc. (ARG) is recalling certain model year 2015-2016 Fleetwood Southwind recreational vehicles, model 32 VS, manufactured April 16, 2014, to June 19, 2015. The affected vehicles may have been manufactured without an emergency exit window on the road side bedroom wall. In the event of an emergency, the occupant's exit from the vehicle may be delayed or prevented, increasing their risk of injury. ARG will notify owners, and dealers will inspect the vehicles and, if necessary, they will replace the existing road side bedroom wall window with an emergency exit window, free of charge. The recall began on August 14, 2015. Owners can contact ARG customer service at 1-800-509-3417. ARG's number for this recall number is 150625ARG.

15V-434

Charles Machine Works Inc. (Charles Machine) is recalling certain model year 2014-2015 Ditch Witch T14MV trailers manufactured December 1, 2014, to June 22, 2015. The affected trailers may have an incorrect wiring harness that would result in the brakes not applying should the trailer breakaway from the tow vehicle. If the brakes do not activate in the event of a trailer breakaway, there would be an increased risk of a crash. Charles Machine will notify owners, and dealers will correct the pin locations in the trailer harness connector, free of charge. The recall began on July 24, 2015. Owners may contact Charles Machine customer service at 1-800-654-6481. Charles Machine's number for this recall is ID0388109.

15V-435

Ford Motor Company (Ford) is recalling certain model year 2015 Ford Escape vehicles manufactured April 1, 2014, to June 12, 2015, Ford Focus vehicles manufactured June 17, 2014, to June 12, 2015, and Ford C-Max vehicles manufactured April 22, 2014, to June 12, 2015. In the affected vehicles, the engine may continue to run after the key or the START/STOP engine button is turned to off. As such, these vehicles fail to comply with the

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JULY 2015**

Published September 2, 2015

requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 114, "Theft Protection and Rollaway Prevention." If the engine does not turn off as expected, someone could move the transmission shifter out of park and the vehicle may move unintentionally, increasing the risk of a crash. Ford will notify owners, and dealers will update the body control module software, free of charge. The recall began on July 27, 2015. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 15C06.

15V-436

VT Hackney, Inc. (VT Hackney) is recalling certain model year 2014-2015 Kidron Refrigerated Trailers manufactured August 9, 2013, to June 15, 2015. The affected trailers have a main wiring harness that may not supply adequate power to the connector at the rear of the trailer. This rear connector is used when a second trailer is attached for doubles operation. As a result of the insufficient power, second trailer's anti-lock brake system (ABS) may not function properly. As such, these vehicles fail to comply with the Requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 121, "Air Brake Systems." If the ABS module on the second trailer does not function properly, the trailer may have an increased braking distance in an emergency braking situation, increasing the risk of a crash. VT Hackney will notify owners, and dealers will install an additional power cable, free of charge. The recall began on August 20, 2015. Owners may contact VT Hackney customer service at 1-800-763-0700.

15V-437

Navistar, Inc. (Navistar) is recalling certain model year 2013-2015 International TranStar vehicles manufactured April 10, 2012, to December 12, 2014. Excessive engine crankcase pressures may cause the 90-degree elbow of the vent tube assembly to detach from the crankcase ventilation breather, possibly allowing engine oil to come into contact with hot surfaces. If engine oil comes into contact with a hot surface, there is an increased risk of a fire. Cummins will notify owners on behalf of Navistar, and dealers will secure the ends of the 90-degree elbow. In addition, the electronic control module (ECM) will be reprogrammed with software that can adjust the engine output under misfire conditions to limit crankcase pressures. These repairs will be performed free of charge. The recall began on June 16, 2015. Owners may contact Navistar customer service at 1-800-448-7825, or Cummins customer service at 1-800-343-7357.

15V-438

Honda (American Honda Motor Co.) is recalling certain model year 2013-2015 ST1300PA, 2014-2015 CB500, CBR500, CRF250L, CBR650, CTX700, NSS300, VT750, VT1300, 2015 CB300F, CBR300, CBR600, and 2014-2016 NC700 motorcycles. In the affected motorcycles, sealant may have been incorrectly applied to the starter relay switch, and as a result, the electrical system may have a loss of power. A loss of electrical power may cause an engine stall, increasing the risk of a crash. Honda will notify owners, and dealers will replace any affected starter relay switch, free of charge. The recall began on August 31, 2015. Owners may contact Honda customer service at 1-866-784-1870. Honda's number for this recall is JS9 and JT0.

15V-439

Wilson Trailer Company (Wilson) is recalling certain model year 2006-2015 Grain trailers manufactured January 1, 2006, to March 31, 2015. In the the affected trailers, the welds that attach the bolster plate to the pickup plate around the kingpin may fail. Failure of these welds may result in the kingpin separating from the pickup

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JULY 2015**

Published September 2, 2015

plate. If the kingpin separates from the pickup plate, the trailer could detach from the tractor, increasing the risk of a crash. Wilson will notify owners, and dealers will inspect the aluminum kingpin assemblies for cracked or failed welds, repairing them as necessary. Additionally, a new forged steel kingpin will be installed with supplemental fasteners. These repairs will be performed free of charge. The recall began on July 29, 2015. Owners may contact Wilson customer service at 1-800-798-2002. Wilson's number for this recall is 323D.

15V-440

KTM North America, Inc. (KTM) is recalling all model year 2014 1290 Super Duke R motorcycles manufactured July 1, 2013, to April 30, 2014. The affected motorcycles may leak fuel from the threaded inserts at the rear of the gas tank. A fuel leak from the threaded inserts, in the presence of an ignition source, may increase the risk of a fire. KTM will notify owners, and dealers will seal the threaded inserts to prevent future fuel leaks. If the motorcycle shows evidence of an existing fuel leak at the threaded insert, the gas tank will be replaced. These repairs will be performed free of charge. The recall began on August 11, 2015. Owners may contact KTM customer service at 1-888-985-6090. KTM's number for this recall is TB1507.

15V-441

General Motors LLC (GM) is recalling certain model year 2014-2015 Chevrolet Cruze vehicles manufactured November 8, 2013, to March 12, 2015, and 2015 Chevrolet Volt vehicles manufactured April 11, 2014. In the affected vehicles, the inner tie rod may not be tightened to specification allowing the tie rod to separate from the steering gear. Separation of the tie rod from the steering gear could result in the loss of steering, increasing the risk of a crash. GM will notify owners, and dealers will replace the steering gear assembly, free of charge. The recall began on July 28, 2015. Owners may contact Chevrolet customer service at 1-800-222-1020. GM's number for this recall is 15386.

15V-442

Autocar, LLC (Autocar) is recalling certain model year 2015-2016 Xpeditor vehicles manufactured November 18, 2014, to July 6, 2015. The affected vehicles are equipped with heating, ventilation and air conditioning (HVAC) units whose defrost mode door actuators may overheat. Overheating of the defrost actuator increases the risk of a fire. Autocar will notify owners, and dealers will install an additional harness with four, one amp fuses to the circuit, free of charge. The recall is expected to begin September 3, 2015. Owners may contact Autocar customer service at 1-765-489-5499. Autocar's number for this recall is ACX-1504.

15V-443

Chrysler (FCA US LLC) is recalling certain model year 2008-2010 Dodge Challenger vehicles manufactured September 19, 2007, to October 29, 2010. The affected vehicles are equipped with a dual-stage driver frontal air bag that may be susceptible to moisture intrusion which, over time, could cause the inflator to rupture. In the event of a crash necessitating deployment of the driver's frontal air bag, the inflator could rupture with metal fragments striking the driver or other occupants resulting in serious injury or death. Chrysler will notify owners, and dealers will replace the driver's frontal air bag inflator, free of charge. Parts to remedy the vehicles are not currently available. Interim notices were mailed to owners beginning on July 24, 2015. Owners will be sent a second notice when remedy parts become available. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is R37.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JULY 2015**

Published September 2, 2015

15V-444

Starcraft Bus (Starcraft) is recalling certain model year 2002-2007 Allstar, Starquest, Starlite, and Ultrastar commercial buses manufactured January 1, 2002, to September 30, 2007. The affected vehicles, when loaded with passengers and fuel, may exceed the gross vehicle weight rating (GVWR). As such, these vehicles fail to comply with the requirements of 49 CFR Part 567, "Certification." If the buses are loaded beyond the GVWR rating on the certification label, the vehicle could have poor handling, tire or suspension failure, increasing the risk of a vehicle crash. Starcraft will notify owners, and dealers will install a revised certification label based on corrected axle and wheel calculations or dealers will remove seats from buses that cannot support additional weight beyond the GVWR on the existing label. This work will be done free of charge. The recall is expected to begin September 25, 2015. Owners may contact Starcraft customer service at 1-800-348-7440. Starcraft's number for this recall is 05-06242015-0058.

15V-445

Kia Motors America (Kia) is recalling certain model year 2016 Kia Sorento vehicles manufactured October 23, 2014, to December 10, 2014. The affected vehicles have a front passenger seat belt whose buckle latch assembly may prevent the front passenger from fastening the seat belt. If the front passenger seat belt cannot be latched, an occupant sitting in the front passenger seat has an increased risk of injury in the event of a crash. Kia will notify owners, and dealers will replace the front passenger seat belt buckle cover, free of charge. The recall began on August 18, 2015. Owners may contact Kia customer service at 1-800-333-4542. Kia's number for this recall is SC123.

15V-446

Vermeer Manufacturing Company (Vermeer) is recalling certain model year 2012-2015 BC900XL brush chippers manufactured January 30, 2012, to July 30, 2015. The flanges that attach the brush chipper discharge chute may crack and fail while the brush chipper is being towed, causing the chute to separate from the chipper. If the chute detaches from the chipper, it would become a road hazard, increasing the risk of a crash. Vermeer will notify owners, and dealers will relocate the discharge chute rotation clamps and will add an additional clamp, free of charge. The recall is expected to begin September 9, 2015. Owners may contact Vermeer customer service at 1-800-829-0051. Vermeer's number for this recall is IK3194.

15V-447

Spartan Motors, Inc. (Spartan) is recalling certain model year 2007-2015 Advantage, Diamond, Gladiator, and MetroStar emergency response vehicles manufactured January 18, 2007 to February 9, 2015. The front wheels of the affected vehicles have valve stems that may rub against the brake caliper. If the valve stems rub against the brake caliper, a hole may develop causing the tire to deflate suddenly, increasing the risk of a crash. Spartan will notify owners, and dealers will inspect the front wheel valve stems and replace any that have wear marks, free of charge. Owners may contact Spartan customer service at 1-517-543-6400. Spartan's number for this recall is 15012.

15V-448

Toyota Motor Engineering & Manufacturing (Toyota) is recalling certain model year 2012-2014 Prius V vehicles

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JULY 2015**

Published September 2, 2015

manufactured August 22, 2011, to June 30, 2014. A component within the hybrid inverter assembly may overheat, causing the hybrid system to reduce output power allowing the vehicle to only drive a short distance. In some circumstances, the hybrid system may shut down causing the vehicle to stop while being driven. The vehicle may enter a fail-safe/limp-home mode that limits the drivability of the vehicle. The hybrid system could also shut down completely resulting in a vehicle stall, increasing the risk of a crash. Toyota will notify owners, and dealers will update the software for the motor/generator control electronic control unit (ECU) and the hybrid control ECU, free of charge. The recall began on July 30, 2015. Owners may contact Toyota customer service at 1-888-270-9371.

15V-449

BMW of North America, LLC (BMW) is recalling certain model year 2014-2015 MINI Cooper and MINI Cooper S Hardtop 2 Door vehicles and 2015 MINI John Cooper Works Hardtop 2 Door vehicles. The affected vehicles do not meet the side impact performance requirements for the rear seat passengers. As such, these vehicles fail to comply with Federal Motor Vehicle Safety Standard (FMVSS) number 214, "Side Impact Protection." If the side impact performance requirements are not met, rear seat passengers may be at a higher risk of injury during a crash. MINI will notify owners, and dealers will install additional energy absorption material between the rear interior side panels and the exterior vehicle body, free of charge. The recall is expected to begin September 12, 2015. Owners may contact MINI customer service at 1-866-825-1525. Note: this recall supersedes 14V-815.

15V-450

Mazda North American Operations (Mazda) is recalling certain model year 2007-2014 CX-9 vehicles manufactured October 24, 2006, to December 28, 2013. The affected vehicles have front suspension ball joints that may corrode from water leaking into the fitting. Over time, the ball joint corrosion may result in the front lower control arm separating from the ball joint, causing a loss of steering control and increasing the risk of a crash. Mazda will notify owners, and dealers will replace both the left and right lower control arms, free of charge. In early September 2015, owners will be mailed an interim notification informing them of recall. When remedy parts are available, owners will be mailed a second notification. The recall will begin with model year 2007-2009 vehicles registered in Connecticut, Delaware, Illinois, Indiana, Iowa, Kentucky, Maine, Maryland, Massachusetts, Michigan, Minnesota, Missouri, New Hampshire, New Jersey, New York, Ohio, Pennsylvania, Rhode Island, Vermont, Virginia, Washington D.C., West Virginia, and Wisconsin. The second phase will be for model year 2010-2014 vehicles in the same states. Finally, all remaining vehicles will be remedied. Owners may contact Mazda customer service at 1-800-222-5500. Mazda's number for this recall is 8515G.

15V-451

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain model year 2014-2015 Audi SQ5 vehicles manufactured May 22, 2013, to April 14, 2015. The affected vehicles have an electric power steering assist system that may shut down in cold temperatures due to a steering motor sensor fault. If the vehicle experiences a loss of power steering assist, extra steering effort will be required at lower speeds, increasing the risk of a vehicle crash. Volkswagen will notify owners, and dealers will update the power steering control module software, free of charge. The recall began on July 31, 2015. Owners may contact Audi customer service at 1-800-253-2834. Volkswagen's number for this recall is 48M1.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JULY 2015**

Published September 2, 2015

15V-452

Nissan North America, Inc. (Nissan) is recalling certain model year 2015 Nissan Rogue vehicles manufactured June 9, 2015, to June 10, 2015, and 2015 Nissan Sentra and Versa Note vehicles manufactured June 5, 2015, to June 13, 2015. In the affected vehicles, the driver side front and rear doors may not fully latch. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 206, "Door Locks and Door Retention Components." A door that does not fully latch may result in the door opening while the car is moving. The distraction may increase the risk of a crash and/or a vehicle occupant may fall out of the vehicle if they are not wearing a seatbelt, increasing their risk of injury. Nissan will notify owners, and dealers will inspect the date, lot number, and cavity code on the left front and rear door latches, and replace them, as necessary, free of charge. The recall is expected to begin by mid-September 2015. Owners may contact Nissan customer service at 1-800-647-7261.

15V-453

Allied Recreation Group, Inc. (ARG) is recalling certain model year 2016 Fleetwood Flair, Storm, Terra SE, Jamboree Sport, Tioga Montara, Tioga Ranger, Holiday Rambler Admiral, and Monaco Trek vehicles. The affected vehicles may have been improperly manufactured with a vertical propane gas tank regulator, instead of the horizontal gas tank regulator required. Use of the incorrect regulator can allow moisture to build up in the regulator, possibly resulting in improper operation. If the regulator fails to operate properly, it can cause a propane gas leak, increasing the risk of a fire. ARG will notify owners, and dealers will inspect the motorhomes and replace the regulator, as necessary, free of charge. The recall began on August 14, 2015. Owners may contact ARG customer service at 1-800-509-3417. ARG's number for this recall is 150708ARG.

15V-454

Tracker Marine L.L.C. (Tracker) is recalling certain model year 2016 Trailstar Tahoe boat trailers, models 400, 450, 500, and 550, manufactured March 23, 2015, to June 24, 2015. The affected trailers were built with wheels that have load range "C" tires installed, instead of load range "D" tires as specified. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 110, "Tire Selection and Rims and Motor Home/Recreation Vehicle Trailer Load Carrying Capacity Information for Motor Vehicles with a GVWR of 4,536 kilograms (10,000 pounds) or less." If the trailer exceeds the load rating on the tire, the tire may suddenly fail, increasing the risk of a crash. Tracker will notify owners, and dealers will replace the wheels that have load range "C" tires for wheels with the correct load range "D" tires, free of charge. Owners may contact Tracker customer service at 1-417-873-4555. Tracker's number for this recall is TS-0031.

15V-455

PACCAR Incorporated (PACCAR) is recalling certain model year 2012-2016 Peterbilt 365, 367, 384, 386, 388, 389, 567, 579, and 587 trucks manufactured January 13, 2011, to April 20, 2015. The affected trucks, equipped with extended-body Leece Neville alternators, have alternator charge cables that may chafe against a formed metal freon discharge line. If the alternator cable rubs through its insulation, an electrical short may occur, increasing the risk of a fire. Peterbilt will notify owners, and dealers will reroute the alternator charge cable away from the metal freon line and install a plastic insulator on the cable end, free of charge. The recall is expected to

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JULY 2015**

Published September 2, 2015

begin September 17, 2015. Owners may contact Peterbilt customer service at 1-940-591-4000. Peterbilt's number for this recall is 715-K.

15V-456

PACCAR Incorporated (PACCAR) is recalling certain model year 2016 Kenworth T440, T470, T660, T680, T800, T880, and W900 trucks manufactured February 16, 2015, to March 9, 2015. The affected vehicles are equipped with an SR-7 spring brake valve assembly that may have had the primary and secondary service brake applications installed in reverse. In the event of a failure in the primary or secondary circuit, the redundant circuit would not provide adequate service brake functionality. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) No. 121, "Air Brake Systems." A loss of braking ability would increase the risk of a crash. Kenworth will notify owners, and dealers will inspect the vehicles and correct the air line installations as required, free of charge. The recall is expected to begin September 17, 2015. Owners may contact Kenworth customer service at 1-425-828-5000. PACCAR's number for this recall is 15KWK.

15V-457

PACCAR Incorporated (PACCAR) is recalling certain model year 2011-2016 Kenworth T440, T470, T660, T680, and T880 trucks manufactured January 14, 2010, to May 22, 2015, and equipped with HID Headlamps and the option for Daytime Running Lamps (DRL). The DRLs are required to deactivate when the hazard warning lights are activated, however, the DRLs on these vehicles override the hazard flashing functionality after the brake pedal is pushed for more than two seconds. Normal hazard flashing functionality returns once the service brake is released. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) No. 108, "Lamps, Reflective Devices, and Associated Equipment." If the hazard warning lamps are overridden by the DRL, oncoming vehicles may fail to be warned, increasing the risk of a crash. Kenworth will notify owners, and dealers will update the cab controller software, free of charge. The recall is expected to begin September 17, 2015. Owners may contact Kenworth customer service at 1-425-828-5000. Kenworth's number for this recall is 15KWL.

15V-458

Chrysler (FCA US LLC) is recalling certain model year 2012-2014 Ram 1500, 2500, 3500, 4500, and 5500 trucks manufactured January 18, 2011, to October 7, 2014, and equipped with the Electronic Vehicle Information Center option. The affected vehicles have a steering wheel wiring harness that may rub against the driver air bag module retainer spring. This abrasion may result in an electrical short that could cause driver's frontal air bag to unexpectedly deploy. Inadvertent deployment of the air bag may increase the risk of injury and the possibility of a vehicle crash. Chrysler will notify owners, and dealers will inspect, repair as necessary, and secure the steering wheel wiring harness. Additionally, protective caps will be added to the air bag retainer spring ends. These repairs will be done free of charge. The recall is expected to begin September 19, 2015. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is R36.

15V-459

Chrysler (FCA US LLC) is recalling certain model year 2013-2015 Ram 1500, 2500, 3500, 4500, and 5500, 2015 Chrysler 200, Chrysler 300, Dodge Charger, and Dodge Challenger, 2014-2015 Jeep Grand Cherokee,

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JULY 2015**

Published September 2, 2015

Cherokee, and Dodge Durango, and 2013-2015 Dodge Viper vehicles. The affected vehicles are equipped with radios that have software vulnerabilities that can allow third-party access to certain networked vehicle control systems. Exploitation of the software vulnerability may result in unauthorized remote modification and control of certain vehicle systems, increasing the risk of a crash. Chrysler will notify and mail affected owners a USB drive that includes a software update that eliminates the vulnerability, free of charge. Optionally, owners may download the update to their own USB drive from <http://www.driveuconnect.com/software-update/> or take their vehicle to a Chrysler dealer for immediate installation. In an effort to mitigate the effects of this security vulnerability, Chrysler has had the wireless service provider close the open cellular connection to the vehicle that provided unauthorized access to the vehicle network. This measure may not have been implemented on all vehicles and does not address access by other means that will be remedied by the software update. The recall is expected to begin the last week of August 2015. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is R40.

15V-461

Forest River, Inc. (Forest River) is recalling certain model year 2007-2015 Glaval Bus Titan II transit buses manufactured June 12, 2007, to January 14, 2015. The affected vehicles may have a cable that is routed across the top of the fan shroud. This cable is not properly positioned on the terminal strip, which can cause a loose connection or possible arching. If the cable is improperly positioned can experience a loose connection, or cause arching, increasing the risk of a vehicle fire. Forest River will notify owners, and dealers will inspect the cable to stud connection, and reposition the cable, free of charge. Owners may contact Forest River customer service at 1-219-533-5934. Forest River's number for this recall is 35-05262015-0038.

15V-462

General Motors LLC (GM) is recalling certain model year 2013-2016 Cadillac ATS vehicles manufactured April 25, 2012, to June 25, 2015. The affected vehicles may experience the roof panel closing automatically when the non-recessed switches are pressed and the roof panel is open. These vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) No. 118, "Power-Operated Window, Partition, and Roof Panel Systems." Because the switch is not recessed, the roof panel switch may inadvertently be pressed resulting in unintended auto-closure of the roof panel, increasing the risk of personal injury. GM will notify owners and dealers will replace the roof console accessory switch trim plate, free of charge. The recall began on August 19, 2015. Owners may contact Cadillac customer service at 1-800-458-8006. GM's number for this recall is 15568. Note this recall supersedes 15V-106.

15V-463

Ford Motor Company (Ford) is recalling certain model year 2015 Ford Taurus, Ford Flex, and Lincoln MKS vehicles manufactured May 4, 2015, to May 23, 2015, Lincoln MKT vehicles manufactured May 4, 2015, to May 21, 2015, and 2015-2016 Ford Explorer vehicles manufactured May 4, 2015, to May 23, 2015. The affected vehicles have a parking brake that may not fully engage when applied. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 135, "Light Vehicle Brake Systems." If the parking brake does not fully engage and the transmission is left in a gear other than 'Park' while on a slope, the vehicle may roll away, increasing the risk of a crash. Ford will notify owners, and dealers will test the operation of the parking brake system, and if necessary, replace the parking brake control assembly,

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JULY 2015**

Published September 2, 2015

free of charge. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 15C07.

15V-464

General Motors LLC (GM) is recalling certain model year 2014-2015 Chevrolet Impala vehicles manufactured April 15, 2013, to June 19, 2015, equipped with front vented-heated passenger seats. Accordingly, the Automatic Occupant Sensing (AOS) system may fail to suppress the front passenger air bag if a child seat is in the front passenger seat. These vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) No. 208, "Occupant Crash Protection." If the front passenger air bag deploys with a child seat in the front passenger seat, it increases the risk of injury to the child. GM will notify owners, and dealers will correct the calibration-learning error by preconditioning the empty seat, and also resetting the ECU to a seat zero-value, free of charge. The recall began on August 25, 2015. Owners may contact Chevrolet customer service at 1-800-222-1020. GM's number for this recall is 15400.

15V-465

Chrysler (FCA US LLC) is recalling certain model year 2011-2014 Dodge Charger vehicles manufactured May 6, 2010, to June 5, 2014. In the affected vehicles, the side impact sensor calibrations may be overly sensitive, and as a result, the side air bag inflatable curtains and seat air bags may unexpectedly deploy and the seat belt pre-tensioners may activate. Air bags that unexpectedly deploy increase the risk of a crash or injury. Chrysler will notify owners, and dealers will update the Occupant Restraint Control module calibration, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is R35.

15V-467

Chrysler (FCA US LLC) is recalling certain model year 2015 Ram 4500, and 5500 pickup trucks manufactured January 30, 2015, to February 6, 2015. The affected vehicles may have inadequate penetration of the front upper control arm loop to spacer weld, reducing the front suspension stability. A reduction of suspension stability control could affect control of the vehicle, increasing the risk of a crash. Chrysler will notify owners, and dealers will inspect and replace any upper control arms, free of charge. The recall is expected to begin September 19, 2015. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is R34.

15V-468

Chrysler (FCA US LLC) is recalling certain model year 2015 Jeep Grand Cherokee and Dodge Durango vehicles manufactured June 12, 2015, to June 20, 2015. The affected vehicles may be equipped with rear lower control arms that may have been incorrectly heat treated. This may cause the rear lower control arm to fracture. If the rear lower control arm fractures it may result in a change in ride height, loss of rear end stability, and reduced braking capabilities, increasing the risk of a crash. Chrysler will notify owners, and dealers will inspect and if necessary replace the lower control arms, free of charge. The recall began July 29, 2015. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is R38. Note: This supersedes Recall No. 15V-407.

15V-469

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JULY 2015**

Published September 2, 2015

Chrysler (FCA US LLC) is recalling certain model year 2015 Chrysler 200 vehicles manufactured January 7, 2014, to September 23, 2014. The affected vehicles may have a Power Distribution Center (PDC) electrical connector that may cause intermittent power failures to certain electrical components. An intermittent loss of power to electrical components could cause a vehicle to stall without warning, increasing the risk of a crash. Chrysler will notify owners, and dealers will replace the C4 connector using a 12 wire split kit for 3.6L engines, or replace the transmission wiring harness for 2.4L engines, free of charge. The parts needed for the recall are currently unavailable. Owners will be notified of the recall on or around September 18, 2015, with second notifications mailed when remedy parts become available. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is R24.

15V-470

Spartan Motors USA (Spartan) is recalling certain model year 2015-2016 K2, and K3 vehicles manufactured November 19, 2013, to May 7, 2015. Power could be lost in the vehicle's air suspension system. A failure of the air suspension system could result in a loss of some vehicle control, increasing the risk of a crash. Spartan will notify owners, and dealers will install a independent electrical circuit that will supply power to the control module, free of charge. Owners may contact Spartan customer service at 1-517-543-6400. Spartan's number for this recall is 15018.

15V-471

Honda (American Honda Motor Co.) is recalling certain model year 2016 HR-V vehicles manufactured January 12, 2015, to May 20, 2015. The affected vehicles may be missing the required tire placard indicating "Tire and Loading Information." These vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) 110, "Tire Selection and Rims and Motor Home/Recreation Vehicle Trailer Load Carrying Capacity Information for Motor Vehicles with a GVWR of 4,536 kilograms (10,000 pounds) or less." If the tire placard is missing the driver or owner may not know at what pressure to inflate the tires, resulting in over or under tire inflation which potentially increases the risk of a tire failure and crash. Honda will notify owners, and dealers will inspect the vehicle, and apply a new label, free of charge. The recall is expected to begin September 18, 2015. Owners may contact Honda customer service at 1-888-234-2138. Honda's number for this recall is JT2, or JT4.

15V-472

Altec Industries Inc. (Altec) is recalling certain model year 2006-2015 Aerial Devices manufactured from June 1, 2006, through April 1, 2015. The affected aerial devices outrigger interlock control system may not detect proper deployment of the outriggers, allowing for instability of the boom. If the aerial device is operated while the outrigger is not properly deployed it can cause instability of the boom, increasing the risk of person injury or death. Altec will notify owners, and dealers will replace the aerial device with a new outrigger interlock module, free of charge. Owners may contact Altec customer service at 1-205-991-7733. Altec's number for this recall is CSN 625.

15V-473

Harley-Davidson Motor Company (Harley-Davidson) is recalling certain model year 2015 XG500 motorcycles manufactured January 20, 2014, to June 24, 2015, and XG750 motorcycles manufactured May 12, 2014, to

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JULY 2015**

Published September 2, 2015

June 24, 2015. The fuel pump modules on these motorcycles have a poor seal at the fuel pump inlet. If there is a poor seal at the fuel pump inlet it can cause interruption to the fuel supply, possibly causing a brief hesitation with the abrupt restoration of power. This abrupt restoration of power can lead to loss of control, increasing the risk of a crash. Harley-Davidson will notify owners, and dealers will install a new fuel pump assembly, free of charge. The recall begin on August 21, 2015. Owners may contact Harley-Davidson customer service at 1-414-343-4056. Harley-Davidson's number for this recall is 0167.

15V-474

Honda (American Honda Motor Co.) is recalling certain model year 2013-2015 Honda CBR500 motorcycles manufactured January 24, 2013, to May 14, 2015, and 2013-2015 CB500 motorcycles manufactured January 31, 2013, to May 16, 2015. The affected motorcycles may experience the fuel level sensor float arm becoming deformed due to exposure to environmental and roadway conditions. This deformation can cause the float arm to separate from the fuel level sensor body. If the float arm separates from the sensor body, it can give the fuel meter inaccurate information, or in some cases the float may contact the positive and negative terminals causing an electrical short. Either condition may cause the vehicle to stall, increasing the risk of a crash. Honda will notify owners, and dealers will replace the fuel level sensor assembly, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Honda customer service at 1-310-783-2000. Honda's number for this recall is JT1.

15V-475

Ford Motor Company (Ford) is recalling certain model year 2015 Lincoln MKT Town Car vehicles equipped with the livery package manufactured February 4, 2015, to June 23, 2015. The vehicles were intended to seat five passengers, but were delivered without the second row seating. Accordingly, the vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) No. 110. The vehicles also fail to comply with FMVSS No. 225, "Child Restraint Anchorages" since they were delivered without a tether anchorage at the front passenger seating position, and as is required for vehicles without a second row of seats. The vehicles do not have the seats and restraints that they were intended to have. Unrestrained or improperly restrained occupants are at an increased risk of injury in the event of a crash. Dealers will inspect and install second row seating if it is missing. The recall began on July 28, 2015. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 15C08.

15V-476

Newmar Corporation (Newmar) is recalling certain model year 2009-2016 Canyon Star toy haulers manufactured from November 28, 2007, through July 9, 2015, and model year 2007-2009 All Star toy haulers manufactured from January 30, 2006, through October 21, 2009. There is unprotected flammable plastic wrap surrounding the exterior fuel dispensing system which could burn if exposed to an ignition source. If the exterior fuel dispensing compartment were to catch fire, the surrounding plastic wrap material could burn increasing the risk of a vehicle fire. Newmar will notify owners, and dealers will install a protective metal sheet on the top of the exterior fuel compartment. The repair will be performed free of charge. The recall began on September 1, 2015. Owners may contact Newmar customer service at 1-574-773-7791.

15V-477

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JULY 2015**

Published September 2, 2015

Forest River, Inc. (Forest River) is recalling certain model year 2015 Glaval Bus Apollo, Concorde, Entourage, and Legacy, and Elkhart Coach ECE4, 2014-2016 AllStar XL, and 2014-2015 Forest River Rockport, Starcraft Starquest, AllStar, Starlite, AllStar MVP, XLT, and Xpress vehicles. The affected vehicles are equipped with a back up camera system which may display images from the camera in reverse. If an object or person are on the left side of the screen but are actually on the right side of the vehicle, or vice versa, there is an increased risk of a crash. Forest River will notify owners, and dealers will replace the camera, free of charge. The recall began on August 25, 2015. Owners may contact Forest River customer service at 1-574-264-5179. Forest River's number for this recall is 51-06232015-0057.

15V-478

Temsa Global Sanayi Ve Ticaret A.S. (Temsa) is recalling certain model year 2013-2016 TS45 coaches manufactured from July 1, 2013, through July 28, 2015. Due to the low output pressure of the inversion relay valve, the affected coaches may have insufficient air pressure for the rear axle parking brake system. The low air pressure may cause the parking brakes to drag while the vehicle is in motion resulting in the overheating of the disc brakes, increasing the risk of a fire. The remedy for this recall is still under development. Owners may contact Temsa customer service at 1-404-602-0151.

15V-479

Forest River, Inc. (Forest River) is recalling certain model year 2014-2016 Sandpiper and Sierra recreational vehicles manufactured October 15, 2013, to July 13, 2015. The affected vehicles may be equipped with Certification labels with an inaccurate gross vehicle weight rating (GVWR). Thus, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standards (FMVSS) No. 567, "Certification." An inaccurate weight rating on a certification label conveys inaccurate information to the vehicle owner or operator about that vehicle's load carrying capacity, thereby increasing the risk of vehicle overloading which can cause tire failure and a crash. Forest River will notify owners, and dealers will provide a new federal certification label, free of charge. The recall began on August 25, 2015. Owners may contact Forest River customer service at 1-219-533-5934. Forest River's number for this recall is 03-07292015-0067.

15V-480

Liftmoore, Inc. is recalling Sure Power Battery Equalizers, part number 12040E00, sold as replacement parts for installation and use on certain 2001 through 2006 6036WX crane trucks. The specific potting compound used in the subject products for insulation was found to be capable of conducting electricity after being exposed to heat. Once electrically conductive, the material is capable of melting and burning, increasing the risk of a fire. Liftmoore will notify owners, and dealers will replace any affected battery equalizer, free of charge. Owners may contact Liftmoore customer service at 1-713-688-5533. Liftmoore's number for this recall is 13E-050.

15V-481

Heartland Recreational Vehicles, LLC (Heartland) is recalling certain model year 2010-2016 Heartland Big Country trailers manufactured January 1, 2010, to July 23, 2015. The tire certification labels applied to the vehicles may contain inaccurate tire sizing and/or inflation information. As such, these vehicles fail to comply with the requirements of 49 CFR Part 567, "Certification." An owner or operator could rely on the inaccurate information in inflating the tires which could cause under or over inflation which, in turn, could lead to a tire failure

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JULY 2015**

Published September 2, 2015

or crash. Heartland will notify owners, and dealers will send a replacement label with the correct information, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Heartland customer service at 1-574-266-3988.

15V-482