

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING SEPTEMBER 2015**

*Published October 14, 2015*

**CHILD SEATS:**

None during September 2015.

**EQUIPMENT:**

Specialty Products Company (SPC) is recalling certain aftermarket alignment hardware kits, part number 28810 (for use on certain 1999-2015 Mercedes-Benz vehicles), and part number 66037 (for use on 2005-2015 Chrysler 300 & 300C, 2006-2008 Dodge Magnum and 2008-2015 Dodge Charger and Challenger vehicles) that were sold by Specialty Products Company between March 9, 2015 and June 22, 2015. The affected suspension bolts may fracture. If suspension bolt fractures it can cause a loss of vehicle control, increasing the risk of vehicle crash. SPC will notify owners and dealers will replace the affected bolts, free of charge. The recall began on September 3, 2015. Owners may contact SPC customer service at 1-303-772-2103.

**15E-071**

Peter Paul Electronics Co., Inc. (Peter Paul) is recalling certain nitrous oxide intake solenoid valves, part numbers 22X01421GM 12/DC, 22X01431GM 12/DC; 22X01441GM 12/DC; 70-1010; 22X01701GM 12/DC; 22X00981GM 12/DC; 22X01031GM 12/DC; 22X01481GM 12/DC; 22X01731GM 16/DC; 22X01751GM 12/DC; 22X01761GM 12/DC; 22X01781GM 16/DC; 22X01821GM 16/DC; 22X01861GM 12/DC; 22X01871GM 12/DC; 22X01881GM 12/DC; O22X00551GM 12/DC; and O22X00591GM 16/DC manufactured May 5, 2015, to July 24, 2015. The affected valves have end stop sleeves that may break when under pressure either during installation or during use. If the end stop sleeves break, portions of the valve may become projectiles, increasing the risk of injury to those nearby or possibly damaging other nearby components. Peter Paul will notify the manufacturers who purchased the valves for use in nitrous oxide fuel systems and provide them replacement solenoid valves, free of charge. Owners may call Peter Paul customer service at 1-860-919-8188.

**15E-072**

Cummins Inc. (Cummins) is recalling certain ISB6.7, ISL9, ISX12 and ISX15 engines. The affected engines have an Engine Control Module (ECM) that may short circuit and blow a fuse resulting in the engine stalling without warning. An engine that stalls without warning increases the risk of a crash. Cummins will notify owners, and dealers will replace any defective ECM with a remedy part, free of charge. The recall is expected to begin October 31, 2015. Owners may contact Cummins customer service at 1-800-343-7357. Cummins' number for this recall is C1698.

**15E-073**

Cequent Consumer Products, Inc. (Cequent) is recalling certain model Reese Explore Bike Carriers, part numbers 1392900 (two-bike trunk mount bike carrier), 1393100 (four-bike hitch mount bike carrier), and 6314400 (four-bike hitch mount bike carrier), manufactured from January 1, 2015, through July 17, 2015. The affected bike carriers have cradles that may have been molded incorrectly, which can cause the cradle to rip and fail. If the cradle fails, a bicycle on the cradle may partially or fully fall from the rack, becoming a road hazard and increasing the risk of a vehicle crash. Cequent will notify owners and will provide a cradle replacement kit. The recall began September 28, 2015. Owners may contact Cequent customer service at 1-877-208-2573 or by

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING SEPTEMBER 2015**

*Published October 14, 2015*

email at [returnsprocessing@cequentgroup.com](mailto:returnsprocessing@cequentgroup.com).

**15E-074**

Old World Industries, LLC (Old World) is recalling certain Peak Lithium Rechargeable Jump-Starters, model PKC0LS, manufactured December 22, 2014, to March 24, 2015. The affected jump-starters contain a lithium battery that may overheat. If the battery overheats, there is an increased risk of a fire. Old World will notify owners, and distributors will refund purchasers the cost of the jump-starter and the return shipping charges. The manufacturer has not yet provided a notification schedule. Owners may contact Old World customer service at 1-847-559-2000.

**15E-075**

Henderson Wheel & Trailer Supply Inc. (Henderson Wheel) is recalling certain torsion arm assemblies, part numbers B-7100A, B-7110A, HT-35XL, T35545EB, T35545I, T35550EB, T35550HB, T35550I, T35655EB and T35655I, manufactured February 18, 2015 to August 25, 2015. The torsion arm of the assembly was made too small for its housing, and as a result, the torsion arm, spindle, and tire and wheel assemblies may detach from the trailer. A separation of the torsion arm can result in a loss of trailer stability and control, increasing the risk of a crash. Henderson Wheel will notify the trailer manufacturers that used the affected axles in their trailer production. Those companies will notify their customers and will reinforce or replace the torsion arm assemblies, as necessary, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Henderson Wheel customer service at 1-801-486-4916.

**15E-076**

Eaton (Eaton Corporation) is recalling certain Eaton Fuller FR-Series 10-speed manual transmissions, models FR-14210B, FRF-15210B, FRF-9210B, FRM-15210B, FRO-11210B, FRO-13210B, FRO-14210C, FRO-15210C, FRO-16210B, FRO-16210C, FROF-11210C, FROF-12210C, FROF-13210C, FROF-14210C, FROF-15210C, and FROF-16210C, manufactured December 18, 2014, to December 21, 2014. When the transmission shift lever is moved from reverse to neutral, the reverse gear may stay engaged. When the transmission shift lever is moved from reverse to a forward gear position, the transmission may mechanically lock because both the reverse gear and forward gear are simultaneously engaged. Even though the transmission has been shifted out of reverse into neutral, the vehicle may unexpectedly move backwards, increasing the risk of a crash. Eaton will notify the vehicle manufacturers that purchased the transmissions. Those vehicle manufacturers will notify owners and remedy the recall issue, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Eaton's customer service number at 1-800-386-1911.

**15E-077**

Lippert Components, Inc. (Lippert) is recalling certain Coachstep Double and Triple Electric Steps manufactured May 25, 2007, to December 18, 2014. The bolt that attaches the fan gear assembly to the steps may fracture allowing the fan gear to disengage from the steps. As a result, the steps may not remain in the expected position and may be unstable. Unstable entry and exit steps increase the risk of injury. The remedy for this recall campaign is still being finalized. The recall is expected to begin in October 2015. Owners may contact Lippert customer service number at 1-574-537-8900. Lippert's number for this recall is LCI-SCS-091815.

**15E-078**

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING SEPTEMBER 2015**

*Published October 14, 2015*

**TIRES:**

None during September 2015.

**VEHICLES:**

Spartan Motors USA (Spartan) is recalling certain model year 2008-2010 Gladiator, and MetroStar emergency vehicles manufactured December 12, 2008, to August 6, 2010. The affected vehicles have mirror lenses that may fall off due to vibration. If the mirror lens comes loose and falls out, the driver's ability to see objects in the mirror would be impaired, increasing the risk of a crash. Spartan will notify owners, and dealers will install a new mirror assembly, free of charge. The recall is expected to begin on October 21, 2015. Owners may contact Spartan customer service at 1-800-582-3454. Spartan's number for this recall is 15016.

**15V-547**

Spartan Motors USA (Spartan) is recalling certain 2007-2008 MM and K2 motorhome chassis manufactured March 07, 2006, to June 22, 2006. The affected vehicles have tag axles with wheel bearings that may be adjusted too tight, resulting in their overheating during use. If the wheel bearings overheat, there is an increased risk of a wheel end fire. Spartan will notify owners, and dealers will adjust the wheel bearing load, replacing the bearings as necessary, free of charge. The recall began on October 7, 2015. Owners may contact Spartan at 1-800-582-3454. Spartan's number for this recall is 14015.

**15V-548**

Spartan Motors USA (Spartan) is recalling certain model year 2004-2008 K2, K3 and MM motorhomes manufactured March 17, 2003, to March 15, 2007. In the affected vehicles, the engine cooling fan may separate from the fan drive while the fan is spinning. If the engine area is open and the cooling fan is operating and detaches, someone nearby may be injured. Spartan will notify owners, and dealers will replace the fan and fan drive system, free of charge. The recall is expected to begin during October 2015. Owners may contact Spartan customer service at 1-800-582-3454. Spartan's number for this recall is 15014.

**15V-549**

Kawasaki Motors Corp., U.S.A. (Kawasaki) is recalling certain model year 2009-2015 Vulcan 1700 Voyager and 2011-2015 Vulcan 1700 Vaquero motorcycles manufactured February 2, 2009, to March 20, 2015. In the affected vehicles, an ignition wire may chafe due to contact with the fuel tank, resulting in a short circuit and possible engine stall. An engine stall increases the risk of a crash. Kawasaki will notify owners, and dealers will install additional shielding and padding to prevent the ignition wire from shorting. Any ignition switch that has damaged wires will be replaced. These repairs will be performed free of charge. The recall began on September 15, 2015. Owners may contact Kawasaki customer service at 1-866-802-9381. Kawasaki's number for this recall is MC15-10.

**15V-550**

Foretravel, Inc. (Foretravel) is recalling certain model year 2012-2014 Nimbus, Phenix, and IH45 motorhomes

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING SEPTEMBER 2015**

*Published October 14, 2015*

manufactured May 16, 2011, to February 24, 2014. The affected vehicles are built with independent front suspensions that may have loose ball joints. A loose ball joint may separate from the steering linkage resulting in a loss of steering control and an increased risk of a crash. Foretravel will notify owners, and dealers will inspect the motorhomes and tighten the ball joints, as necessary, free of charge. The recall began on October 6, 2015. Owners may contact Foretravel customer service at 1-800-955-6226, option 3.

**15V-551**

Forest River, Inc. (Forest River) is recalling certain model year 2016 Shasta Airflyte 16 and Shasta Airflyte 19 trailers manufactured September 26, 2014, to August 17, 2015. The affected vehicles may have insufficient clearance between the tire and the wheel well at the top of the tire tread and also at the inner sidewall. If there is insufficient tire clearance, the tire may rub, resulting in sudden tire failure which could increase the risk of a crash. Forest River will notify owners, and dealers will install a new axle that provides the proper clearance between the tire and the wheel well, free of charge. The recall began on October 8, 2015. Owners may contact Forest River customer service at 1-574-825-8717. Forest River's number for this recall is 53-08282015-0082.

**15V-552**

Forest River Inc. (Forest River) is recalling certain model year 2016 Shasta Airflyte 16 and Shasta Airflyte 19 trailers manufactured September 26, 2014 to August 17, 2015. In the affected vehicles, the rear exit window glass may come loose and fall out due to poor adhesion. If the rear window glass detaches, it could fall onto the road and be a road hazard, increasing the risk of a crash. Forest River will notify owners, and dealers will inspect the trailers to verify that the windows are properly secured. Any window that fails the inspection process will be replaced. These repairs will be performed free of charge. The recall is expected to begin on October 28, 2015.

Owners may contact Forest River customer service at 1-574-825-8717. Forest River's number for this recall is 53-08282015-0081.

**15V-553**

Spartan Motors (Spartan) is recalling certain model year 2010-2013 Spartan K3 and MM motorhome chassis manufactured August 7, 2008, to June 4, 2013. In the affected vehicles, the flexible exhaust tube may tear allowing hot exhaust to blow against other components or materials. If hot exhaust gas contacts other components or materials, it can increase the risk of a fire. Spartan will notify owners, and dealers will replace the flexible exhaust tube with an improved one, free of charge. The recall is expected to begin in October 2015. Owners may contact Spartan customer service at 1-517-543-6400. Spartan's number for this recall is 15020.

**15V-554**

Volvo Cars of North America, LLC. (Volvo) is recalling certain model year 2016 Volvo S60, V60, V60CC, XC60, XC70, and S80 vehicles manufactured April 8, 2015 to August 19, 2015. In certain driving conditions when using the automatic engine stop/start function, the starter motor fuse may blow, preventing the car from restarting when necessary. If the vehicle is unexpectedly unable to be started in the middle of traffic, such as when stopped at an intersection, there is an increased risk of a crash. Volvo will notify owners, and dealers will replace the existing starter motor fuse with a higher amperage fuse, free of charge. The recall is expected to begin during October 2015. Owners may contact Volvo customer service at 1-800-458-1552 or by visiting <http://volvo.custhelp.com>. Volvo's number for this recall is R39574.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING SEPTEMBER 2015**

*Published October 14, 2015*

**15V-555**

Eldorado National-Kansas (Eldorado) is recalling certain model year 2015 Amerivan vehicles built on Toyota Sienna chassis manufactured July 1, 2015, to August 20, 2015. In the affected vehicles, the Toyota seat belt tab may not properly latch to the Amerivan's Qstem seat belt buckle assembly. As a result, the seat belt may unlatch unexpectedly when pulled on. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 210, "Seat Belt Assembly Anchorage." If the seat belt unlatches, the occupant would not be properly restrained and is at an increased risk of injury in the event of a crash. Eldorado will notify owners, and dealers will install a new Q-stem assembly with an alternate buckle assembly, free of charge. The recall began on October 7, 2015. Owners may contact Eldorado customer service at 1-785-827-1033.

**15V-556**

Fontaine Trailer Company (Fontaine) is recalling certain model year 2015 Traverse HT trailers manufactured March 4, 2015, to August 6, 2015. The affected trailers have a suspension member that may separate from the trailer as a result of cracks in the trailer. If the suspension member separates from the trailer, there would be an increased risk of a crash. Fontaine has notified owners and has installed additional reinforcing pieces, free of charge. The recall began September 2, 2015. Owners may contact Fontaine customer service at 1-205-485-1375.

**15V-557**

General Motors LLC (GM) is recalling certain model year 2013-2016 Cadillac ATS sedan vehicles manufactured April 23, 2012, to September 2, 2015. In the affected vehicles, the coil antenna module that powers the rear defogger system may generate excessive heat due to excessive cycling or continuous operation. If the coil antenna generates excessive heat, there is an increased risk of a fire. GM will notify owners, and dealers will update the Electronic Climate Control module to remove the automatic rear defogger "on" function, free of charge. The recall is expected to begin on October 16, 2015. Owners may contact Cadillac customer service at 1-800-458-8006. GM's number for this recall is 15299.

**15V-558**

Honda (American Honda Motor Co.) is recalling certain model year 2015 Fit vehicles manufactured December 6, 2013, to August 28, 2014. The affected vehicles may experience damage to the wires inside the Plug Top Ignition Coils (PTC) due to improper protection against electrical noise. If the wires become damaged, the coil may overheat and cause the engine to stall, increasing the risk of a crash. Honda will notify owners, and dealers will replace the Plug Top Ignition Coils with new design, free of charge. The recall is expected to begin during October 2015. Owners may contact Honda Automobile Customer Service at 1-888-234-2138. Honda's number for this recall is JT9.

**15V-559**

Ferrara Fire Apparatus, Inc. (Ferrara) is recalling certain model year 2013-2014 Igniter and Inferno firetrucks manufactured October 16, 2013, to December 10, 2014. The affected vehicles are built with independent front suspensions that may have loose ball joints. A loose ball joint may separate from the steering linkage resulting in a

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING SEPTEMBER 2015**

*Published October 14, 2015*

loss of steering control and an increased risk of a crash. Ferrara will notify owners, and dealers will inspect the firetrucks and replace the affected suspension components, as necessary, free of charge. The recall is expected to begin in October 2015. Owners may contact Ferrara customer service at 1-225-567-7100 ext 3011.

**15V-560**

Keystone RV Company (Keystone) is recalling certain model year 2008-2009 Big Sky, Challenger, Everest, Fuzion, Montana, and Raptor travel trailers and fifth wheels equipped with an IOTA ITS-50R transfer switch. These transfer switches, used in vehicles wired to be powered by a generator, may fail when exposed to elevated electrical loads and used in higher ambient temperatures. As the transfer switch fails, it may overheat, increasing the risk of a fire. Keystone will notify owners, and dealers will replace the IOTA ITS-50R transfer switch with a different brand transfer switch, free of charge. The recall began on October 8, 2015. Owners may contact Keystone customer service by calling 1-866-425-4369. Keystone's number for this recall is 15-234.

**15V-561**

New Flyer Industries Ltd. (New Flyer) is recalling certain model year 2014-2015 New Flyer XDE40 and XD40, 2014 XD60, XN35 and XN60, 2015 XDE35, and 2013-2015 XN40 transit buses. The affected vehicles may be equipped with an improperly torqued front axle center link retaining clamp on the tie rod. As a result, the tie rod may disconnect, causing a loss of steering. A loss of steering increases the risk of a crash. New Flyer will notify owners, and dealers will inspect the vehicles to verify that the center link retaining clamp is properly torqued. Any components displaying play or movement will be replaced. These repairs will be performed free of charge. The recall began on October 1, 2015. Owners may contact New Flyer customer service at 1-204-224-6706. New Flyer's number for this recall is R15-015.

**15V-562**

Honda (American Honda Motor Co.) is recalling certain model year 2003 Odyssey vehicles manufactured August 28, 2002, to August 30, 2002. The affected vehicles were manufactured with air bag modules, preventing them from meeting the advanced air bag safety standards. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 208, "Occupant Crash Protection." Air bags that do not meet the safety requirements increase the risk of occupant injury in the event of a crash. Honda will notify owners, dealers will replace the passenger frontal air bag module, free of charge. The recall is expected to begin during October 2015. Owners may contact Honda customer service at 1-888-234-2138. Honda's number for this recall is JU0.

**15V-563**

Daimler Trucks North America LLC (DTNA) is recalling certain model year 2006-2015 Thomas Built Buses Saf-T-Liner HDX, Saf-T-Liner EF, Saf-T-Liner EFX, and Minotour DRW transit buses manufactured January 3, 2006, to August 1, 2014, and equipped with certain Ricon model S2005, S2010, S5005, S5010, S5505, S5510 wheelchair lifts. The affected lifts are equipped with folding link arms that may have pivot holes that are too big, allowing the bearings to move out of position. If the bearings move out of position, the stowed platform may have excessive movement resulting in failure of the platform mounting. This failure could cause the wheelchair lift platform to fall out of the vehicle when the doors are opened, increasing the risk of injury for the lift operator. DTNA will notify owners, and dealers will inspect the link arms for damage or for displaced bearings.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING SEPTEMBER 2015**

*Published October 14, 2015*

The platform will be inspected for cracks. Any damaged parts will be replaced, free of charge. The recall is expected to begin November 2, 2015. Owners may contact DTNA customer service at 1-800-745-8000. DTNA's number for this recall is FL-686.

**15V-564**

Daimler Trucks North America LLC (DTNA) is recalling certain model year 2006-2015 Thomas Built Buses FS-65, Saf-T-Liner C2, Saf-T-Liner EF, Saf-T-Liner EFX, Saf-T-Liner HDX, and Minotour DRW school buses manufactured January 3, 2006, to August 1, 2014, and equipped with certain Ricon model S2005, S2010, S5005, S5010, S5505, S5510 wheelchair lifts. The affected lifts are equipped with folding link arms that may have pivot holes that are too big, allowing the bearings to move out of position. If the bearings move out of position, the stowed platform may have excessive movement resulting in failure of the platform mounting. This failure could cause the wheel chair lift platform to fall out of the vehicle when the doors are opened, increasing the risk of injury for the lift operator. DTNA will notify owners, and dealers will inspect the link arms for damage or for displaced bearings. The platform will be inspected for cracks. Any damaged parts will be replaced, free of charge. The recall is expected to begin November 2, 2015. Owners may contact DTNA customer service at 1-800-745-8000. DTNA's number for this recall is FL-686.

**15V-565**

Hyundai Motor America (Hyundai) is recalling certain model year 2009-2011 Hyundai Accent vehicles manufactured March 1, 2009, to February 11, 2011. In the affected vehicles, the brake light switch may malfunction. A malfunctioning brake light switch may cause the brake lights to not illuminate when the brake pedal is depressed or may cause an inability to deactivate the cruise control by depressing the brake pedal. Additionally, a malfunctioning brake light switch may also prevent the shifter from being moved out of the PARK position. Failure to illuminate the brake lights during braking or the inability to disengage the cruise control could increase the risk of a crash. Hyundai will notify owners, and dealers will replace the brake switch, free of charge. The recall is expected to begin November 2, 2015. Owners may contact Hyundai's customer service at 1-855-671-3059 or by visiting [www.HyundaiUSA.com/Campaign131](http://www.HyundaiUSA.com/Campaign131). Hyundai's number for this recall is 131. This recall is an expansion of 13V-113.

**15V-566**

Entegra Coach (Entegra) is recalling certain model year 2010 Anthem and 2012-2014 Cornerstone motorhomes manufactured October 5, 2009, to June 18, 2013 and built on a Spartan Motors chassis. In the affected vehicles, the flexible exhaust tube may tear allowing hot exhaust to blow against other components or materials. If hot exhaust gas contacts other components or materials, it can increase the risk of a fire. Entegra will notify owners and Spartan Motors dealers will replace the flexible exhaust tube with an improved one, free of charge. The manufacturer has not yet provided a notification schedule. Entegra owners may contact Spartan customer service at 1-800-543-4277.

**15V-567**

Hyundai Motor America (Hyundai) is recalling certain model year 2011-2012 Sonata vehicles manufactured December 11, 2009, to April 12, 2012 at Hyundai Motor Manufacturing Alabama and equipped with either a 2.0 liter or 2.4 liter Gasoline Direct injection engine. In the affected vehicles, metallic debris may not have been

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING SEPTEMBER 2015**

*Published October 14, 2015*

fully removed during manufacturing of the engine crankshaft. If the debris was not completely removed, oil flow may be restricted through the connecting rod bearings, causing connecting rod damage. A worn connecting rod bearing will produce a metallic, cyclic knocking noise from the engine and possible engine failure. Engine failure would result in a vehicle stall, increasing the risk of a crash. Hyundai will notify owners, and dealers will inspect the vehicles and replace the engine assembly, as necessary, free of charge. Additionally, Hyundai Motor America will increase the warranty for the engine sub-assembly (short block) to 10 years/120,000 miles for both original and subsequent owners of 2011 and 2012 Sonatas manufactured at Hyundai Motor Manufacturing Alabama equipped with 2.0 liter and 2.4 liter Gasoline Direct injection engines. An interim notification will be mailed by November 2, 2015. A second notification will be mailed when parts are available. Owners may contact Hyundai customer service at 1-855-671-3059 or by visiting [www.HyundaiUSA.com/Campaign132](http://www.HyundaiUSA.com/Campaign132). Hyundai's number for this recall is 132.

**15V-568**

Jaguar Land Rover North America, LCC (Jaguar) is recalling one 2016 Jaguar F-Type vehicle manufactured February 3, 2015. The affected vehicle has the power steering system still set in the supplier's factory operating mode. In this condition, in the event of a steering system malfunction, the vehicle can experience additional steering inputs from the electric power steering system. If the vehicle is in motion when this occurs, the driver may unexpectedly lose the ability to control the vehicle, increasing the risk of a crash. Jaguar will notify the owner, and a dealer will either correct the steering system software or replace the steering rack, free of charge. The recall is expected to begin October 31, 2015. Owners may contact Jaguar customer service at 1-800-452-4827. Jaguar's number for this recall is J055.

**15V-569**

Triple E Recreational Vehicles (Triple E) is recalling certain model year 2015-2016 Unity motorhomes, models U24MB, U24CB, U24IB and U24TB, manufactured from September 2, 2014, through September 9, 2015. In the affected vehicles, the battery compartment under the entrance step was not properly sealed to prevent gases from the battery from entering the vehicle. Explosive gases from the battery may enter the motorhome, increasing the risk of a fire. Triple E will notify owners, and dealers will seal the battery compartment to prevent gases from entering the motorhome, free of charge. The recall is expected to begin in October 2015. Owners may contact Triple E customer service at 1-877-992-9906. Triple E's number for this recall is CA#8132-1.

**15V-570**

Jaguar Land Rover North America, LLC (Land Rover) is recalling certain model year 2014 Land Rover Range Rover Sport vehicles manufactured December 16, 2013, to April 15, 2014. In the affected vehicles, the owner's handbook information may incorrectly describe the functionality of the Air Bag Status Indicator Lamp. As such, these vehicles fail to comply with requirements of the Federal Motor Vehicle Safety Standard (FMVSS) number 208, "Occupant Crash Protection." An occupant that does not correctly understand the air bag functionality, may be at an increased risk of injury in a crash. Land Rover will notify owners and will send out an owner's handbook supplement to all affected owners, free of charge. The recall began on October 8, 2015. Owners may call Land Rover customer service at 1-800-637-6837. Land Rover's recall number is P071.

**15V-571**



**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING SEPTEMBER 2015**

*Published October 14, 2015*

McNeilus Truck & Manufacturing, Inc., (McNeilus) is recalling certain model year 2013-2015 McNeilus Bridge Master Mixer, Standard Mixer, Sliding Trailer Mixer, Standard Rear Loader, Rear Loader w/3.5 YD HD Tail, Zero Radius Automated, Auto Reach, Atlantic Front Loader, Split Body Rear Loader, Rear Loader w/Tag Axle, Metro Pak Rear Loader, XXC Rear Loader, and Pacific Front Loader vehicles manufactured August 1, 2013, to May 14, 2015. These concrete mixers and refuse trucks are equipped with certain Kidde plastic valve disposable handheld fire extinguishers that may not properly discharge when the lever is pressed. In the event of a fire, if the fire extinguisher does not work correctly, there is an increased risk of injury. McNeilus will notify owners, and advise them to follow the provided instructions from Kidde to inspect their fire extinguishers. Kidde will replace the fire extinguishers as necessary, free of charge. The recall is expected to begin in October 2015. Owners may contact McNeilus customer service at 1-888-686-7278. McNeilus' number for this recall is Kidde: CPSC 15-079.

**15V-572**

Nissan (Nissan North America, Inc.) is recalling certain model year 2007-2012 Nissan Versa vehicles manufactured May 8, 2006, to November 12, 2012, that were sold or ever registered in the District of Columbia, Connecticut, Delaware, Iowa, Illinois, Indiana, Kentucky, Massachusetts, Maine, Maryland, Michigan, Minnesota, Missouri, New Hampshire, New Jersey, New York, Ohio, Pennsylvania, Rhode Island, Vermont, Virginia, West Virginia and Wisconsin. Road salt may corrode the front coil springs, possibly resulting in the coil springs fracturing. If a front coil spring fractures, it may contact the tire, possibly puncturing it, increasing the risk of a crash. Nissan will notify owners, and dealers will replace both front coil springs, free of charge. The recall is expected to begin by mid-November 2015. Owners may contact Nissan customer service at 1-800-647-7261.

**15V-573**

Honda (American Honda Motor Co.) is recalling certain model year 2014-2015 Civic vehicles manufactured January 16, 2014, to November 6, 2014 and 2015 Fit vehicles manufactured March 12, 2014, to May 12, 2015. The software settings that control the transmission operation may result in damage to the transmission drive pulley shaft. If the transmission drive pulley shaft is damaged, it may break, and the vehicle may lose acceleration or the front wheels may lock up while driving, increasing the risk of a crash. Honda will notify owners, and dealers will update the software for the transmission, free of charge. The recall is expected to begin October 16, 2015. Owners may contact Honda customer service at 1-888-234-2138. Honda's numbers for this recall are JU2 (Civic) and JU3(Fit).

**15V-574**

Vermeer Manufacturing Company (Vermeer) is recalling certain model year 2008-2016 Vermeer BC1000XL, 2013-2016 BC700XL, 2012-2016 BC900XL, 2009-2016 BC1200XL, 2003-2016 BC1800XL, 2005-2014 BC600XL, 2005-2016 SC802 and 2005-2013 SC602 Brush Chippers and Stump Cutters. These models have LED side markers lights that do not have reflectors built into the lenses, reducing the visibility of the vehicle. As such, these vehicles fail to comply with the requirements of the Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." The absence of reflectors could reduce the ability for others to see the vehicle, increasing the risk of a crash. Vermeer will notify owners, and will supply reflective decals to be installed on the trailer sides, free of charge. The manufacturer has not yet

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING SEPTEMBER 2015**

*Published October 14, 2015*

provided a notification schedule. Owners may contact Vermeer customer service at 1-800-829-0051 or by email at [productsafety@vermeer.com](mailto:productsafety@vermeer.com).

**15V-575**

Forest River, Inc., (Forest River) is recalling certain 2011-2016 Coachmen Pursuit, Mirada, and Encounter motorhomes manufactured from March 1, 2011, through September 11, 2015. In the affected vehicles, the trailer hitch attaching bolts and nuts may not have been properly tightened, allowing the hitch to detach during use. If the trailer hitch partially or fully detaches from the motorhome while it is towing a vehicle, a loss of vehicle control could occur, increasing the risk of a crash. Forest River will notify owners, and dealers will install a new fastener kit, free of charge. The recall began on October 9, 2015. Owners West of the Mississippi River may contact Forest River customer service at 1-574-825-8317. Owners East of the Mississippi River may contact Forest River customer service at 1-574-825-8305. Forest River's campaign number for this recall is 310-09112015-0086.

**15V-576**

Toyota Motor Engineering & Manufacturing (Toyota) is recalling certain model year 2009-2012 RAV4 vehicles manufactured October 27, 2008, to December 19, 2012 and 2012-2014 RAV4 EV vehicles manufactured July 24, 2012, to August 29, 2014. In the affected vehicles, water may drip onto the joint that connects the wiper linkage to the wiper motor. Over time, the dripping water may cause corrosion and wear at the joint, potentially resulting in the separation of the wiper linkage. Once this occurs, the wipers would not function, reducing driver visibility and increasing the risk of a crash. Toyota will notify owners, and dealers will replace the water diverter channel. In addition, a new wiper linkage with a wiper motor crank arm will be installed. The wiper linkage will have a protective cover over the wiper linkage joint to minimize water splash and a retainer ring to prevent the wiper arm from separating from the wiper motor. The recall is expected to begin by November 16, 2015. Owners may contact Toyota's customer service number at 1-800-331-4331.

**15V-577**

Triple E Recreational Vehicles (Triple E) is recalling certain model year 2016 Libero L24CB and Serenity S24CB recreational vehicles manufactured July 17, 2015, to September 9, 2015. In the affected vehicles, there is the possibility of an electrical shock when the window valance is installed on the driver side rear of vehicle. The possibility of an electrical shock increases the risk of injury. Triple E will notify owners, and dealers will reroute the wiring to the overhead cabinet near where the valance is to be installed, free of charge. The recall is expected to begin in October 2015. Owners may contact Triple E customer service at 1-877-992-9906. Triple E's number for this recall is CA#8135-1.

**15V-578**

Mitsubishi Motors North America, Inc. (Mitsubishi) is recalling certain model year 2011 Outlander Sport vehicles manufactured on December 3, 2010. The affected vehicles are equipped with incorrect certification labels that were installed during manufacturing. The incorrect labels do not have the correct vehicle identification numbers (VIN) printed on the label. As such, these vehicles fail to comply with the requirements of 49 CFR Part 567, "Certification." A vehicle must comply with all regulatory requirements to ensure that it is safe. Mitsubishi will notify owners, and dealers will install corrected certification labels, free of charge. The manufacturer has not

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING SEPTEMBER 2015**

*Published October 14, 2015*

yet provided a notification schedule. Owners may contact Mitsubishi customer service at 1-888-648-7820. Mitsubishi's number for this recall is SR-15-010.

**15V-579**

Motor Coach Industries, Inc. (MCI) is recalling certain model year 2015 D4000 vehicles manufactured June 8, 2015, to July 20, 2015, D4005 vehicles manufactured March 18, 2015, to July 10, 2015, D4500 vehicles manufactured December 19, 2014, to July 20, 2015, and D4505 vehicles manufactured December 18, 2014, to July 15, 2015. In the affected vehicles, the fuse block assembly for the heating, ventilation and air conditioning motors in the battery compartment may have been assembled incorrectly. The incorrectly assembled fuse block may not protect the circuit and the connections may arc, increasing the risk of a fire. MCI will notify owners, and dealers will replace the fuse block assembly, free of charge. The recall is expected to begin in October 2015. Owners may contact MCI customer service at 1-800-241-2947.

**15V-580**

Winnebago Industries, Inc. (Winnebago) is recalling certain model year 2015-2016 Winnebago Sightseer and Itasca Sunova motorhomes with a D35G floorplan, manufactured March 19, 2015, to July 15, 2015. In the affected vehicles, the wiring harness behind the panel board may be pinched or damaged when the left rear slideout room is retracted due to insufficient clearance. A damaged or pinched wiring harness increases the risk of a fire. Winnebago will notify owners, and dealers will inspect the wiring harness for damage, repairing it as necessary. Additionally, the harness attachment point will be relocated to provide the harness extra clearance. These repairs will be performed free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Winnebago customer service number at 1-641-585-3535.

**15V-581**

DS Corp DBA Crossroads RV (Crossroads) is recalling certain model year 2015-2016 Sunset Trail trailers manufactured November 14, 2014, to September 1, 2015. The affected trailers are equipped with kitchen ranges that were installed without a panel to isolate the range from air movement. Without the required isolation panel, a back draft may occur from the top burner increasing the risk of a potential explosion, fire or carbon monoxide build up. Crossroads has notified owners, and dealers will install the panel to prevent air movement affecting the kitchen range, free of charge. The recall began on September 25, 2015. Owners may contact Crossroads at 1-855-226-7496 or by email at [service@crossroadsrv.com](mailto:service@crossroadsrv.com). Crossroads' number for this recall is 38.

**15V-582**

KYMCO (KYMCO USA) is recalling certain model year 2015 Super 8-50 X and 2015 Super 8-150 X road scooters manufactured February 6, 2015, to September 15, 2015. In the affected models, the front hydraulic brake hose may be improperly routed, and as a result, the brake hose may contact the front tire when the front suspension is compressed. If the hydraulic brake hose contacts the tire, the hose may rupture, resulting in a loss of front brakes and increasing the risk of a crash. KYMCO will notify owners, and dealers will replace the two brake hose securing brackets, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact KYMCO customer service at 1-888-235-3417.

**15V-583**

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING SEPTEMBER 2015**

*Published October 14, 2015*

Vermeer Manufacturing Company (Vermeer) is recalling certain model year 2012-2015 Vermeer HG4000 horizontal grinder trailers manufactured June 28, 2012, to July 10, 2015. In the affected units, the antilock braking system (ABS) brakes may be improperly connected. Additionally, the brake chamber mounting may fail. In the event of severe braking, the the ABS may not function correctly allowing the trailer brakes to lock up, increasing the risk of a crash. Vermeer will notify owners, and dealers will correct the ABS installation and reinforce the brake chamber mounts, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Vermeer customer service at 1-800-829-0051.

**15V-584**

Newmar Corporation (Newmar) is recalling certain model year 2010 Dutch Star motorhomes manufactured May 13, 2009, to April 14, 2010, 2010 Dutch Aire motorhomes manufactured May 12, 2009, to February 8, 2010, and 2012-2013 King Aire motorhomes manufactured March 22, 2011, to May 17, 2013. The affected vehicles are built on a Spartan Motors chassis and have a flexible exhaust tube that may tear allowing hot exhaust to blow against other components or materials. If hot exhaust gas contacts other components or materials, it can increase the risk of a fire. Newmar will notify owners, and Spartan dealers will install a new exhaust tube, free of charge. The recall began on October 8, 2015. Owners may contact Newmar customer service at 1-800-731-8300 or Spartan customer service at 1-800-543-4277. Newmar's number for this recall is 15V-554.

**15V-585**

Daimler Trucks North America LLC (DTNA) is recalling certain model year 2014-2016 Freightliner Business Class M2, 108SD, and 114SD trucks manufactured April 30, 2013, to September 14, 2015. Due to incorrect positioning, the rear disk brake calipers may contact the spring suspension reducing rear brake performance. A reduction in braking performance can increase the risk of a crash. DTNA will notify owners, and dealers will correct the orientation of the rear brake calipers, free of charge. The recall is expected to begin November 13, 2015. Owners may contact DTNA customer service at 1-800-745-8000. DTNA's number for this recall is FL-688.

**15V-586**

Suzuki Motor of America, Inc. (Suzuki) is recalling certain model year 2012-2103 Suzuki SX4 vehicles manufactured September 3, 2011, to April 5, 2013. In the affected vehicles, insufficient clearance between the power steering pump body and the power steering fluid control valve may cause improper movement of the valve, and as a result, the power steering pump may seize. A seizure of the power steering pump would cause a loss of power steering assist, requiring extra steering effort at lower speeds, increasing the risk of a vehicle crash. Suzuki will notify owners, and dealers will replace the power steering pump, free of charge. The recall began on October 9, 2015. Owners may contact Suzuki's customer service number at 1-800-934-0934. Suzuki's number for this recall is VS.

**15V-587**

Stealth Enterprises LLC DBA Stealth Trailers (Stealth Trailers) is recalling certain model year 2016 Qualitec Gooseneck and Yukon, Stealth Super-Lite, Predator, Intruder, Car Hauler Express, Gooseneck, Liberty, Liberty Limited Edition, Phantom I, Prowler, Titan, Titan SE, Viper, and Coldshore trailers manufactured March 9, 2015, to March 23, 2015. In the affected trailers, the studs that are used to attach the wheels to the axle hubs

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING SEPTEMBER 2015**

*Published October 14, 2015*

may break. If the wheel studs break, the wheel could detach from the vehicle, increasing the risk of a crash. Stealth Trailers will notify owners, and dealers will replace any affected wheel hub, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Stealth Trailers customer service at 1-574-848-5900.

**15V-588**

Forest River Inc. (Forest) is recalling certain model year 2009-2016 Forest River Cherokee and Vengeance recreational trailers manufactured May 16, 2008, to September 14, 2015. The wiring harness for the trailer's lights, electric brakes, battery charging and many of the interior 12V fixtures may have an insufficient ground wire. With an insufficient ground wire, the wiring harness may overheat, increasing the risk of fire. Additionally, the ground wire failure would result in the loss of the trailer's external lights and electric brakes, increasing the risk of a crash. Forest River will notify owners, and dealers will inspect the trailer wiring harnesses, and upgrade the ground wires, as necessary, free of charge. The recall is expected to begin November 18, 2015. Owners may contact Forest River's customer service number at 1-260-593-4005. Forest River's recall number is 17B-0918-2015-0090.

**15V-589**

Chrysler (FCA US LLC) is recalling certain model year 2015 Fiat 500L vehicles manufactured April 23, 2015, to May 10, 2015. The affected vehicles may be equipped with a passenger frontal air bag that was not folded properly during the assembly process. As a result, the air bag may not deploy as designed. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 208, "Occupant Crash Protection." In the event of a crash, if the air bag does not inflate as designed, the front seat occupant is at an increased risk of injury. Fiat will notify owners, and dealers will replace the passenger frontal air bag module, free of charge. The recall is expected to begin November 6, 2015. Owners may contact Fiat customer service at 1-888-242-6342. Chrysler's number for this recall is R54.

**15V-590**

Blue Bird Body Company (Blue Bird) is recalling certain model year 2016 Vision school buses manufactured on August 16, 2015. In the affected vehicles, the Engine Control Module (ECM) may short circuit, causing the engine to stall without warning. An engine that stalls without warning increases the risk of a crash. Blue Bird will notify owners, and Cummins dealers will replace the ECM, free of charge. The recall is expected to begin October 22, 2015. Owners may contact Blue Bird's customer service number at 1-478-822-2242. Blue Bird's recall number is R15YG-SB.

**15V-591**

Chrysler (FCA US LLC) is recalling certain model year 2016 Ram 2500, 3500, 3500 Cab Chassis and 4500/5500 Cab Chassis trucks manufactured July 31, 2015, to August 13, 2015 and equipped with a 6.7L Cummins Diesel engine. In the affected vehicles, the Engine Control Module (ECM) may short circuit, causing the engine to stall without warning. An engine that stalls without warning increases the risk of a crash. Chrysler will notify owners, and dealers will replace the ECM, free of charge. The recall is expected to begin November 6, 2015. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is R52.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING SEPTEMBER 2015**

*Published October 14, 2015*

**15V-592**

Yamaha Motor Corporation, USA (Yamaha) is recalling certain model year 2015 YZFR3 motorcycles manufactured January 1, 2015, to August 31, 2015. The affected motorcycles may have an incorrectly manufactured upper triple clamp (handle crown) that may crack while riding. If the upper triple clamp fractures, a loss of steering control may result, increasing the risk of a crash. Yamaha will notify customers, and dealers will replace the upper triple clamp with a new one, free of charge. The recall is expected to begin in October 2015. Owners may contact Yamaha's customer service at 1-800-962-7926. Yamaha's recall number is 990099.

**15V-593**

Mitsubishi Motors North America, Inc. (Mitsubishi) is recalling certain model year 2014 Mitsubishi Mirage vehicles manufactured July 27, 2013, to November 20, 2013, and 2012 Mitsubishi i-MiEV vehicles manufactured October 28, 2011, to September 7, 2012. Due to an increased resistance in the impact sensor for the air bag system, in the event of a crash necessitating deployment of the frontal, side and/or curtain air bags when the SRS warning is illuminated, the frontal air bag may have a delayed deployment and/or the side and curtain air bag may not deploy at all. In the event of a crash, an air bag that does not deploy or deploys late, increases the risk of occupant injury. Mitsubishi will notify owners, and dealers will replace the affected impact sensors, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Mitsubishi customer service at 1-888-648-7820. Mitsubishi's number for this recall is SR-15-011.

**15V-594**

Chrysler Group LLC (Chrysler) is recalling certain model year 2016 Chrysler Town and Country and Dodge Grand Caravan vehicles manufactured August 19, 2015 to August 27, 2015. In the affected vehicles, the bolts that attach the hood striker may loosen and, as a result, the hood may open unexpectedly while driving. If the hood opens while driving, the driver's vision may be obstructed, increasing the risk of a crash. Chrysler will notify owners, and dealers will install new hood striker bolts with the proper torque, free of charge. The recall is expected to begin November 6, 2015. Owners may contact Chrysler's customer service at 1-800-853-1403. Chrysler's recall number is R53.

**15V-595**

Forest River, Inc. (Forest River) is recalling certain model year 2011-2016 Glaval Titan II Low Floor diesel transit buses manufactured October 5, 2011, to September 11, 2015. During installation of the floor decking, a screw may have pierced the exhaust tube. If the exhaust tube was pierced and the screw is removed, exhaust fumes may enter the passenger area. Additionally, there is an increased risk of a fire. Forest River will notify owners, and dealers will remove and inspect the exhaust system, sealing or replacing it, as necessary, free of charge. The recall began on October 7, 2015. Owners may contact Forest River customer service at 1-800-445-2825 ext 167. Forest River's number for this recall is 35-20222015-0091.

**15V-596**

Paccar Incorporated (Paccar) is recalling certain model year 2016 Kenworth T370, T660, T680, T800, T880, and W900 vehicles manufactured July 31, 2015, to August 12, 2015, and 2016 Peterbilt 337, 348, 365, 367, 382, 386, 389, 567, 579, and 587 vehicles manufactured August 4, 2015, to August 12, 2015. In the affected

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING SEPTEMBER 2015**

*Published October 14, 2015*

vehicles, the Engine Control Module (ECM) may short circuit, causing the engine to stall without warning. An engine that stalls without warning increases the risk of a crash. PACCAR will notify owners, and dealers will replace the defective engine control modules, free of charge. The recall is expected to begin by October 31, 2015. Owners may contact Kenworth customer service at 1-425-828-5000 or Peterbilt customer service at 1-940-591-4000. Paccar's numbers for this recall are 15KWM (Kenworth) and 915-L (Peterbilt).

**15V-597**

E-One Incorporated (E-One) is recalling certain model year 2013-2014 Typhoon, Cyclone II, and Quest emergency vehicles manufactured August 2, 2013, to December 16, 2014. The affected vehicles have front independent suspension assemblies that may have loose ball joints which could separate causing a loss of steering control. A loss of steering control increases the risk of a crash. E-One will notify owners, and dealers will inspect and repair the suspension assemblies, as necessary, free of charge. The recall is expected to begin October 20, 2015. Owners may contact E-One customer service at 1-800-627-5050.

**15V-598**

General Motors LLC (GM) is recalling certain model year 2006-2007 Buick Rainier, Chevrolet Trailblazer and GMC Envoy vehicles, and 2006 GMC Envoy XL and Chevrolet Trailblazer EXT vehicles. Fluid may enter into the driver's door master power window switch module, causing corrosion that could result in a short in the circuit board, causing window switches to become inoperative. Previously, the affected vehicles may have had their master power window switch module treated with a protective coating, instead of having it replaced. The protective coating may not eliminate the risk that the circuit board could short and result in a fire, even while the vehicle is unattended. GM will notify owners, and dealers will install a new driver's door switch module, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Buick customer service at 1-800-521-7300, Chevrolet customer service at 1-800-222-1020, and GMC customer service at 1-800-462-8782. GM's number for this recall is 15700.

**15V-599**

Jaguar Land Rover North America, LLC (Land Rover) is recalling certain model year 2015 Range Rover and Range Rover Sport vehicles manufactured June 2, 2015, to June 11, 2015. In the affected vehicles, the second row seat back may not latch properly, especially in the center section. In the event of a crash, if the seat back is not properly latched, the seat belt may not properly restrain the occupant, increasing their risk of injury. Land Rover will notify owners, and dealers will inspect the second row seat mechanism, replacing it as required, free of charge. The recall is expected to begin November 13, 2015. Owners may contact Land Rover's customer service at 1-800-637-6837. Land Rover's number for this recall is P072.

**15V-600**

Honda (American Honda Motor Co.) is recalling certain model year 2014-2015 Honda Accord Hybrid vehicles manufactured August 29, 2013, to May 30, 2015. Electrical interference may cause the hybrid system to switch into fail-safe mode, disabling the gasoline engine, limiting the vehicle's speed to 40 miles per hour and functioning only on battery power. Once the battery is discharged, the vehicle will stall. A vehicle stall increases the risk of a crash. Honda will notify owners, and dealers will update the hybrid system software, free of charge. The recall is expected to begin November 6, 2015. Owners may contact Honda customer service at 1-888-234-2138.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING SEPTEMBER 2015**

*Published October 14, 2015*

Honda's number for this recall is JT7.

**15V-602**

Spartan Motors USA (Spartan) is recalling certain model year 2014 MetroStar emergency vehicles manufactured January 5, 2015, to March 9, 2015, and equipped with a fire pump and a Hale Products K-Gearbox. The K-Gearbox transmission in the affected vehicles may unexpectedly shift to neutral while traveling to or from a fire. If the vehicle unexpectedly shifts to neutral on the way to attend a fire, the delay may hinder fire fighting efforts. Additionally, the loss of drive may increase the risk of a crash. Spartan will notify owners, and dealers will remove the gearbox, send it to Hale for repairs and then reinstall it once it has been fixed. These repairs will be performed free of charge. The recall is expected to begin in October 2015. Owners may contact Spartan customer service at 1-800-867-6478. Spartan's number for this recall is 15021.

**15V-603**

Volvo Bus Corporation (Volvo) is recalling certain model year 2009-2013 Volvo 9700 buses manufactured August 28, 2008, to December 21, 2012. In the affected vehicles, the exhaust clamp at the turbocharger may fail, allowing hot exhaust gas to contact materials in the engine compartment. If hot exhaust gas contacts other components or materials, it can increase the risk of a fire. Volvo will notify owners, and dealers will replace the exhaust clamp, free of charge. The recall is expected to begin November 25, 2015. Owners may contact Volvo Bus at 1-866-870-2046. Volvo's number for this recall is SR15-85.

**15V-604**

Ford Motor Company (Ford) is recalling certain model year 2015 Ford Taurus, Lincoln MKS, and 2016 Ford Explorer vehicles manufactured on July 24, 2015. During vehicle production, the fuel tank attachment bolts may not have been properly tightened. As a result, the fuel tank straps may fracture and the fuel tank could separate from the vehicle. If the fuel tank separates from the vehicle, a fuel leak may occur, increasing the risk of a fire. Ford will notify owners, and dealers will tighten the fuel tank attachment bolts, as necessary, free of charge. The recall is expected to begin October 19, 2015. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 15S26.

**15V-605**

Ford Motor Company (Ford) is recalling certain model year 2001-2008 Ford Escape and Mercury Mariner vehicles manufactured March 31, 2001, to September 1, 2009. The affected vehicles are equipped with either a 2.3L or 3.0L engine and have had their CD4E transmission replaced with remanufactured one that was rebuilt between June 11, 2015 through July 15, 2015. These service repair part transmissions have a shift lever bolt that may not be properly tightened. As a result, the shift control lever could disengage from the transmission without warning. If the shift lever disengages from the transmission, a driver may be unable to shift gear positions and the indicated shift position may not represent the gear position the vehicle is in. Should a disengagement occur while the vehicle is being driven, when the driver goes to stop and park the vehicle, the gear selection indicator may show that the transmission is in the "PARK" position, but the vehicle transmission may not actually be in the "PARK" gear position. If the vehicle is not in the "PARK" position there is a risk the vehicle will roll away as the driver and other occupants exit the vehicle or anytime thereafter. A vehicle rollaway increases the risk of injury to exiting occupants and bystanders. Ford will notify owners, and dealers will inspect



**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING SEPTEMBER 2015**

*Published October 14, 2015*

the transmissions and either tighten the manual shift lever bolt or replace the manual shift lever assembly. These repairs will be performed free of charge. The recall is expected to begin October 19, 2015. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 15S28.

**15V-606**

Navistar, Inc. (Navistar) is recalling certain model year 2011-2014 International ProStar trucks manufactured May 18, 2010, to April 5, 2013, 2012-2014 International LoneStar trucks manufactured September 7, 2011, to March 25, 2013, and 2011-2013 International TranStar trucks manufactured October 18, 2010, to February 20, 2013. The affected trucks are equipped with Fontaine Ultra LT Fifth Wheel connectors, which, due to cumulative damage to the fifth wheel and its locking mechanism, have a locking mechanism that may fail to operate or to properly engage. If the fifth wheel and locking mechanism are sufficiently damaged, the locking mechanism may fail to operate as intended and the trailer may unexpectedly detach from the tractor, increasing the risk of a crash. Navistar will notify owners, and Fontaine dealers will replace the fifth wheel with an Ultra NT model fifth wheel, free of charge. The recall is expected to begin in October 2015. Owners may contact Navistar customer service at 1-800-448-7825, or Fontaine customer service at 1-844-597-7393.

**15V-607**

Ford Motor Company (Ford) is recalling certain model year 1998-2003 Windstar vehicles manufactured September 2, 1997, to July 3, 2003. The affected vehicles were previously remedied to safeguard against the rear axle cracking from corrosion, however, the remedy brackets may have been misinstalled. The incorrect bracket installations may limit the effectiveness of the service repair for NHTSA recalls 10V-385, 12V-193, and 12V-195. If the brackets were not installed properly, the rear axle may fracture, affecting the vehicle handling and increasing the risk of a crash. Ford will notify owners, and dealers will inspect the brackets to verify their proper installation. If a bracket is found to have been misinstalled, the rear axle will be replaced. These repairs will be performed free of charge. The recall is expected to begin October 19, 2015. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 15S27.

**15V-608**

General Motors LLC (GM) is recalling certain model year 2016 Chevrolet Traverse, GMC Acadia, and Buick Enclave vehicles manufactured August 18, 2015 to September 24, 2015. Due to a manufacturing defect, the windshield wiper motor may overheat when used. A wiper motor that overheats increases the risk of a fire. GM has notified owners, and dealers will replace the windshield wiper motor cover assembly, free of charge. Owners are advised not to use their front windshield wipers until the wiper cover has been replaced. If weather conditions prevent operation of the vehicle without using the windshield wipers, GM will make arrangements to pick up the vehicle for servicing. The recall began on September 30, 2015. Owners may contact Chevrolet customer service at 1-800-222-1020, Buick customer service at 1-800-521-7300, and GMC customer service at 1-800-462-8782. GM's number for this recall is 15780.

**15V-609**

Keystone RV Company (Keystone) is recalling certain model year 2016 Retreat recreational trailers manufactured July 13, 2015, to September 24, 2015, and model year 2016 Residence recreational trailers manufactured April 2, 2015, to September 2, 2015. The affected vehicles may have been manufactured with an

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING SEPTEMBER 2015**

*Published October 14, 2015*

insufficient weld on the rear mounting plate that the detachable A-frame is bolted to. If the A-Frame plate detaches from the frame while the vehicle is in motion it can reduce vehicle handling, increasing the risk of a crash. Keystone will notify owners, and dealers will inspect the welds and repair them as necessary, free of charge. The recall is expected to begin October 16, 2015. Owners may contact Keystone customer service at 1-866-425-4369. Keystone's number for this recall is 15-238.

**15V-610**

Ford Motor Company (Ford) is recalling certain model year 2016 Ford F-53 and F-59 stripped chassis trucks manufactured June 1, 2015, to August 11, 2015. Due to an incorrect shift cable bracket and an improper shift cable adjustment, the affected vehicles can be shifted out of 'PARK' without applying the brakes. If the vehicle can be shifted into reverse without the brakes being applied, the vehicle may unintentionally move, increasing the risk of a crash. Ford will notify owners, and dealers will replace the transmission shift control bracket and adjust the transmission shift cable, free of charge. The recall is expected to begin November 9, 2015. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 15S25.

**15V-611**

Tiffin Motorhomes, Inc. (Tiffin) is recalling certain model year 2010-2012 Phaeton motorhomes with floor plans QBH, QKH, and QTH manufactured July 1, 2010, to August 1, 2011. The affected vehicles have an exhaust pipe that is mounted too close to the underside of the floor. Insufficient spacing between the exhaust pipe and the floor may result in the insulation melting and an increased risk of a fire. Tiffin will notify owners, and dealers will change the configuration of the exhaust to provide extra clearance between it and the floor, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Tiffin customer service at 1-256-356-8661. Note: Although these vehicles may have been previously repaired for this condition under recall number 11V-416, it is important that the affected vehicles receive the revised remedy of this recall.

**15V-612**

Daimler Trucks North America LLC (DTNA) is recalling certain model year 2016 Freightliner Cascadia, Business Class M2, 108SD, 114SD, 122SD, Coronado Glider, and Columbia Glider vehicles manufactured June 29, 2015, to September 7, 2015. In the affected vehicles, the steering arm bolts may not be properly tightened. If the steering arm bolts are not properly tightened, the steering arm may separate from the knuckle causing a loss of steering and increasing the risk of a crash. DTNA will notify owners, and Daimler Trucks North America or Detroit Diesel authorized service facilities will inspect the steering arm bolts, tightening them as necessary, free of charge. The recall is expected to begin November 28, 2015. Owners may contact DTNA customer service at 1-800-745-8000. DTNA's number for this recall is FL-691.

**15V-613**

Ford Motor Company (Ford) is recalling certain model year 2015 Ford F-150 trucks manufactured March 18, 2014, to August 6, 2015 and equipped with Adaptive Cruise Control (ACC). While using the Adaptive Cruise Control, the vehicle may falsely detect an obstacle in its path and may unexpectedly apply the brakes. A vehicle that unexpectedly brakes increases the risk of a crash. Ford will notify owners, and dealers will reprogram the cruise control module with updated ACC radar software, free of charge. The recall is expected to begin October 19, 2015. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING SEPTEMBER 2015**

*Published October 14, 2015*

recall is 15S29.

**15V-614**