

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2015**

Published September 28, 2015

CHILD SEATS:

Britax Child Safety, Inc. (Britax) is recalling certain Advocate ClickTight child seats, model numbers E9LT95Q, E9LT95Z, E9LT95N, and E1A025Q, Boulevard ClickTight child seats, model numbers E9LT86F, E1A135Q, E9LT86G, E9LT85Q, E9LT86A, E9LT86H, E9LT85S, E1A015Q, E1A016A, and E1A016H, and Marathon ClickTight child seats, model numbers E1A116L, E9LT76P, E9LT71Q, E9LT76N, E9LT76B, E9LT75R, E9LT76L, E1A006B, E1A005R and EXA116L, manufactured August 1, 2014, to July 29, 2015. The affected child seats have a red harness adjuster button that may stick in the down (harness release) position allowing the shoulder harness to loosen. If the harness loosens, the child may not be properly restrained, increasing their risk of injury in the event of a crash. Britax will notify registered owners and send them a remedy kit that includes a lubricant to apply to the harness adjuster button, free of charge. The recall began on August 14, 2015. Owners may contact Britax customer service at 1-888-427-4829, option 3 or by visiting www.BritaxClickTightConvertibleRecall.com.

15C-003

EQUIPMENT:

Emerson Process Mgmt Regulator Tech, Inc. (Emerson) is recalling certain Fisher Pressure Relief Valves model numbers H732A, H832A, H733, and H833 manufactured from April 9, 2013, through April 24, 2015 and sold as aftermarket or for use as service replacement equipment in cargo tank trailer applications for transporting compressed gases, such as butane or amines. The flow rate of valves with relief setpoints up to 200 psig may be restricted in the event the tank trailer is involved in a crash or other emergency and is exposed to a fire. Without sufficient flow in these conditions, the tank could explode causing serious injury to bystanders. Emerson will notify owners and will provide replacement pressure relief valves free of charge. The recall began on August 17, 2015. Owners may contact Emerson customer service at 1-888-237-1751.

15E-064

Marmon-Herrington is recalling certain drive axles, model numbers MT14, MT17, MT22, R17 and R22, manufactured July 28, 2014, to July 22, 2015. The affected axles are equipped with hex nuts on the flange yoke that may not have been properly tightened. If the hex nuts are not tightened to specification, the driveshaft may disconnect from the drive axle, resulting in a loss of propulsion and increasing the risk of a crash. The remedy for this recall is still under development. The manufacturer has not yet provided a notification schedule. Owners may contact Marmon-Herrington customer service at 1-502-253-0277.

15E-065

Fontaine Fifth Wheel Company (Fontaine) is recalling certain Ultra LT Fifth Wheel connectors, part number SLTPL4000, manufactured July 29, 2009, to May 27, 2013. Over time, use of the fifth wheel connector may result in the locking mechanism failing to properly engage. If the fifth wheel connector lock doesn't properly engage, the trailer may unexpectedly detach from the tractor, increasing the risk of a crash. Fontaine will notify owners, and dealers will replace the fifth wheel with an Ultra NT model fifth wheel, free of charge. The recall is expected to begin in September 2015. Owners may contact Fontaine customer service at 1-844-597-7393.

15E-066

Reyco Granning (Reyco) is recalling certain Independent Front Suspension (IFS) assemblies manufactured April

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2015**

Published September 28, 2015

27, 2011, to February 23, 2015. The affected assemblies may have loose ball joints which could separate causing a loss of steering control. A loss of steering control increases the risk of a crash. Reyco will notify the motorhome and firetruck manufacturers that purchased the IFS assemblies. Those manufacturers will contact the vehicle purchasers and their dealers will correct the ball joint installation, free of charge. The recall began on September 8, 2015. Owners may contact Reyco customer service at 1-800-753-0050.

15E-067

Ricon Corporation (Ricon) is recalling certain model S2005, S2010, S5005, S5010, S5505, and S5510 wheelchair lifts manufactured January 1, 2006, to August 25, 2014. The affected lifts are equipped with folding link arms that may have pivot holes that are too big, allowing the bearings to move out of position. If the bearings move out of position, the stowed platform may have excessive movement resulting in failure of the platform mounting. This failure could cause the wheel chair lift platform to fall out of the vehicle when the doors are opened, increasing the risk of injury for the lift operator. Ricon will notify the purchasers of the lifts, and dealers will inspect the link arms for damage or for displaced bearings. The platform will be inspected for cracks. Any damaged parts will be replaced, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Ricon Customer Service at 1-800-322-2884, or by email at admin15E068@wabtec.com.

15E-068

Alpine Electronics Of America, Inc. (Alpine) is recalling certain Audio Amplifiers, models PDR-F50 and PDR-M65, manufactured December 1, 2013, to July 1, 2015. Due to a manufacturing error, the power circuit board (PCB) may develop an abnormal hot spot. A PCB that overheats increases the risk of a vehicle fire. Apline will notify owners and dealers will replace the amplifier, free of charge. The recall began on September 24, 2015. Owners may contact Alpine customer service at 1-800-733-4101 or visit www.alpine-usa.com/recallpdr.

15E-069

Holley Performance Products, Inc. (Holley) is recalling certain NOS-brand Nitrous Oxide systems manufactured May 1, 2015, to August 17, 2015. The affected nitrous oxide systems have solenoid valves that may fracture when the fuel system is pressurized. If the valve fractures, portions of the valve may become projectiles, increasing the risk of injury to those nearby or possibly damaging other nearby components. Holley will notify owners and will repair or replace the solenoid valves, free of charge. The recall is expected to begin in September 2015. Owners may contact Holley customer service at 1-800-638-0032.

15E-070

TIRES:

Michelin North America, Inc. (MNA) is recalling certain BFGoodrich Commercial T/A All-Season tire size LT275/70R18 125/122Q LRE, BFGoodrich Commercial T/A All-Season 2 sizes LT275/70R18 125/122R LRE, LT235/80R17 120/117R LRE, LT265/70R17 121/118R LRE, LT245/75R17 121/118R LRE, LT245/70R17 119/116R LRE, and BFGoodrich Rugged Terrain T/A sizes LT275/70R18 125/122R LRE and LT275/65R18 123/120R LRE. The affected tires may experience rapid air loss due to a rupture in the sidewall in the bead area. If the tire sidewall ruptures during use resulting in a rapid air loss, it can cause loss of vehicle

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2015**

Published September 28, 2015

control, increasing the risk of a vehicle crash. MNA will notify owners, and dealers will provide similar replacement tires free of charge. The recall began on August 24, 2015. Owners may contact BFGoodrich Consumer Care at 1-866-524-2638.

15T-016

VEHICLES:

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain model year 2010-2014 Volkswagen CC, and Passat, 2010-2013 Eos, 2011-2014 Golf, GTI, Jetta, and Tiguan, and 2012-2014 Jetta Sportwagen vehicles. In the affected vehicles, debris may contaminate the air bag clock spring, a spiral wound, flat cable that keeps the air bag powered while the steering wheel is being turned. This contamination may tear the cable and result in a loss of electrical connection to the driver's frontal air bag. A loss of electrical connection to the driver's frontal air bag will prevent the air bag from deploying in the event of a vehicle crash, increasing the risk of injury. Volkswagen will notify owners, and dealers will install a cover to prevent clockspring contamination. Any clockspring that fails prior to the cover installation will be replaced. These repairs will be performed free of charge. Interim notices were mailed to owners on September 25, 2015. Owners will receive a second notice when parts become available in early 2016. Owners may contact Volkswagen customer service at 1-800-822-8987.

15V-483

Forest River, Inc. (Forest River) is recalling certain model year 2015-2016 Cedar Creek Silver Back recreational vehicles manufactured October 23, 2014, to July 2, 2015. The gross vehicle weight rating (GVWR) that is less than the vehicle's GVWR represented on its certification label. As such, these vehicles fail to comply with the requirements of 49 CFR Part 567, "Certification." Inaccurate weight information can mislead an owner as to the vehicle's weight carrying capacity which could result in vehicle overloading and a crash. Forest River will notify owners, and dealers will install a new set of corrected certification labels, free of charge. The recall began on August 25, 2015. Owners may contact Forest River customer service at 1-260-593-2417. Forest River's number for this recall is 20-07282015-0066.

15V-484

New Flyer Industries Ltd. (New Flyer) is recalling certain model year 2014 NABI 42BRT transit buses manufactured from December 19, 2014, through June 6, 2015, and 2014-2015 NABI 40LFW transit buses manufactured from September 11, 2014, through June 3, 2015. The affected buses are powered with compressed natural gas (CNG) and are equipped with pressure relief devices (PRD) that may not function as designed, failing to vent a buildup of pressure, such as could occur if the CNG tank was exposed to fire. If the PRD does not activate in the event of a build up of pressure, the CNG tank may explode, increasing the risk of fire and injury. New Flyer has notified owners, and Agility, supplier of the CNG system, will replace the PRDs, free of charge. The recall began on August 17, 2015. Owners may contact New Flyer customer service at 1-204-224-1251. New Flyer's number for this recall is R15-012.

15V-485

Nissan North America, Inc. (Nissan) is recalling certain model year 2016 Nissan Maxima vehicles manufactured

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2015**

Published September 28, 2015

March 19, 2015, to June 2, 2015. In the affected vehicles, due to an improperly installed o-ring that may not have been seated correctly at the time of assembly, fuel may leak during a crash from the area where the fuel sending unit attaches to the fuel tank. If fuel leaks from between the fuel sending unit and the tank, it may increase the risk of a fire in the event of a crash. Nissan will notify owners, and dealers will install a retainer ring between the fuel tank and the fuel sending unit. The recall is expected to begin on September 29, 2015. Owners may contact Nissan customer service at 1-800-647-7261.

15V-486

Forest River, Inc.(Forest River) is recalling certain model year 2015 Palomino PaloMini vehicles manufactured November 14, 2014, to July 23, 2015. The cambers in the axle tubes may have been installed upside down. This can cause the tube to appear bent downward towards the ground, when the bend should be pointing upwards to the unit floor. A mispositioned camber may come in contact with a tire, a spindle or other components leading to fracture or failure, and increasing the risk of a crash. Forest River will notify owners, and dealers will inspect and reposition any mispositioned cambers, free of charge. The recall began on August 21, 2015. Owners may contact Forest River customer service at 1-260-593-2417. Forest River's number for this recall is 400-07282015-0065.

15V-487

Ameritrans Bus, Inc. (Ameritrans) is recalling certain model year 2015 225 vehicles manufactured on a Ford E-350 chassis from February 1, 2015, through March 31, 2015. The affected vehicles are equipped with a back up camera system which may display images from the camera in reverse. If an object or person are on the left side of the screen but are actually on the right side of the vehicle, or vice versa, there is an increased risk of a crash. Ameritrans will notify owners, and dealers will replace the camera, free of charge. The recall began on September 21, 2015. Owners may contact Ameritrans customer service at 1-574-262-8935. Ameritrans' number for this recall is 15E050.

15V-488

Felling Trailers, Inc (Felling) is recalling certain model year 2016 FT-6T tilting trailers manufactured from February 15, 2015, through June 30, 2015. Due to an improper placement of the fender, the tires on affected trailers may rub against the fenders. If the tire rubs on the fender, tire damage may occur, possibly causing tire failure and increasing the risk of a crash. The remedy for this recall is still under development. The manufacturer has not yet provided a notification schedule. Owners may contact Felling customer service at 1-888-335-5464.

15V-489

Winnebago Industries, Inc. (Winnebago) is recalling certain model year 2012-2016 Winnebago Era recreational vehicles manufactured November 11, 2010, to July 20, 2015. The certification label affixed to the vehicles provide an incorrect front tire inflation pressure. Accordingly, these vehicles fail to comply with the requirements of 49 CFR Part 567, "Certification." Incorrect tire pressure information could cause an owner or operator to under or over inflate the tires, increasing the risk of a tire failure and a crash. Winnebago will notify owners, and dealers will provide new certification labels with the correct tire inflation pressure specifications, free of charge. The recall began on September 18, 2015. Owners may contact Winnebago customer service at 1-641-585-3535.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2015**

Published September 28, 2015

15V-490

Newmar Corporation (Newmar) is recalling certain model year 2015-2016 Essex and King Aire vehicles manufactured March 7, 2014, to June 15, 2015, and 2016 Mountain Aire vehicles manufactured March 9, 2015, to June 5, 2015. The control module for the air suspension may experience a loss of power resulting in the air suspension not being able to achieve ride height. If the ride height of the suspension is less than specified ride height the vehicle may be difficult to control, increasing the risk of a crash. Newmar will notify owners and Spartan Motors will repair the motor homes free of charge. The recall began on August 5, 2015. Owners may contact Newmar customer service at 1-800-731-8300.

15V-492

Forest River, Inc. (Forest River) is recalling certain model year 2015-2016 XLR vehicles, models T29HFS, T31FDK, T31FQSL, T30FQSL, T21FQSL, T24FQSL, T24HFS, T27HFS, T28TQDL and T30HDS, manufactured October 20, 2014, to July 14, 2015. In the affected vehicles, the wiring at the electrical inlet used for connecting external AC power to the trailer may have been strained during the assembly process. As a result, the wiring may loosen at the inlet connector. If the wires are not properly secured to the connector, the wires may arc, increasing the risk of a vehicle fire. Forest River will notify owners, and dealers will rewire the inlet to relieve the wiring strain and secure the electrical wiring connections, free of charge. The recall began on August 25, 2015. Owners may contact Forest River customer service at 1-574-642-0437. Forest River's number for this recall is 51-07302015-0068.

15V-493

Turtle Top is recalling certain model year 2012 Van Terra XL transit bus manufactured October 13, 2012, to February 7, 2013, and 2012 Odyssey XL MPV transit bus manufactured May 2, 2011, to October 4, 2011, which fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) No. 217, "Bus Emergency Exits and Window Retention and Release." The windows may not meet minimum loading requirements. Windows that do not meet minimum loading requirements are at an increased risk of breaking and falling onto a passenger when pushed by passengers or objects. Turtle Top will notify owners, and dealers will install a newly designed catch and handle combination. Repairs will be made free of charge. The recall began on September 8, 2015. Owners may contact Turtle Top customer service at 1-574-831-4340.

15V-494

Starcraft RV (Starcraft) is recalling certain model year 2015-2016 Launch Ultra Lite vehicles manufactured June 17, 2014, to July 23, 2015. The furnaces equipped on the trailers may not have been secured properly and could separate from the exhaust. Hazardous exhaust fumes could be released into the cabin area, sickening and injuring any occupants. Starcraft will notify owners, and dealers will inspect the furnace, and if necessary secure the furnace to the floor platform, free of charge. The recall began on August 25, 2015. Owners may contact Starcraft customer service at 1-800-945-4787. Starcraft's number for this recall is 9902246.

15V-495

Forest River, Inc. (Forest River) is recalling certain model year 2014-2015 Vengeance vehicles manufactured December 20, 2013, to November 3, 2014. The gross vehicle weight rating (GVWR) is less than the vehicle's

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2015**

Published September 28, 2015

GVWR represented on its certification label. As such, these vehicles fail to comply with the requirements of 49 CFR Part 567, "Certification." A customer may be confused as to actual GVWR of the vehicle, as well as the vehicle's load carrying capacity. Misinformation as to load carrying capacity can lead to vehicle overloading that can cause a tire failure and crash. Forest River will notify owners, and dealers will install a new corrected certification label, free of charge. The recall began on August 31, 2015. Owners may contact Forest River customer service at 1-219-533-5934. Forest River's number for this recall is 17B-08032015-0069.

15V-496

Volvo Cars of N.A., LLC (Volvo) is recalling certain model year 2016 Volvo XC90 vehicles manufactured January 27, 2015, to July 10, 2015. The third row seating side curtain air bags may not fully inflate. Underinflated air bags may not fully protect third row occupants, increasing the risk of injury in the event of a crash. Volvo will notify owners, and dealers will modify the D-pillar interior panels to allow full inflation of the third row airbags, free of charge. The recall began on September 21, 2015. Owners may contact Volvo Customer Care at 1-800-458-1552.

15V-497

LGS Industries Inc. (LGS) is recalling certain model year 2015-2016 Look trailers, models ST, Element, Vision, LXT, Element Puresport, Element Puresport Deckover, Vision Puresport, Vision Puresport Deckover, Element Motorcycle, and Vision Motorcycle, 2015-2016 Pace trailers, models Outback, Journey, Cargo Sport, PXT, Aerosport, Aerosport Deckover, Journey Motorcycle, and Legacy Motorcycle, and 2015-2016 Cargo Express cargo trailers, models EX, XL, PRO, CXT, XL Yukon, XL Yukon Deckover, Pro Sport, Pro Sport Deckover, XL Motorcycle, and Pro Motorcycle. The affected trailers have a gross vehicle weight rating (GVWR) of 5,000 pounds or less, and were manufactured November 4, 2014, to July 27, 2015. The Ram 2" A Frame Coupler used to secure the trailer to the tow vehicle may have been manufactured improperly, preventing the external latch from fully locking into place. If the coupler's latch does not fully engage, the trailer may separate from the tow vehicle, increasing the risk of a vehicle crash. LGS will notify owners, and dealers will inspect and repair the coupler, as necessary, free of charge. The recall is expected to begin September 30, 2015. Owners may contact LGS customer service at 1-877-475-5665.

15V-498

Keystone RV Company (Keystone) is recalling certain model year 2014-2015 Keystone Avalanche recreational vehicles, model 355RK, manufactured from May 6, 2013, through April 24, 2014. The affected vehicles may be equipped with a rear window that has a sticker labeling it as an emergency exit sticker. However, this window may be partially blocked by the rear ladder and was not intended to be a secondary emergency exit. In the event of an emergency, occupants could try to escape through the rear window, but would not be able to. This delay in their escape may increase the risk of injury. Keystone has notified owners, and dealers will remove the emergency exit sticker, free of charge. The recall began on August 17, 2015. Owners may contact Keystone customer service at 1-866-425-4369. Keystone's number for this recall is 15-233.

15V-499

General Motors LLC (GM) is recalling certain model year 2010 Chevrolet Cobalt vehicles manufactured January 4, 2010, to June 23, 2010. The affected vehicles may be equipped with an improperly routed Side-

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2015**

Published September 28, 2015

Impact Sensor (SIS) wiring harness in the driver side front door. The misrouted wiring harness could cause an electrical short that disables the driver side curtain air bag. A disabled driver side roof-rail air bag will not deploy in the event of a crash necessitating deployment of that air bag, increasing the risk of injury to the driver. GM will notify owners, and dealers will inspect the sensor's wiring in the driver's door and make repairs as necessary, free of charge. The recall began on September 8, 2015. Owners may contact Chevrolet customer service at 1-800-222-1020. GM's number for this recall is 15075.

15V-500

Nissan North America, Inc. (Nissan) is recalling certain model year 2015 Nissan Armada vehicles manufactured April 30, 2015, to June 5, 2015. The affected vehicles may have been built with driver or front passenger seat belt assemblies that may not properly latch or that may not unlatch when the release button is pressed. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 208, "Occupant Crash Protection" and number 209, "Seat Belt Assemblies." A seat belt that does not properly latch would not restrain a user, increasing their risk of injury in the event of a crash. A seat belt that does not properly unlatch when the release button is pressed may prevent the occupant from quickly exiting the vehicle in an emergency, such as after a crash, increasing their risk of injury. Nissan will notify owners, and dealers will inspect the both front seat belt buckle assemblies, replacing them as necessary, free of charge. The recall is expected to begin by early October 2015. Owners may contact Nissan customer service at 1-800-647-7261.

15V-501

Subaru of America, Inc. (Subaru) is recalling certain 2015 and 2016 model year Subaru Legacy 4-Door and Outback vehicles manufactured July 3, 2015, to July 27, 2015. Transmission oil may leak from a deformed seal cap on the propeller shaft yoke. If the transmission oil leaks onto the exhaust pipe, there is a possible risk of fire. Subaru will notify owners, and dealers will replace the propeller shaft, free of charge. The recall began on August 28, 2015. Owners may contact 1-800-782-2783. Subaru's number for this recall is WQU-56.

15V-502

Goshen Coach (Goshen) is recalling certain model year 2014-2015 Pacer, Pacer LS, PacerLTD, GCII, Impulse, Connection, Commander, G-Force, G-Force Access, G-FforceLTD, Sentinel, Sentinel UC, Mainstream Low Floor vehicles manufactured July 1, 2014, to July 27, 2015. The driver and passenger seat mounting space not have been properly tightened. The bolts can come loose and cause the seat to move if involved in a crash. Thus, these vehicles fail to comply with the requirements of the Federal Motor Vehicle Safety Standard (FMVSS) No. 207, "Seating Systems." The failure of the seat to stay in place in the event of a crash increases the risk of injury to the occupant in that seat. Goshen will notify owners, and dealers will inspect and re-tighten the bolts, free of charge. The recall began on September 3, 2015. Owners may contact Goshen customer service at 1-574-970-6300.

15V-503

Mitsubishi Fuso Truck of America, Inc. (MFTA) is recalling certain model year 2012-2015 FEC52 vehicles manufactured February 3, 2011, to March 31, 2015 and 2012-2014 FEC72 and FEC92 vehicles manufactured February 3, 2011, to January 9, 2013. The affected vehicles have brake pad shims that may rust or corrode after exposure to snow and ice melting chemicals that have been applied to roadways. Rust or corrosion will

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2015**

Published September 28, 2015

result in swelling of the shims causing an increased brake pedal stroke. The extra brake travel may lengthen the distance needed to stop the vehicle, increasing the risk of a crash. MFTA will notify owners, and dealers will replace any steel brake pad shims with stainless steel shims, free of charge. The manufacturer has not yet provided a notification schedule. MFTA's number for this recall is C1008010.

15V-504

Mercedes-Benz USA, LLC (MBUSA) is recalling certain model year 2016 Mercedes Benz E350, E400, E400 4Matic, E63 4M S AMG, E350 4Matic, E63-4M S AMG, 2015 CLS400, CLS400 4Matic, CLS550, CLS63-4M "P" AMG, and CLS550 4Matic vehicles manufactured April 16, 2015, to April 22, 2015. The integral steel cable that secures the rubber seal to the bulkhead might have been damaged due to the supplier rework of the rubber seal. In the event the rubber seal is not properly secured around the engine compartment, it is possible for the rubber seal to temporarily stick to the hood when it is opened and then may fall into the engine bay when the hood is closed. If the rubber seal falls into the engine compartment, it may contact parts of the engine or exhaust system, increasing the risk of a fire. MBUSA will notify owners, and dealers will replace the rubber seal, in the engine compartment, free of charge. The manufacturer has not yet provided a notification schedule. MBUSA's number is 2015080001. Owners may contact MBUSA customer service at 1-201-573-5339.

15V-505

Strick Trailers, LLC (Strick) is recalling certain model year 2013 Dry Freight Van Trailers, model number S4280E99NFWOP, manufactured October 1, 2012, to July 15, 2013. As built, the trailers have tires that are more than 12 inches forward of the rear of the trailer. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) No. 224, "Rear Impact Protection." Failing to meet the rear impact protection requirements increases the risk of injury to occupants of a vehicle that collides with the rear of the trailer. Strick will notify owners and will replace the fixed torque arm with an adjustable torque arm allowing for the rearward adjustment of the axle, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Strick customer service at 1-704-436-2590.

15V-506

Nissan North America, Inc. (Nissan) is recalling certain model year 2012-2015 Nissan Versa sedan vehicles manufactured June 9, 2011, to March 11, 2015, and 2014-2015 Nissan Versa Note vehicles manufactured April 23, 2013, to March 11, 2015. The affected vehicles have a center console trim panel that may catch the driver's shoe and delay the transition from the accelerator pedal to the brake pedal. A delay in the application of the brake pedal would lengthen the distance needed to stop the vehicle and increase the risk of a crash. Nissan will notify owners, and dealers will modify the console trim panel, free of charge. The recall is expected to begin by mid-October 2015. Owners may contact Nissan customer service at 1-800-647-7261.

15V-507

Chrysler (FCA US LLC) is recalling certain model year 2015 Jeep Renegade vehicles manufactured September 18, 2014, to June 25, 2015. The affected vehicles are equipped with radios that have software vulnerabilities that can allow third-party access to certain networked vehicle control systems. Exploitation of the software vulnerability may result in unauthorized remote modification and control of certain vehicle systems, increasing the

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2015**

Published September 28, 2015

risk of a crash. Chrysler will notify and mail affected owners a USB drive that includes a software update that eliminates the vulnerability, free of charge. Optionally, owners may download the update to their own USB drive from <http://www.driveuconnect.com/software-update/> or take their vehicle to a Chrysler dealer for immediate installation. In an effort to mitigate the effects of this security vulnerability, Chrysler has had the wireless service provider close the open cellular connection to the vehicle that provided unauthorized access to the vehicle network. This measure may not have been implemented on all vehicles and does not address access by other means that will be remedied by the software update. The recall is expected to begin on October 2, 2015. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is R45.

15V-508

Chrysler (FCA US LLC) is recalling certain model year 2014 Jeep Cherokee vehicles manufactured January 4, 2013, to July 11, 2014. Use of the front windshield wipers on dry glass may cause damage to the body control module (BCM). BCM damage may result in the failure of the windshield wipers, impairing the driver's vision and increasing the risk of a vehicle crash. Chrysler will notify owners, and dealers will install a ground strap to protect the BCM from damage, free of charge. The recall is expected to begin on October 10, 2015. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is R39.

15V-509

Winnebago Industries, Inc. (Winnebago) is recalling certain model year 2014-2015 Winnebago Vista, Brave, Trend, Minnie Winnie, and Itasca Sunstar, Tribute, Viva!, and Spirit vehicles manufactured March 18, 2013, to November 18, 2014. Due to a manufacturing issue, the deadbolt locks installed on the vehicles may become stuck in a locked position. A stuck deadbolt could potentially trap occupants inside the vehicle, increasing the risk of injury. Winnebago will notify owners, and dealers will inspect and repair deadbolts as needed, free of charge. Winnebago issued an interim notification to owners on August 21, 2015. Owners may contact Winnebago customer service at 1-641-585-3535, or TriMark customer service at 1-641-394-3188.

15V-510

Pierce Manufacturing (Pierce) is recalling certain model year 2014-2015 Velocity and Quantum vehicles manufactured from February 10, 2014, through January 8, 2015, and equipped with LED headlamp assemblies. The headlamps on the affected vehicles may flicker when the vehicle is operated in extreme cold temperatures causing the headlights to provide interrupted illumination. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." If the headlights flicker and do not provide steady illumination, other drivers may be confused and the driver may have reduced visibility, increasing the risk of a vehicle crash. Pierce will notify owners, and dealers will replace the headlamps, free of charge. The recall began on September 3, 2015. Owners may contact Pierce customer service at 1-888-974-3723. Pierce's number for this recall is 74B264.

15V-511

Terex South Dakota, Inc. (Terex) is recalling certain model year 2013-2015 Aerial Devices and Digger Derrick trucks manufactured from June 3, 2013, through November 13, 2014. Due to an issue in assembly, the vertical cylinders and, by extension, the outriggers may drift when loaded. Outrigger drifting could result in the platform falling and seriously injuring platform occupants or bystanders. Terex will notify owners, and dealers will install

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2015**

Published September 28, 2015

the orifice and replace the affected valves, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Terex customer service at 1-605-882-4000. Terex's number for this recall is SN619.

15V-512

Halcore Group, Inc. (Halcore) is recalling certain model year 2014-2015 American Emergency Vehicles (AEV) Trauma Hawk emergency vehicles manufactured from December 1, 2014, through June 30, 2015. The affected vehicles are equipped with a back up camera system which may display images from the camera in reverse. If an object or person are on the left side of the screen but are actually on the right side of the vehicle, or vice versa, there is an increased risk of a crash. Halcore will notify owners, and dealers will work with ASA Electronics to replace any camera that is not displaying the correct images. The recall is expected to begin during September 2015. Owners may contact AEV customer service at 1-800-374-9749 or ASA customer service at 1-877-384-4400. Halcore's number for this recall is 15E050.

15V-513

Southeast Toyota Distributors, LLC (SET) is recalling certain model year 2015 Toyota Prius C vehicles manufactured April 20, 2015, to June 30, 2015. In the affected vehicles, the Tire Pressure Monitoring System (TPMS) may be improperly calibrated and, as a result, the TPMS may fail to warn the driver that the tire pressure is low. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) No. 138, "Tire Pressure Monitoring Systems." If the vehicle is driven on underinflated tires, the tires may fail. Sudden tire failure increases the risk of a crash. SET will notify owners, and dealers will recalibrate the TPMS, free of charge. The recall began on September 15, 2015. Owners may contact SET customer service at 1-866-405-4226. SET's number for this recall is SET15E.

15V-514

Southeast Toyota Distributors, LLC (SET) is recalling certain model year 2010-2015 Toyota 4Runner vehicles manufactured March 29, 2010, to July 30, 2015. The affected vehicles may be equipped with accessory exhaust tips installed by SET or SET dealers that may contact people and possibly burn them while they are standing behind the vehicle. Contact with an exhaust tip may result in personal injury. SET will notify owners, and dealers will install a re-designed exhaust tip that is smaller in diameter and is more recessed behind the bumper, free of charge. The recall is expected to begin September 22, 2015. Owners may contact SET customer service at 1-866-405-4226. SET's number for the recall is SET15D.

15V-515

Pierce Manufacturing (Pierce) is recalling certain model year 2014-2015 Pierce Arrow XT, Dash CF, Enforcer, Quantum, and Velocity emergency vehicles manufactured from November 3, 2014, through July 31, 2015. The affected vehicles have a driveshaft that may bend or twist possibly causing it disconnect. If the driveshaft disconnects from the vehicle, the vehicle would have a loss of drive, disabling it on the roadway and preventing the vehicle from responding to an emergency. Additionally, portions of the driveshaft could become a road hazard. These scenarios may increase the risk of a crash. Pierce has notified owners, and dealers will install a stronger driveshaft, free of charge. The recall began on September 15, 2015. Owners may contact Pierce customer service at 1-888-974-3723. Pierce's number for this recall is 74B265.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2015**

Published September 28, 2015

15V-516

Chrysler (FCA US LLC) is recalling certain model year 2014-2015 Ram 1500 diesel 4x2 trucks manufactured August 8, 2013, to July 2, 2015. The affected vehicles have a battery harness that may rub against the frame bracket for the right engine mount resulting in an electrical short. If the harness shorts, the vehicle may stall and there is an increased risk of a fire. Chrysler will notify owners, and dealers will inspect the vehicles to confirm that the battery harness is correctly routed and secured. Any harness that shows evidence of wear will be replaced. These repairs will be performed free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is R43.

15V-517

Grand Design RV, LLC (Grand Design) is recalling certain model year 2014-2016 Reflection fifth-wheel trailers manufactured September 5, 2013, to June 30, 2015. The affected vehicles may have been manufactured with axles rated to 5200 lbs. instead of 6000 lbs. as designed and as listed on the Certification Label. As such, these vehicles fail to comply with the requirements of 49 CFR Part 567, "Certification." The inaccurate label may result in users overloading their trailer, resulting in axle or tire failure and increasing the risk of a crash. Grand Design will notify owners, and dealers will inspect the trailers and will replace any axle that is only rated to 5200 lbs. with an axle rated to 6000 lbs., free of charge. The recall began on September 10, 2015. Owners may contact Grand Design customer service at 1-574-825-8000 ext. 2015. Grand Design's number for this recall is 910004.

15V-518

General Motors LLC (GM) is recalling certain model year 2005 Buick LaCrosse vehicles manufactured May 31, 2004, to June 27, 2005, and 2007 Pontiac Grand Prix vehicles manufactured April 12, 2006, to April 25, 2007. In the affected vehicles, the headlamp driver module (HDM) may overheat and fail, causing the headlamps and daytime running lights to not illuminate. Headlamps that do not illuminate reduce the driver's ability to see the roadway and reduce the vehicle's visibility to oncoming vehicles, both of which increase the risk of a vehicle crash. GM will notify owners, and dealers will replace the HDM, free of charge. Interim notices were mailed to owners on September 2, 2015. Owners will receive a second notice when remedy parts are available. Owners may contact Buick customer service at 1-800-521-7300 or Pontiac customer service at 1-800-762-2737. GM's number for this recall is 14291.

15V-519

BMW North America, LLC (BMW) is recalling certain model year 2012-2015 320i, 320xi, 328i, 328xi, 335i, 335xi, and ActiveHybrid3 vehicles manufactured October 20, 2011, to June 22, 2015, 2014-2015 328xi Sports Wagon vehicles manufactured March 21, 2013, to March 17, 2015, 2014-2015 328d, 328xd vehicles manufactured June 28, 2013, to April 21, 2015, and 2014-2015 328xd Sports Wagon vehicles manufactured July 5, 2013, to April 21, 2015. The affected vehicles may have been programmed with new software that inadvertently makes the front side marker lights inoperative in conjunction with the parking lights or the headlights. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." If the side marker lights do not illuminate, the vehicle may be less visible at night, increasing the risk of a crash. BMW will notify

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2015**

Published September 28, 2015

owners, and dealers will upload revised software to correct the issue, free of charge. The recall is expected to begin October 9, 2015. Owners may contact BMW customer service at 1-800-525-7417 or by email at CustomerRelations@bmwusa.com.

15V-520

Mack Trucks, Inc. (Mack) is recalling certain model year 2013-2015 Pinnacle (CXU) trucks manufactured from October 3, 2012, through February 18, 2014 and equipped with Meritor air disc brakes. In the affected vehicles, the brake chambers may have been incorrectly mounted resulting in internal contamination of the air brake calipers. Contamination of the calipers may cause a loss of brakes on one wheel, lengthening the distance required to stop the vehicle, increasing the risk of a crash. Mack will notify owners. A remedy plan has not yet been determined. Owners may contact Mack customer service at 1-800-866-1177. Mack's number for this recall is SC0392.

15V-521

Mack Trucks, Inc. (Mack) is recalling certain model year 2013 and 2015 Titan (TD), model year 2014 and 2015 Pinnacle (CHU), and model years 2009-2010, 2012, and 2014-2016 Granite (GU) trucks. The chassis harness and air lines may not be properly clipped to the crossmember, which can allow the cables and air lines to fall and get twisted in the driveline. If the electrical cables and air lines were to fall and get tangled in the driveline, it could affect the electrical system and braking system, increasing the risk of a vehicle crash. Mack will notify owners, and dealers will inspect the vehicles and properly clip the harness and air lines, free of charge. The recall is expected to begin during September 2015. Owners may contact Mack customer service at 1-800-528-6586. Mack's number for this recall is SC0393.

15V-522

Volvo Trucks North America (Volvo) is recalling certain model year 2012-2016 VAH trucks manufactured July 11, 2011, to June 25, 2015 and equipped with a sealed drag link. In the affected trucks, the draglink ball socket boot may be damaged due to the angle of the ball stud. A damaged boot may allow contaminants to enter and corrode the ball socket. Corrosion will accelerate wear of the ball, possibly resulting in the ball joint separating from the socket, causing loss of steering and an increased risk of a crash. Volvo will notify owners, and dealers will replace the drag link with one that has an improved geometry, free of charge. The recall is expected to begin by October 13, 2015. Owners may contact Volvo customer service at 1-800-528-6586. Volvo's number for this recall is RVXX1503.

15V-523

Volvo Trucks North America (Volvo) is recalling certain model year 2012-2015 VNL and VNM trucks manufactured May 31, 2011, to December 1, 2014. In the affected trucks, the trailer hand brake handle may not return to the off position due to being restricted by the cut out in the trim panel. If the brake handle does return to the off position, the trailer service brakes may drag causing the wheel end to overheat and potentially cause a wheel end fire or tire blowout. Either condition increases the risk of a crash. Volvo will notify owners, and dealers will inspect the trim panel slot and make it longer, as necessary, free of charge. The recall is expected to begin by October 13, 2015. Owners may contact Volvo customer service at 1-800-258-6586. Volvo's number for this recall is RVXX1504.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2015**

Published September 28, 2015

15V-524

Forest River, Inc. (Forest River) is recalling certain model year 2013-2014 Starcraft All Star XL transit buses manufactured by October 17, 2012, to November 26, 2012, and 2013 Starcraft XLT transit buses manufactured October 14, 2012, to November 26, 2012. The affected vehicles are equipped with Navistar engines that have fuel injectors that may fail. If one or more fuel injectors fail, the engine may misfire, causing a loss of performance, possibly resulting in an engine stall and increasing the risk of a crash. Forest River will notify owners, and Navistar dealers will recalibrate the engine control module (ECM) software, free of charge. The recall began on September 9, 2015. Owners may contact Navistar customer service at 1-800-448-7825 or Forest River customer service at 1-574-389-4600. Forest River's number for this recall is 05-08102015-0071.

15V-525

Turtle Top is recalling certain model year 2014-2015 Odyssey transit buses manufactured March 12, 2014, to June 30, 2015, 2014 Odyssey XLT transit buses manufactured January 15, 2015, to April 22, 2015, and 2014 Van Terra transit buses manufactured May 6, 2014, to June 30, 2015. The affected vehicles are equipped with a back up camera system which may display images from the camera in reverse. If an object or person are on the left side of the screen but are actually on the right side of the vehicle, or vice versa, there is an increased risk of a crash. Turtle Top will work with ASA Electronics to notify owners, and dealers will replace the camera unit, free of charge. The recall began on September 18, 2015. Owners may contact Turtle Top customer service at 1-574-831-4340 or ASA Electronics at 1-877-384-4400. Turtle Top's number for this recall is 15E-050.

15V-526

Forest River, Inc. (Forest River) is recalling certain model year 2013-2014 Starcraft All Star XL, 2013 Starcraft All Star, and XLT transit buses manufactured October 17, 2012, to November 20, 2012. The affected vehicles may have an improperly routed engine grid heater power feed cable which can result in the cable contacting the metal edge on the cab. If the cable contacts the metal edge of the cab, it may cause an electrical short, increasing the risk of a fire. Forest River will notify owners, and dealers will install a cable tie to provide proper clearance for the engine grid heater power feed cable, free of charge. The recall is expected to begin in September 2015. Owners may contact Forest River's customer service at 1-574-389-4600. Forest River's number for this recall is 5-08102015-0072.

15V-527

Mack Trucks, Inc. (Mack) is recalling certain model year 2011-2016 Granite (GU) trucks manufactured September 24, 2011, to July 1, 2015. The affected trucks may be equipped with an air brake system reservoir that does not have a sufficient volume. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 121, "Air Brake Systems." If the air brake system reservoir has an insufficient volume, braking performance may be affected, increasing the risk of a crash. Mack will notify owners, and dealers will add additional air brake reservoir volume, free of charge. The recall is expected to begin by October 13, 2015. Owners may contact Mack customer service at 1-800-866-1177. Mack's number for this recall is SC0394.

15V-528

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2015**

Published September 28, 2015

E-One Incorporated (E-One) is recalling certain model year 2013-2016 E-One Pumpers, Tankers, and Rescue vehicles manufactured using International truck chassis from May 5, 2012, to May 16, 2015. The vehicles are equipped with a manual master body power disconnect switch that activates various side and rear lights as well as the sirens. However, the switch was not linked to the vehicle start circuit, such that an operator may operate the vehicle without the requisite lighting. An emergency vehicle operated without side and rear lighting, its sirens, or warning lights, increases the risk of a crash and injury to its and other vehicle occupants. E-One will notify owners, and dealers will install a relay that will interlock with the engine start circuit so the vehicle cannot be operated until the switch has been engaged, free of charge. The recall is expected to begin during September 2015. Owners may contact E-One customer service at 1-904-237-1122.

15V-529

Thor Motor Coach (TMC) is recalling certain model year 2016 Axis and Vegas recreational vehicles manufactured March 26, 2015, to July 6, 2015. In the affected vehicles, the heating, ventilation and air conditioning control may lock on one setting, preventing the the operator from changing the air flow, thereby eliminating the ability to defrost the windshield. If the windshield cannot be defrosted, the driver's visibility may be affected, increasing the risk of a crash. TMC has notified owners, and dealers will install a jumper harness to prevent the condition, free of charge. The recall began on September 1, 2015. Owners may contact TMC customer service at 1-877-500-1020. TMC's number for this recall is RC000103.

15V-530

Thor Motor Coach (TMC) is recalling certain model year 2014-2015 Tuscany XTE motorhomes manufactured March 28, 2013, to February 27, 2015. In the affected vehicles, the dinette convertible table top insert may slide out of position allowing the insert to flip up if it is sat on. If the insert flips up when sat on, the occupant may fall, increasing the risk of injury. TMC has notified owners, and dealers will install an additional support bracket to slide the table insert into, preventing the insert from flipping up, free of charge. The recall began on September 1, 2015. Owners may contact TMC customer service at 1-877-500-1020. TMC's number for this recall is RC000104.

15V-531

Oshkosh Corporation (Oshkosh) is recalling certain model year 2014-2015 S-Series concrete mixers manufactured July 16, 2014, to June 30, 2015. The affected concrete mixers are powered with compressed natural gas (CNG) and are equipped with pressure relief devices (PRD) that may not function as designed, failing to vent a buildup of pressure, such as could occur if the CNG tank was exposed to fire. If the PRD does not activate in the event of a buildup of pressure, the CNG tank may explode, increasing the risk of fire and injury. Oshkosh will notify owners, and dealers will inspect and replace the PRD's, as necessary, free of charge. The recall is expected to begin in September 2015. Owners may contact Oshkosh customer service at 1-888-686-7278. Oshkosh's number for this recall is Emcara 15E-059.

15V-532

Ford Motor Company (Ford) is recalling certain model year 2011-2013 and 2015 Ford F-650, and F-750 trucks manufactured February 14, 2011, to April 28, 2015, and equipped with a 70% fixed bench passenger seat. The affected vehicles have passenger seat belt anchorage floor attachments that are not installed in the

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2015**

Published September 28, 2015

correct location. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 210, "Seat Belt Assembly Anchorages." Seat belt anchors that are installed in an incorrect location may increase the risk of occupant injury in the event of a crash. Ford will notify owners, and dealers will correct the seat belt anchorage locations, free of charge. An interim notice will be mailed on September 21, 2015. When the remedy plan has been finalized and repair parts are available, owners will be mailed a second notice. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 15C09.

15V-533

Chrysler (FCA US LLC) is recalling certain model year 2014-2015 Ram 1500 Quad Cab trucks manufactured August 26, 2013, to August 8, 2015. The affected vehicles are equipped with side air bag inflatable curtains (SABIC) that may not fully overlap the C-pillars in the event of a vehicle crash. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 226, "Ejection Mitigation." In the event of a vehicle crash, if a SABIC does not inflate as intended, there is an increased risk of injury to the rear seat occupant. Chrysler will notify owners, dealers will inspect the right and left side air bag inflatable curtains (SABIC) for proper orientation and a foil patch will be installed on both sides of the headliner. One or both of the air bag inflatable curtains (SABIC) will be replaced if necessary. The recall is expected to begin during September 2015. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is R47.

15V-534

Strick Trailers, LLC (Strick) is recalling certain model year 2014 Van Trailers manufactured November 12, 2013, to December 9, 2013, and equipped with SAF-Holland-brand CBX Trailer Suspension Air Ride Axle Systems. The trailer suspension has pivot bolts that may fail at the point where the bolt head meets the body of the bolt. Failure of the pivot bolts may cause the suspension and attached axle to separate from the trailer, increasing the risk of a crash. Strick has notified the owners, and SAF-Holland has arranged for delivery of one repair kit per axle free of charge. SAF-Holland will reimburse the owner for the labor required to install the repair kits. The recall began September 17, 2015. Owners may contact Strick customer service at jlontz@diamatrix.net or 1-704-436-2590. Note: This recall supercedes recall 14V-497.

15V-535

McNeilus Truck & Manufacturing, Inc. (McNeilus) is recalling certain model year 2010-2015 Zero Radius (ZR) Side-Loader Refuse Trucks, model 48, manufactured January 1, 2010, to April 10, 2015. The affected trucks are equipped with an air actuated transit arm latch that may loosen over time, causing the transit arm latch to unintentionally release, allowing the arm to extend beyond the overall width of the vehicle. If the latch arm unexpectedly extends from the side of the vehicle, there is an increased the risk of a crash. McNeilus will notify owners, and fleet service technicians will install a new a chain style transit arm latch that will keep the arm from drifting, free of charge. The recall is expected to begin in September 2015. Owners may contact McNeilus customer service at 1-888-686-7278. McNeilus' number for this recall is VSR-TSB-008.

15V-536

McNeilus Truck & Manufacturing, Inc. (McNeilus) is recalling certain model year 2014-2015 CNG Refuse and

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2015**

Published September 28, 2015

Concrete trucks manufactured July 30, 2014, to July 10, 2015. The affected vehicles are powered with compressed natural gas (CNG) and are equipped with pressure relief devices (PRD) that may not function as designed, failing to vent a buildup of pressure, such as could occur if the CNG tank was exposed to fire. If the PRD does not activate in the event of a buildup of pressure, the CNG tank may explode, increasing the risk of fire and injury. McNeilus will notify owners, and dealers will inspect and replace the PRD's, as necessary, free of charge. The recall is expected to begin in September 2015. Owners may contact McNeilus customer service at 1-888-686-7278. McNeilus' number for this recall is Emcara: 15E-059.

15V-538

East Manufacturing Corp. (East) is recalling certain model year 2014-2016 Refuse, Dump, Dolly Tipper Genesis, Frame Genesis, Frameless Genesis, Frame S&P, and Truck Dolly trailers manufactured August 26, 2013, to February 24, 2015. The affected trailers may have an insufficient amount of grease in the wheel end hubs. If there is a lack of grease in the wheel end hubs, the wheel bearings may overheat, increasing the risk of a vehicle fire. There is also the possibility that the wheel can come off the vehicle, increasing the risk of a crash. East will notify owners, and dealers will inspect and add more grease to the wheel end hubs, as necessary, free of charge. The recall began on September 9, 2015. Owners may contact East customer service at 1-330-325-8204.

15V-539

Spartan Motors USA (Spartan) is recalling certain model year 2012-2013 Gladiator and MetroStar emergency vehicles manufactured March 4, 2013, to May 30, 2013. In the affected vehicles, the front splay rails may crack. If the front splay rails crack, they may separate, causing the cab to collapse when it is being raised, increasing the risk of injury to those nearby. The remedy for this recall is still under development. The recall is expected to begin in September 2015. Owners may contact Spartan customer service at 1-517-543-6400. Spartan's number for this recall is 15019.

15V-540

Chrysler (FCA US LLC) is recalling certain model year 2014 Ram 2500 trucks and 2013-2014 Ram 3500 trucks and cab chassis manufactured October 9, 2012, to July 29, 2014. The affected vehicles may have inadequate welds securing the front track bar frame brackets, which may result in the bracket components separating from the frame. If the bracket components separate from the frame, the vehicle may be more difficult to steer and control, increasing the risk of a crash. The remedy for this recall is still under development. The recall is expected to begin October 9, 2015. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is R46.

15V-541

Chrysler (FCA US LLC) is recalling certain model year 2013-2015 Dodge Dart vehicles manufactured February 24, 2012, to June 16, 2015. The affected vehicles may experience failure of the transmission control module (TCM), causing the transmission to unexpectedly shift into neutral. If the transmission shifts into neutral, it can cause loss of motive power, increasing the risk of a vehicle crash. Chrysler will notify owners, and dealers will replace the TCM and bracket, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is R42.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2015**

Published September 28, 2015

15V-542

Strick Trailers, LLC (Strick) is recalling certain model year 2001 Van Trailers manufactured October 11, 2000, and 2009 Van Trailers manufactured March 12, 2008, to March 17, 2008. The affected trailers may be equipped with rear impact guards that may not be strong enough to prevent a vehicle from traveling under a trailer in the event of a crash. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) No. 223, "Rear Impact Guards." If the trailer is rear ended by a automobile, the guard may fail to prevent the automobile from traveling under the trailer, increasing the risk of injury to the driver of the automobile. Strick will notify owners, and fleets will add reinforcements to the gussets, free of charge. The remedy parts are not available, but owners will receive an interim notification starting late October 2015. A second notice when the remedy parts are available, currently expected to be before the end of 2015. Owners may contact Strick customer service at 1-260-692-1300.

15V-543

Corp. Micro Bird Inc. (Micro Bird) is recalling certain model year 2013-2015 G5 transit buses manufactured March 25, 2013, to May 1, 2015. In the affected buses, the positive battery feeder stud that is attached to the positive cable in the battery box may prematurely corrode. Additionally, bolts designed to mount the battery box may also be missing. If the feeder stud is corroded, a short circuit may result, increasing the risk of a fire. If the battery box mounting bolts are missing, the battery and box may detach causing damage to other components. Micro Bird will notify owners, and dealers will replace the feeder stud components and install a protective cap to prevent corrosion, free of charge. Any missing battery box bolts will be installed. The recall began on September 22, 2015. Owners may contact Micro Bird customer service at 1-819-477-2012 extension 364. Micro Bird's number for this recall is 15-060-BUC.

15V-544

Corp. Micro Bird Inc. (Micro Bird) is recalling certain model year 2013-2015 G5 school buses manufactured March 25, 2013, to May 1, 2015. In the affected buses, the positive battery feeder stud that is attached to the positive cable in the battery box may prematurely corrode. Additionally, bolts designed to mount the battery box may also be missing. If the feeder stud is corroded, a short circuit may result, increasing the risk of a fire. If the battery box mounting bolts are missing, the battery and box may detach causing damage to other components. Micro Bird will notify owners, and dealers will replace the feeder stud components and install a protective cap to prevent corrosion, free of charge. Any missing battery box bolts will be installed. The recall began on September 22, 2015. Owners may contact Micro Bird customer service at 1-819-477-2012 extension 364. Micro Bird's number for this recall is 15-060-BUS.

15V-545

Mitsubishi Motors North America, Inc. (Mitsubishi) is recalling certain model year 2014-2015 Lancer Evolution vehicles manufactured January 31, 2014, to September 5, 2014, and 2014-2015 Lancer Ralliart vehicles manufactured February 3, 2014, to September 5, 2014. The affected turbocharged vehicles have a right parking brake cable that may contact the fuel tank, wearing away the tank's protective coating. Without the protective coating, the fuel tank may rust and leak. A fuel leak in the presence of an ignition source increases the risk of a fire. Mitsubishi will notify owners, and dealers will replace the right parking brake cable, and inspect the fuel

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2015**

Published September 28, 2015

tank, free of charge. If the fuel tank's exterior coating shows signs of damage from abrasive contact with the right parking brake cable, the fuel tank will also be replaced, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Mitsubishi customer service at 1-888-648-7820. Mitsubishi's number for this recall is SR-15-009.

15V-546